

1. COUNTY CODE 084,			2. DISTRICT CODE/NAME 0160,				3. FACILITY CODE/NAME NEW BERLIN HIGH/JR HIGH BUILDING								
Item I.D.	Location(s) (Room No)	Rule Violated	Description of the violation	Recommendation to correct violation	Action I.D.	Priority Code	Specification(s)	Units Of Measure	Quantity	Labor Code	Estimated Cost	ISBE Adjustment	Estimated Completion Date	Funding Type	
1	Roof (See Description and Roof Plan for Locations)	IPMC 304.1.1.8	Roof system (EPDM) has failed over roof section 12. Water is entering the building causing additional damage inside the facility. Roof deficiencies found include field seams unadhered, ponding water, drain failure, perimeter edge metal rusting, soft areas under foot, insulation damage, buckled insulation, roof membrane unadhered. Wet insulation is present, full extent is unknown.	Remove existing roof system in its entirety (including edge metal) down to the deck. Install new membrane roof system and edge metal.	b	b.	Remove existing roof system in its entirety (including edge metal) down to the deck. Install new membrane roof system and edge metal.	sf	11600	2	\$208,800.00		9/1/2024	F	

Violation / Work Item Listing