CENTRAL MONTESSORI SCHOOL/ DISTRICT ADMINISTRATION

Use:

PK-4

Built:

1948

Additions + Renovations:

1963 / 1988

Total Building Area:

68,400 SF

Site Area:

28 Acres

Enrollment:

345 students

Square Footage per Student:

145.1* sf/student

Renovation Cost:


\$18,257,287


Current Replacement Value [CRV]: \$21,888,000


Facility Condition Index (FCI):

83%

^{*} Calculation based on school building's square footage only.

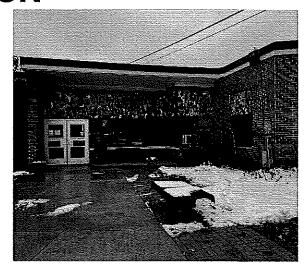

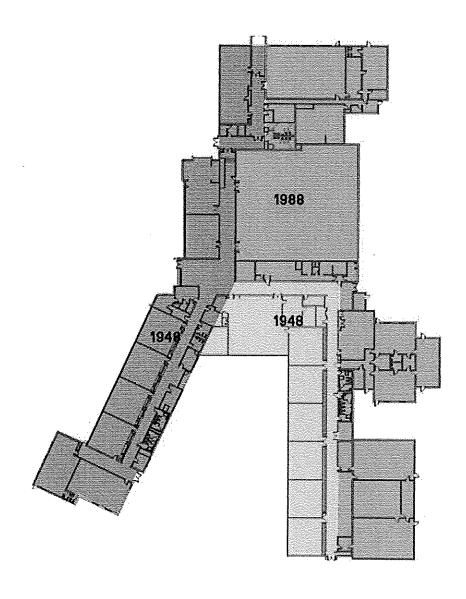

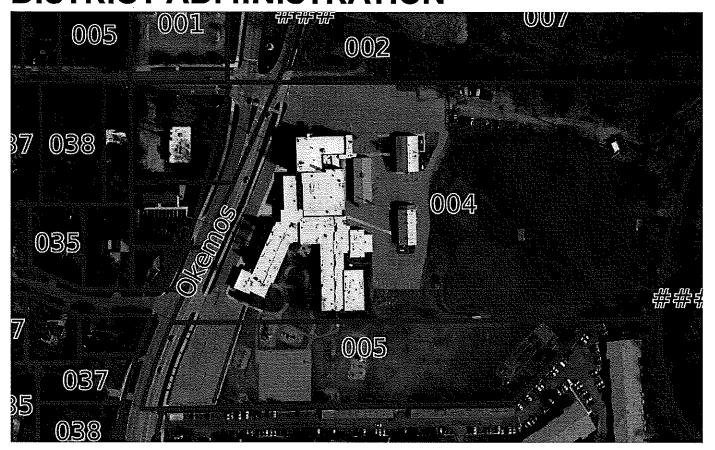



OBSERVATION HIGHLIGHTS

SITE

Student drop-off is located at the back of the building. This circulation is convoluted and conflicts with the adjacent Operations/Tech/Grounds functions. Dumpsters are scattered along the north side of the building, including adjacent to the main student drop-off. Current construction in progress at Okemos and Mt. Hope intersection. This intersection serves as the main exit for the Central Elementary and Administration buildings.

ARCHITECTURE

At the Montessori school, most exterior windows, entrance canopies, upper metal soffits and fascia are all in need of upgrades. Most exterior doors and frames have been upgraded to aluminum thermally broken products and are in good shape. The auxiliary entrance on the north end of the Montessori school, which provides access to the building elevator needs to be upgraded. Currently, visitors must call the main office from the exterior for access inside. Exterior chimney at the Administration building should be removed and taken out of service. North entrances to ground level kitchen and cafeteria are below grade, access from the north parking lot is down a set of exterior stairs. Water infiltration, snow and ice are a challenge at these locations for maintenance staff to monitor and control. Current masonry on exterior walls at the Administration building is in decent shape, no significant signs of deterioration. The exterior windows and aluminum framing should be considered for replacement based on age and current performance of non-thermally broken products.

INTERIORS

Toilet room updates have been performed at most locations in the Administration building. Toilet room upgrades needed at the Montessori Elementary. Flooring and ceilings should be considered for upgrades and replacement. Most interior doors and frames throughout the campus are in decent shape. Current mezzanine space adjacent to the gym being used as classroom space needs to be evaluated for ADA compliance with entrance and egress. Lockers in the Montessori Elementary need to be removed and upgraded. The students from the Montessori school proceed from their classrooms, through the corridors to use the kitchen and cafeteria located on the ground floor of the Administration building. Another item to consider are the current handrails used in the Administration building stairwells. These will need to be addressed, overall height from finish floor to top of handrail too low and current pipe used as the handrail not acceptable per current building codes.

MECHANICAL

Add cooling to the Elementary office. Provide controls to existing finned-tube. Replace air-handling units [2-3,500 cfm] and the rooftop unit [8.5-ton]. All exhaust fans should be replaced. Replace partial pneumatic controls with new DDC and upgrade the balance of the DDC controls. The two tunnel sumps, all plumbing fixtures, sanitary, and domestic piping need to be replaced.

ELECTRICAL

Interior and exterior lighting fixtures are fluorescent or in poor condition and need to be replaced. Exit signs have faded lettering and need to be replaced. All interior lighting controls are toggle switches and need to be updated to modern controls and better energy efficiency. The majority of the panelboards are in good shape and do not need to be replaced.

TECHNOLOGY

The MDF is a shared space with storage and should be a dedicated space. Fiber optic cabling between IT rooms is antiquated and needs updating. Synchronized clock system does not exist. Paging system needs to be upgraded. Gym & cafe need new AV systems. Security cameras & VMS needs updating.

RECOMMENDATION SUMMARY

This building is not a good candidate for significant investment in the existing facility. Significant renovations are required at this facility to bring it up to an overall "good" condition rating. This is the oldest building in the facility inventory and does not lend itself to easily accept improvements, modifications, or additions. Taking this building offline in the near to mid-range planning should be considered.



DATA SHEETS

Facility Assessment

Building Name

Central Montessori/District Admin

Good = Item meets current and future needs, no recommendation for improvement for the next 10 years
Fair = Item meets current use, showing signs of age and should be replaced in the next 10 years
Poor = Item is nearing the end of it's useful life, current need, should be replaced in the next 3-5 years

SITE		1000		good
				There is a drainage issue at the south-west corner of the building, water
Drainage		X		pools at this location during heavy rains.
Asphalt Parking/ Drives	X		Ī	Asphalt pavement in good condition throughout.
Sidewalks		Х		Some cracking along main drop-off location.
Adequate Parking		х		Parking is scattered throughout
Bus Loop				N / A - no bus service
				Playground equipment is showing its age and should be replaced in the near
Playgrounds		х	Х	term.
				Student drop-off is located at the back of the building. This circulation is
				convoluted and conflicts with the adjacent Operations/Tech/Grounds
Student Drop off Area			х	functions.
Landscaping			Х	
Irrigation Systems				N/A - no irrigation present
Athletic fields		х		Athletic fields are low and general hold water.
Fencing			Х	
Signage			Х	
				Dumpsters are scattered along the north side of the building, including
Dumpster Location			X	adjacent to the main student drop-off.

ARCHITECTURAL	\(\frac{1}{2}\)	(3)	god comments
Building Shell			
			Central Elementary 2005 Single-ply membrane. New roofing installed in 2016
Roofing	х		Firestone single-ply membrane. District reports no issues.
			Administration: original aluminum windows with interior blinds and vision
			and spandrel glass to be replaced. Integral frames with mech louvers present.
Exterior Windows	х		School: aluminum windows should be replaced.
			Administration: (2) ground floor doors allow water to enter cafeteria and
			kitchen area during heavy rains. Trench drains to be added at bottom of
			exterior stairs. School: Classrooms on the south end of each major wing have
			tunnel access with sump pumps to remove overflow rain from large rain
Positive Drainage	х		events.
			Canopy at the Administration entrance on the north side. School entrance is
			identifiable on the west side of building but there is no parking adjacent to
Defined Entry	Х	0.00	the entrance.



ARCHITECTURAL (CON'T)	Z	/s/s/	<i>(</i> >)	port comments
				ADA accessibility poor. Administration entrance (north entrance) is not
	_			barrier free accessible. The only barrier free access is at the west entrance,
				away from both administration and school main entrances. There is no
				barrier free parking near the accessible entrance. Many level changes in the
				building. Need to review barrier free emergency egress from all levels.
				Corridor to west entrance on lower level is too narrow for barrier free access
				and egress. The classroom located in the old gym mezzanine does not have
Accessibility			×	barrier free access.
		2.12		Canopy at north entrance should be removed and replaced. Wood fascia and
Fascia/Soffits			X	soffits at the school building should be replaced with prefinished metal trim.
				Brick masonry at administration and school outgries in good condition
				Brick masonry at administration and school exterior in good condition. Cleaning/joint care/tuckpointing/some small repairs and replacements could
				be completed. Consider removal of "chimney" on roof of administration.
Brick / CMU		x		Administration walls not energy efficient. CMU at school to be repainted.
Wall panels			×	Wall panels at window infill to be replaced.
Caulk Joints		34,466	^	woir pancis as window min to be replaced.
Cauk Joines				Admin building - can be seen on cast stone pieces. Central Mont - can be seen
				on CMU (south elevation of wings) and some of the roof edge metal around
Water Stains		x l		the perimeter of the building
				Decent aluminum frames/electronic locksets present. Not all entrances have
			9	barrier free access and snowmelt concrete should be considered at all
Exterior Doors		х		locations.
				Not present at most locations including Administration building. Main
				entrance to Central Montessori has exterior secure entrance doors but no
Vestibule Entries			x	secure vestibule entrance
				Found in some locations of the Admin building - should be considered for
Glass Block			×	removal and replacement with windows.
Chimney			×	Remove Chimney (not sure if still functional) on Admin building,
				Located around Central Mont windows and could be removed and replaced
Transite Panels			X	with larger window frames.

INTERIORS / FINISHES		pob silly	comments
Corridors			
Lights		×	Upgrade - old/performance/bulb retrofits/lighting controls.
Flooring		X	Replace all flooring (carpet & VCT). Terrazzo floor in fair condition.
			Replace 2x4 grid/pads/lights in Administration, Some school ceilings are in
			fair condition - selective replacement. Plaster walls in Administration (minor
			cracks to be repaired.), brick in good condition, wood walls need to be
Ceiling/Walls		×	refinished.
			Built-in lockers in school corridors. School would like them removed and new
Lockers		x	reinstalled. Build in metal lockers in CMU walls (extensive work)
			Building received electronic locking hardware upgrades (district wide).
			Administration office doors are in good condition but door knobs should be
		1	replaced with levers. Doors in lower level of Administration should be
			replaced (childcare, cafeteria, gym). Old/no door closers/some doors in
Doors		×	Admin building have 'knob' hardware.
			Most buildings have 'good' adequate corridor size (overall width), works with
			traffic flow, free egress, emergencies. District did not report any issues here
Size of Corridor	x		or at any other buildings in regards to this
			No issues with flow reported. Central Montessori has two major wings
Flow of Corridor	x		connected by passageway at main office.

INTERIORS / FINISHES		/	Λ	
(CON'T)	/	/ ₀ 00	***	tod! comments
				Egress provided in corridor, some classrooms have egress doors. Admin
				building has 3 major entrances/exits. Central Mont. school has 6 major
Emergency Egress	x			entrances/exits.
Vestibule				not present
Cabinets at Building				194 present
Entrances			x	Replace at Central Mont.
				Administration stair handrails and guardrail height do not meet today's code
Stairs		x		requirements
Stalls		^		One - located in southwest corner of administration building - old/estimated
Charles and Falls				install in 1980's. It cannot be accessed from the administration or school
Elevator				entrances.
Lievatoi			X	
				Ground floor of Administration Building - located on east end south of CAFE -
Canaval Nata				narrow (24" wide). Provides access to kitchen back of house and Admin mech
General Note				rooms.
Classrooms		2.00		Light Control of the
Flooring		Х		classroom carpet and VCT to be replaced
Celling		X		Many classrooms have newer 2x4 grid and fixtures,
<u></u>				Most window do not have labels, but windows should be removed and
Egress Windows				replaced.
Casework			X	Casework to be replaced
Marker/Chalkboards		X		Have whiteboards - ready for upgrade.
Heat		X		Received new VUV units with last bond cycle.
Air-Conditioning		х		Received new VUV units with last bond cycle.
				ok - but exterior windows and doors need to be considered for replacement.
Daylight		x		Room for large openings available - could be a big impact for each classrooms
				No issues reported, school was full (every classroom occupied) when we
Overall Size		х		were onsite for tour.
				Upgrade doors (just replaced hardware electronic locksets with last bond
Doors			Х	cycle).
Lighting			x	Upgrade fixtures/controls.
				Replace - Present in east wing of school, in 2 locations separating 4
Dividing Partition Walls			х	classrooms (other classrooms received CMU walls)
Toilet Rooms				
Fixtures Operational	x			Most (not all) toilet rooms were updated. Staff toilet rooms to be updated.
Toilet Partitions	х			
Walls	х			
		VILLEND VILLE		Epoxy floor with integral cove base used at bathrooms recently updated
Floors	x			(district wide update).
				Some comments from district about tree roots/floor drain conflicts at this
Floor Drains		x		building. Inspection should be recommended.
Lighting	х			
Hand Dryers	ŕ			not present.
Cellings/Walls	х			gyp board ceilings with new light fixtures/diffusers
Mirrors		х		new framed mirrors installed.
		^		in compliance at new bathrooms. Some staff bathrooms in Central Mont
ADA Accessible				need to be upgraded/updated.
Adequate Size	X			
<u> </u>	×			no issues reported.
Gymnasium				
Flooring		х		Flooring being maintained and upgrade by district at winter break 2021.

INTERIORS / FINISHES		7.	7						
(CON'T)		1009		comments					
Lights	ĺχ		f	recent fixture updates (district wide at gyms).					
HVAC		X		Recent upgrades (no A/C typical district wide).					
Daylight			х	none - no exterior windows.					
				Hoops are fixed but in good condition. Poor acoustics and no wall padding -					
Gym Equipment			х	should be addressed.					
Doors			200000000000000000000000000000000000000	Remove, replace, upgrade.					
Size	х			nice gym.					
Bleachers			x	Remove and replace wood bleachers					
Egress		X		no issues present - exterior and interior entrances.					
				trusses/new light fixtures/tectum roof deck present. Repaint walls and					
Walls/Ceilings		x		celling.					
7,7,7,10,0				North of Gym - a classroom - confirm emergency egress. Also, 9x9 floor tile					
General Note				hazardous materials.					
Cafeteria				nazaraous materials.					
				Rubber sheet vinyl over old gym flooring not performing well - should be					
Flooring			v	replaced					
i iooi iii g				Ceiling needs to be replaced, walls need new patch/paint. Walls have wall					
Cellings/Walls			l x	protection installed from floor to 4' AFF which also needs to be replaced					
Accessibility		x		Acceptable but no ideal (tight/compact).					
Lighting			$\frac{1}{x}$	Update fixtures.					
LIBIKUIB		23/2007/05		Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs					
Seating		l ,		updates (open area up - doors/windows).					
Seating		X		ok – no issues reported from Okemos. Central school age students walk from					
At-1				school through building (stairs - not Adah friendly) into Admin ground floor to					
Size Air Conditioning		Χ		enter cafeteria.					
Air-Conditioning	X			present with recent unit updates to Admin building.					
Daylight	Х			ok - exterior windows (up high on walls) due to ground floor location.					
Doors			Х	remove and replace.					
				Located on ground floor of administration building. Exterior entrance (stairs					
				up to parking lot level). Main entrance located on west elevation of room to					
Egress			X	corridor. Other egress through kitchen.					
				Admin building mechanical unit updates recently performed, not issues					
Heating	X			noted during site visit. Inefficient exterior perimeter windows.					
Offices									
Flooring			Door Sales Sandian	Replace all flooring in Administration and school offices					
Furniture			Х						
i				Administration ceilings (2x4 grid with sagging tiles) to be replaced. Fair to					
				good condition - new ceilings would make a large impact. New light fixtures,					
Ceilings		100000000000000000000000000000000000000		may become necessary since campus does not have fire suppression system.					
Paging			Х	Upgrade					
Master Clock			X	Upgrade					
Phone System			TO CONTRACT OF THE PARTY OF THE	Upgrade ·					
Lighting			X	Upgrade					
				School office workroom inefficient and small - not functional, Teacher					
Copy/Work Room			X	workroom located in former locker room					
				Small individual rooms scattered around main office - need to update /					
Meeting Rooms		Japan Co	Million Ave	reconfigure.					
Boardroom			X	Dated, all finishes and casework to be replaced.					
Coffee Break Area		A STATE OF THE STA	X	Do not have in Administration.					
				Staff bathrooms in corridor outside main office were not updated with other					
Bathroom(s)			X	restrooms					

INTERIORS / FINISHES		/.	A	
(CONT)	/	(3) 199	(i)/	and comments
Visibility			MALKHWY.	Poor visibility to both the school entrance and administration entrance
				Present at Central Mont main office near main entrance. Entire main office
Health Room w/Toilet			x	needs to be upgraded and redesigned.
Accessibility		14.455F00800	x	No
Child Care Center		x		large room located on ground floor of Administration building.
Staff Lounge		págadone.	x	Located in East Wing of school, minimal natural light.
Media Center				9,
				No limitations reported. IT added room configured within footprint of Media
Size			x	Center.
Flooring			x	Carpet,
			-77	2x4 fixtures - ok condition/no building controls other than wall switches. No
Lighting		х		dimming capacity.
Six and the said some state of the said state of				No media center offices - Adjacent meeting rooms used for general building
				use. Be aware of ceiling types in these rooms (different condition and should
Office Space				be removed and replaced).
Ventilation	х			встеточев ани теріасси).
Doors	٨	x		
Ceilings				Jud grid Hights Invainator Islam
Acoustics			X	2x4 grid/lights/projector/clean. no issues - ceiling height 11' and CMU painted walls
	X			furniture ok
Seating	X			Turniture ok
Auxiliary Spaces		2.50		
Adambarian Danasa				Mechanical room at the Administration building is small, crowded and
Mechanical Room			X	difficult to access.
Kitchen				
				Kitchen/Cafeteria located in ground floor of Admin building (original High
				School footprint). 300 meals daily to Central Montessori Elementary
Program				students.
	1			JRA to provide list for selecting new equipment. Large 3 compartment sink,
				range with oven and old hood, (4) free standing coolers (one is residential),
Equipment		Х		prep tables. Serving space in separate room adjacent to kitchen.
		100000		Replace 2x4 tiles and grid in serving area. Replace and upgrade
Ceilings			Х	lights/diffusers/grilles. Kitchen has hard lid gyp ceiling - remove and replace.
Cooler/Freezer				Walk-in units not present.
Floors		X		4x4 quarry tile and rubber base present in kitchen and serving area.
				All are through west school entrance (no canopy) to elevator - down to
				ground floor and through cafeteria to kitchen. No receiving area. There are
Delivery Space			х	(2) exterior doors on the north side with steps up to the parking lot elevation.
				Storage room present - between kitchen and mechanical area. Concrete floor
Storage Space			x	(tunnel access here) / CMU walls/ gyp lid.
Kitchen Hood			X	Old large hood above range and coolers. Remove and replace.
				Serving space in separate room adjacent to kitchen. Floor ok, CMU and Gyp
Serving Line		x		walls, replace ceiling. No fire suppression or fire alarm present.
Electrical		х		No issues noted - such as too few outlets/location/breaker capacity.
Lighting		х		Upgrade light fixtures.
				Administration building just received new HVAC units to serve all (3) floors.
Heating	x			Heating and A/C.
Fire Suppression/FA			X	No fire suppression present, Fire alarm present.
				Final preparations and serving to elementary students. Not a fully functional
Overall				licensed kitchen. Materials delivered from food service and high school.
	a province consist		E CONSTRUCTION OF THE	

MECHANICAL	/	200è		ggd comments				
				Building is served by (4) PK heating hot water boilers, 2,000 MBH each				
Heating Source and				installed around 2003. Two of the boilers have been abandoned that used to				
Condition		Х		serve the Facilities out buildings.				
Usating Dumps and Dining		х		Building is served by (2) B&G base mounted pumps (320 gpm @ 90' HD) installed around 2003. No known issues for piping.				
Heating Pumps and Piping Cooling Source and		^		individual DX cooling. Administration building and classrooms have cooling.				
Condition		х						
Cooling Pumps and Piping		N/A.						
COOME ramps and riping	+			Classrooms are served by (23) horizontal unit vents with remote condensing				
				units were installed within the last 5 years. Finned-tube have Danfoss valves				
Terminal Devices		х		not on BMS. Window air conditioning units serve the Elementary offices.				
				The (2) 3,500 cfm dual duct AHU's with remote condensing units on the roof				
				serve the second and third floor of the Administration building were installed				
				in 1988. The AHU with remote condensing unit on the roof serves the				
				Cafeteria was installed in 2021. The 1,800 cfm AHU with remote condensing				
				unit on the roof serves the first floor of the Administration building and was				
				installed in 2021. There is a 8.5-ton RTU that serves the Boardroom in the				
				Administration Building installed in 1988. There are (2) AHU's that serve the				
AHUs and RTUs		X		Gym.				
				Exhaust fans are original. There is no ventilation in the conference room and				
				office off the Board Room. (1) 3,500 cfm EF, (2) 300 cfm EF's, (1) 800 cfm EF,				
				(1) 3,000 cfm EF, (1) 600 cfm EF, (1) 1,800 cfm EF, (2) 1,100 cfm EF's, (3) 175				
Ventilation			х	cfm EF's, (4) 560 cfm EF's, (1) 690 cfm EF				
Building Management								
System/Controls			Х	Building is served by Trane BMS with partial pneumatics.				
				Storm and domestic piping is nearing end of life. Sanitary piping backs up a				
Domestic Water Piping			X	couple of times a year. There are two tunnel sumps. Tunnel floods.				
				Building is served by a Bradford White water heater, 80 gallon, 200 MBH				
Water Heaters	X			installed in 2020.				
				Administration Building remodeled within last 5 years. Elementary fixtures				
Plumbing Fixtures		Х		are original.				
Fire Protection	1			N/A.				
Pool equipment		1		N/A.				

ELECTRICAL	/	/ (i) go/		comments
Transformer size	х			
Primary/Secondary Service	Х			Wiring is original, lacking receptacles throughout building
Generator				No generator.
Occupancy Sensors				N/A
Lighting Control System			Х	Toggle switches. Needs updating.
Panels	х			Majority of panels are in good shape.
Panel Clearance	x			Need to remove storage items.
Fire Alarm	x			Upgraded in the last 5 years. Future upgrades could include voice activation (district wide)
Interior Lighting			X	Fluorescent fixtures throughout need to be replaced.
Exit Signs			X	Exit signs are very old and letters are dim.

TECHNOLOGY	,00b	(a) / 200	comments
IT Rooms	х	Sha	red storage space. Unused equipment needs to be removed.



TECHNOLOGY (CON'T)	/);0 ⁰ 0	/	god				
Fiber Optic Cabling (between buildings/IT rooms)		x		Older single mode fiber between buildings, multimode between IT rooms, some CAT6 tie lines between racks.				
Data Cabling (within buildings)	x			CAT 6 cabling. Switches were upgraded recently.				
Bells/Paging System			х	Need to update paging for the district. Paging speakers not loud enough in the gym.				
Clock System			x	There is no synchronized clock system. Some satellite clocks and digital signage running software to display time.				
Classroom Audio/Video Systems	х			Standard throw projectors being replaced with 75" interactive displays. Plan to replace Lightspeed audio with Audio Enhancement systems.				
Large Space Audio/Video				Gym needs to audio system and installed projector. Admin boardroom/conference room need AV systems to support virtual and in-				
Systems Security Camera System			month and the contract	Need to update Sony cameras and VMS (currently exacqvision software)				
Access Control System		х		Axis intercom at main entrance. Card readers at priority doors. Vanderbilt SMS.				

BUDGET DETAIL

ITEM #:	13				Acres:		28
	Central Montessori/District Admin.	- Sitewor	k				
	Description	Quantity	UOM		Unit Cost		Total Cost
Sitework	SITEWORK					\$	
Drainage	There is a drainage issue at the south-west corner of the building, water pools at this location during heavy rains.	I	LS	\$	25,000.00	\$	25,000
Asphalt Parking/ Drives	Asphalt pavement in good condition throughout		assume we	ork not r	equired	\$	-
Sidewalks	Some cracking along main drop-off location.					\$	•
Adequate Parking	Parking is scattered throughout					\$	-
Bus Loop	N / A - no bus service					\$	
Playgrounds	Playground equipment is showing its age and should be replaced in the near term.	1	LS	\$	500,000.00	\$	500,000
Student Drop off Area	Student drop-off is located at the back of the building. This circulation is convoluted and conflicts with the adjacent Operations/Tech/Grounds functions.	1	LS	\$	250,000.00	\$	250,000
Landscaping			†	T		\$	-
Irrigation Systems	N/A - no irrigation present					\$	-
Athletic fields	Athletic fields are low and general hold water.	1	allow	\$	100,000.00	\$	100,000
Fencing				Г		\$	-
Service Entrance				T		\$	•
Signage	Allowance	1	ALLOW	\$	5,000.00	\$	5,000
Dumpster Location	Dumpsters are scattered along the north side of the building, including adjacent to the main student drop-off.	2	EA	\$	40,000,00	\$	80,000
Traffic Directions						\$	
Parking Lot Lighting			assume by	owner		\$	•
Retaining Wails						\$	-
			1	1		\$	•
						\$	-
	Direct Trade	28	acres	\$	34.285.71	3	960,000

ITEM #: 14				68,400		
	Central Montessori/District Admin Build	ing Impro	vements			
	Description	Quantity	UOM		Unit Cost	 Total Cost
Building Shell	BUILDING SHELL	TOTAL CONTRACTOR				\$ -
Roofing	Central Elementary 2005 Single-ply membrane. New roofing installed in 2016 - Firestone single-ply membrane. District reports no issues.		assume w	ork not	required	\$ •
Exterior Windows	Administration: original aluminum windows with interior blinds and vision and spandrel glass to be replaced. Integral frames with mech louvers present. School: aluminum windows should be replaced.	68,400	SF	\$	15.00	\$ 1,026,000
Positive Drainage	Administration: (2) ground floor doors allow water to enter cafeteria and kitchen area during heavy rains. Trench drains to be added at bottom of exterior stairs. School: Classrooms on the south end of each major wing have tunnel access with sump pumps to remove overflow rain from large rain events.	1	LS	\$	50,000.00	\$ 50,000
Defined Entry	Canopy at the Administration entrance on the north side. School entrance is identifiable on the west side of building but there is no parking adjacent to the entrance.	1	LS	\$	150,000.00	\$ 150,000
Accessibility	ADA accessibility poor. Administration entrance (north entrance) is not barrier free accessible. The only barrier free access is at the west entrance, away from both administration and school main entrances. There is no barrier free parking near the accessible entrance. Many level changes in the building. Need to review barrier free emergency egress from all levels. Corridor to west entrance on lower level is too narrow for barrier free access and egress. The classroom located in the old gym mezzanine does not have barrier free access.	-	LS	\$	200,000.00	\$ 200,000
Fascia/Soffits	Canopy at north entrance should be removed and replaced. Wood fascia and soffits at the school building should be replaced with prefinisold metal trim.		see items	below		\$ -
Fascia/Soffits	Remove/replace wood fascia/soffits	7,878	SF	\$	35.00	\$ 275,730
Fascia/Soffits	Canopy remove and replace	1,000	SF	\$	175.00	\$ 175,000
Maintenance Room Entry						\$ -
Brick	Brick masonry at administration and school exterior in good condition. Cleaning/joint care/tuckpointing/some small repairs and replacements could be completed. Consider removal of "chimney" on roof of administration. Administration walls not energy efficient. CMU at school to be repainted.	27,573	SF	s	4.00	\$ 110,297
	Add insuakion at admin walls	6,300	· · · · · · · · · · · · · · · · · · ·	\$	30.00	\$ 189,000
Wall Panels	Wall panels at window infill to be replaced.	1	LS	\$	75,000.00	 75,000
Caulk Joints				L		\$



Water Stains	Admin building - can be seen on cast stone pieces. Central Mont - can be seen on CMU (south elevation of wings) and some of the roof edge metal around the	ı	LS	\$ 10,000.00	\$	10,000
Exterior Doors	perimeter of the building Decent aluminum frames/electronic locksets present. Not all entrances have barrier free access and snowmelt concrete should be considered at all locations.	I	ALLOW	\$ 75,000.00	\$	75,000
	Add snow melt system		excluded		<u> </u>	
Vestibule Entries	Not present at most locations including Administration building. Main entrance to	1	LS	\$ 75,000.00	\$	75,000
	Central Montessori has exterior secure entrance doors but no secure vestibule entrance					
Everior Lighting	Building mounted lighting	1	LS	\$ 20,000.00	\$	20,000
	Found in some locations of the Admin building - should be considered for removal		LS	\$ 50,000.00		50,000
Glass Block	and replacement with windows.	F	<u> </u>	30,000.00	•	30,000
Chimney	Remove Chimney (not sure if still functional) on Admin building.	1	1.5	\$ 25,000.00	\$	25,000
Transite Panels	Locased around Central Mons windows and could be removed and replaced with	ı	LS	\$ 100,000.00	\$	100,000
	larger window frames.					
					\$	
	INTERIORS		X25X35X5		\$	•
CONTRACTOR OF THE PROPERTY OF	Paint/refresh entire building	68,400	1	\$ 1.50	\$	102,600
Corridors	Corridors	10,222	SF		\$	
Lighting	Upgrade - old/performance/bulb retrofits/lighting controls.	10,222	SF	\$ 7.50	\$	76,665
Flooring	Replace all flooring (carpet & VCT)-assume 25% corridor area. Terrazo floor in	283.94	SY	\$ 63.54	\$	18,042
	fair condition.	7,075.50			<u> </u>	144510
	Terrazzo repair allowance	7,225.50	_	\$ 20,00	\$	144,510
Ceilings/Walls	Replace 2x4 grid/pads/lights in Administration, Some school ceilings are in fair	10,222	SF	\$ 12.00	\$	122,664
	condition - selective replacement. Plaster walls in Administration (minor cracks					
	to be repaired.), brick in good condition, wood walls need to be refinished.					
P.L. alta	111 11/4	10 232		• 050		F 1 4 3
	Add diffuser and grilles with new ceilings	10,222		\$ 0.50	\$	5,111
Lockers	Built-In lockers in school corridors. School would like them removed and new	450	EA	\$ 750.00	\$	337,500
	reinstalled. Build in metal lockers in CMU walls (extensive work)					
Doors	Building received electronic locking hardware upgrades (district wide).	59	EA	\$ 2,000.00	\$	118,000
	Administration office doors are in good condition but door knobs should be			, ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	ľ	
	_					
	rplaced with levers. Doors in lower level of Administration should be replaced				1	
	(childcare, cafeteria, gym). Old/no door closers/some doors in Admin building]	
	have knob hardware.			1	-	
Size of Corridor	Most buildings have 'good' adequate corridor size (overall width). works with		assume wo	rk not required	\$	-
		ı .				
	traffic flow, free egress, emergencies. District did not report any issues here or at					
	any other buildings in regards to this					
Flow of Corridor	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected		assume Wo	ork not required	\$	
	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office.			·		•
	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building			ork not required	\$	-
	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office.			·		-
	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits.			·		-
Emergency Egress	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present	25		·	\$	- - 18,750
Emergency Egress Vestibule Entries Cabinets at Building Entrances	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present	25		rk not required	\$	- 18,750 35,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont.	25	assume wo	ork not required	\$	
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code	25	assume wo	ork not required	\$	
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated	25	assume wo	\$ 750.00 \$ 35,000.00	\$	35,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school	25	assume wo	\$ 750.00 \$ 35,000.00	\$	35,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances.	25	assume wo	\$ 750.00 \$ 35,000.00	\$ \$ \$ \$	35,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE -	25	assume wo	\$ 750.00 \$ 35,000.00	\$	35,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech	25	assume wo	\$ 750.00 \$ 35,000.00	\$ \$ \$ \$	35,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms.	25 I	assume wo	\$ 750.00 \$ 35,000.00 \$ 20,000.00	\$ \$ \$ \$	35,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage	25	LS LS	\$ 750.00 \$ 35,000.00 \$ 20,000.00	\$ \$ \$ \$	35,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. achool has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage	25 	LS LS SF	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55	\$ \$ \$ \$ \$	35,000 20,000 37,620
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade.	25	LS LS SF SF SF	\$ 750.00 \$ 35,000.00 \$ 20,000.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 - 37,620
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Ceilings	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures.	25 1 1 68,400 15,665 1,740.56	LS LS SF SF SY SF	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 - - 37,620 - 110,595
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Ceilings	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade.	25 1 1 68,400 15,665 1,740.56	LS LS SF SF SF	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 - - 37,620
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Cellings Egress Windows	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures.	25 1 1 68,400 15,665 1,740.56	LS LS SF SF SY SF LS	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 - - 37,620 - 110,595
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Ceilings Egress Windows Catework	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms Classrooms Classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures. Most window do not have labels, but windows should be removed and replaced.	68,460 15,665 1,740.56	LS LS SF SF SY SF LS	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55 \$ 63.54	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 - - 37,620 - - 110,595 50,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Ceilings Egress Windows Casework Marker/Chalkboards	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures. Most window do not have labels, but windows should be removed and replaced. Casework to be replaced Have whiteboards - ready for upgrade. Assume 3 each classroom (8' If/each MB)	68,460 15,665 1,740.56	LS LS SF SF SY SF LS LF RMS	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55 \$ 63.54 \$ 50,000.00 \$ 450.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 37,620 - 110,595 - 50,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Ceilings Egress Windows Catework Marker/Chalkboards Heating	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures. Most window do not have labels, but windows should be removed and replaced. Casework to be replaced Have whiteboards - ready for upgrade. Assume 3 each classroom (8' lifeach MB) Received new VUV units with last bond cycle.	68,460 15,665 1,740.56	LS LS SF SF SY SF LS LF RMS assume wo	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55 \$ 63.54 \$ 50,000.00 \$ 3,360.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 37,620 - 110,595 - 50,000 450,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Cellings Egress Windows Casework Marker/Chalkboards Heading Air-Conditioning	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures. Most window do not have labels, but windows should be removed and replaced. Casework to be replaced Have whiteboards - ready for upgrade. Assume 3 each classroom (8' Ifleach MB) Received new VUV units with last bond cycle. Received new VUV units with last bond cycle.	68,460 15,665 1,740.56	LS LS SF SF SY SF LS LF RMS assume wo	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55 \$ 63.54 \$ 50,000.00 \$ 450.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 37,620 - 110,595 - 50,000 450,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Cellings Egress Windows Casework Marker/Chalkboards Heading Air-Conditioning	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures. Most window do not have labels, but windows should be removed and replaced. Casework to be replaced Have whiteboards - ready for upgrade. Assume 3 each classroom (8' lifeach MB) Received new VUV units with last bond cycle.	68,460 15,665 1,740.56	LS LS SF SF SY SF LS LF RMS assume wo	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55 \$ 63.54 \$ 50,000.00 \$ 450.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 37,620 - 110,595 - 50,000 450,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Cellings Egress Windows Casework Marker/Chalkboards Heading Air-Conditioning	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures. Most window do not have labels, but windows should be removed and replaced. Casework to be replaced Have whiteboards - ready for upgrade. Assume 3 each classroom (8' Ifleach MB) Received new VUV units with last bond cycle. Received new VUV units with last bond cycle.	68,460 15,665 1,740.56	LS LS SF SF SY SF LS LF RMS assume wo	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55 \$ 63.54 \$ 50,000.00 \$ 450.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 37,620 - 110,595 - 50,000 450,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Ceilings Egress Windows Catework Marker/Chalkboards Heating Air-Conditioning Daylight	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures. Most window do not have labels, but windows should be removed and replaced. Casework to be replaced Have whiteboards - ready for upgrade. Assume 3 each classroom (8' Ifleach MB) Received new VUV units with last bond cycle. Received new vuv units with last bond cycle.	68,460 15,665 1,740.56	LS LS SF SF SY SF LS LF RMS assume wo	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55 \$ 63.54 \$ 50,000.00 \$ 450.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 37,620 - 110,595 - 50,000 450,000
Emergency Egress Vestibule Entries Cabinets at Building Entrances Stairs Elevators General Note Interior Signage Classrooms Flooring Ceilings Egress Windows Catework Marker/Chalkboards Heating Air-Conditioning Daylight	any other buildings in regards to this No issues with flow reported. Central Montessori has two major wings connected by passageway at main office. Egress provided in corridor, some classrooms have egress doors. Admin building has 3 major entrances/exits. Central Mont. school has 6 major entrances/exits. not present Replace at Central Mont. Administration stair handrails and guardrail height do not meet today's code requirements One - located in southwest corner of administration building - old/estimated install in 1980's. It cannot be accessed from the administration or school entrances. Ground floor of Administration Building - located on east end south of CAFE - narrow (24" wide). Provides access to kitchen back of house and Admin mech rooms. Interior signage Classrooms classrooms could use carpet and VCT upgrade. Many classrooms have newer 2x4 grid and fixtures. Most window do not have labels, but windows should be removed and replaced. Casework to be replaced Have whiteboards - ready for upgrade. Assume 3 each classroom (8' Ifleach MB) Received new VUV units with last bond cycle. Received new VUV units with last bond cycle.	68,460 15,665 1,740.56	LS LS SF SF SY SF LS LF RMS assume wo	\$ 750.00 \$ 35,000.00 \$ 20,000.00 \$ 0.55 \$ 63.54 \$ 50,000.00 \$ 450.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	35,000 20,000 37,620 - 110,595 - 50,000 450,000

	Upgrade doors (just replaced hardware electronic locksets with last bond cycle).	17	EA	\$ 1,000.00	\$	17,000
Lighting	Upgrade fixtures/controls.	15,665	SF	\$ 7.00	\$	109,655
Heating					\$	
Dividing Partition Walls	Replace - Present in east wing of school, in 2 locations separating 4 classrooms (other classrooms received CMU walls)	I,920	SF	\$ 45,00	\$	86,400
Special Education	Rooms are located with east wing of Central Mont. Could not inspect - in use				\$	
	during site walk-through. Be aware of use/functionality here. Should meet with					
	staff to discuss function and updates.					
Tollet Rooms		1,517			\$	-
Fixtures Operational	Most (not all) toilet rooms were updated. Staff toilet rooms to be updated.	2	LOC	\$ 35,000.00	\$	70,000
Toilet Partitions			assume wo	ork not required	\$	•
Walls			assume wo	ork not required	\$	
Floors	Epoxy floor with integral cove base used at bathrooms recently updated (district		assume wo	ork not required	\$	•
··········	wide update).			•		
Floor Drains	Some comments from district about tree roots/floor drain conflicts at this	1	LS	\$ 6,000.00	\$	6,000
	building. Inspection should be recommended.					
Lighting			with item a	above staff toilets	\$	-
Hand Dryers	not present		excluded		\$	-
Cellings/Walls	gyp board ceilings with new light fixtures/diffusers		with item a	above staff toilets	\$	-
Mirron	new framed mirrors installed.		with item a	above staff toilets	\$	
ADA Accessible	in compliance at new bathrooms. Some staff bathrooms in Central Mont need to		with item a	above staff toilets	\$	
	be upgraded/updated.					
Adequate Size	no issues reported.				\$	
Gymnasium	Gymnasium	9,915	SF		\$	-
Flooring	Flooring being maintained and upgrade by district at winter break 2021.	***************************************	wotk by or	wner	\$	-
	recent fixture updates (district wide at gyms).		 	ork not required	\$	
	Recent upgrades (no A/C typical district wide).			ork not required	\$	
	none - no exterior windows.			ork not required	\$	
	Hoops are fixed but in good condition. Poor acoustics and no wall padding -	750	 	\$ 41.00	\$	30,750
ayın aqarpıncın	should be addressed.	,50		1.55	Ť	50,,50
	Remove, replace, upgrade.	6	EA	\$ 3,500.00	\$	21,000
	nice gym.				\$	-
Bleachers	Remove and replace wood bleachers	1,000	EA	\$ 185.00	\$	185,000
Egress	no issues present - exterior and interior entrances.		L		\$	<u> </u>
Locker Rooms					\$	-
Walls/Ceiling	trusses/new light fixtures/tectum roof deck present. Repaint walls and ceiling.	9,915	SF	\$ 4.00	\$	39,660
				7.00	*	
	North of Gym - a classroom - confirm emergency egress. Also, 9x9 floor tile - hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom	1	LS	\$ 650,000.00	\$	650,000
General Note	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom			-	\$	650,000
General Note , Cafeteria	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria	2,478		\$ 650,000.00	\$	-
General Note	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom			-	\$	-
General Note , Cafeteria Flooring	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced	2,478 2,478	SF	\$ 650,000.00	\$ \$	37,170
General Note , Cafeteria Flooring	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall	2,478	SF	\$ 650,000.00	\$ \$	37,176
General Note , Cafeteria Flooring	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced	2,478 2,478	SF	\$ 650,000.00	\$ \$	37,176
General Note , Cafeteria Flooring Ceilings/Wall:	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced.	2,478 2,478	SF	\$ 650,000.00	\$ \$	37,176
General Note Cafeteria Flooring Ceilings/Wall:	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact).	2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00	\$ \$ \$	29,736
General Note Cafeteria Flooring Ceilings/Wall: Accessibility Lighting	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures.	2,478 2,478	SF SF	\$ 650,000.00	\$ \$ \$	- 37,176 29,736
General Note Cafeteria Flooring Ceilings/Wall: Accessibility Lighting	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs	2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00	\$ \$ \$	- 37,176 29,736
General Note Cafeteria Flooring Ceilings/Walls Accessibility Lighting Seating	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows).	2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00	\$ \$ \$ \$ \$ \$ \$ \$ \$	- 37,176 29,736
General Note Cafeteria Flooring Ceilings/Walls Accessibility Lighting Seating	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no issues reported from Okemos. Central school age students walk from	2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00	\$ \$ \$	- 37,176 29,736
General Note Cafeteria Flooring Ceilings/Walls Accessibility Lighting Seating	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to	2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00	\$ \$ \$ \$ \$ \$ \$ \$ \$	29,736
General Note Cafeteria Flooring Ceilings/Walls Accessibility Lighting Seating	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria.	2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00 \$ 12.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	29,736 29,063
General Note Cafeteria Flooring Ceilings/Walls Accessibility Lighting Seating size	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building.	2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$	29,736 29,736
General Note Cafeteria Flooring Ceilings/Wall: Accessibiling Lighting Seating size Air-Conditioning	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-A ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building. ok - exterior windows (up high on walls) due to ground floor location.	2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00 \$ 12.00	\$ \$ \$ \$ \$ \$ \$	- 37,176 29,734 - 21,06:
General Note Cafeteria Flooring Ceilings/Wall: Accessibility Lighting Seating size Air-Conditioning Dayligh Overall Size	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-A ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building. ok - exterior windows (up high on walls) due to ground floor focation.	2,478 2,478 2,478 2,478	SF SF assume wo	\$ 650,000.00 \$ 15.00 \$ 12.00 \$ 8.50	\$ \$ \$ \$ \$ \$ \$ \$	- 37,176 29,736 - 21,06: - -
General Note Cafeteria Flooring Ceilings/Wall: Accessibility Lighting Seating size Air-Conditioning Dayligh Overall Size	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building. ok - exterior windows (up high on walls) due to ground floor location.	2,478 2,478 2,478 2,478	SF SF	\$ 650,000.00 \$ 15.00 \$ 12.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	29,736 - 21,063
General Note Cafeteria Flooring Ceilings/Wall: Accessibility Lighting Seating size Air-Conditioning Dayligh Overall Size	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building. ok - exterior windows (up high on walls) due to ground floor location.	2,478 2,478 2,478 2,478	SF SF assume wo	\$ 650,000.00 \$ 15.00 \$ 12.00 \$ 8.50	\$ \$ \$ \$ \$ \$ \$ \$	29,736 - 21,063
General Note Cafeteria Flooring Cellings/Wall: Accessibility Lighting Seating size Air-Conditioning Dayligh Overall Size	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building. ok - exterior windows (up high on walls) due to ground floor location.	2,478 2,478 2,478 2,478	SF SF assume wo	\$ 650,000.00 \$ 15.00 \$ 12.00 \$ 8.50	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	29,736 - 21,063
General Note Cafeteria Flooring Ceilings/Wall: Accessibility Lighting Seating size Air-Conditioning Dayligh Overall Size Egress	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building. ok - exterior windows (up high on walls) due to ground floor location. remove and replace. Located on ground floor of administration building. Exterior entrance (stairs up to parking lot level). Main entrance located on west elevation of room to corridor. Other egress through kitchen.	2,478 2,478 2,478 2,478	SF SF assume wo	\$ 650,000.00 \$ 15.00 \$ 12.00 \$ 8.50	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	29,736 29,736 - 21,063 - - - 17,506
General Note Cafeteria Flooring Ceilings/Walls Accessibility Lighting Seating size Air-Conditioning Dayligh Overall Size Doors Egress	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building. ok - exterior windows (up high on walls) due to ground floor location. remove and replace. Located on ground floor of administration building. Exterior entrance (stairs up to parking lot level). Main entrance located on west elevation of room to corridor. Other egress through kitchen. Add diffuser and grilles with new cellings	2,478 2,478 2,478 2,478	SF SF SF SSF SF SF	\$ 650,000.00 \$ 15.00 \$ 12.00 \$ 8.50 ork not required \$ 3,500.00	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	29,736 29,736
General Note Cafeteria Flooring Ceilings/Walls Accessibility Lighting Seating size Air-Conditioning Dayligh Overall Size Doors Egress	hazardous materials. Add new egress stair and barrier free elevator access to 2nd floor classroom Cafeteria Rubber sheet vinyl over old gym flooring not performing well - should be replaced Ceiling needs to be replaced. walls need new patch/paint. Walls have wall protection installed from floor to 4' AFF which also needs to be replaced. Acceptable but not ideal (tight/compact). Update fixtures. Grade school K-4 ages. Tables and chairs ok - overall space ok. Room needs updates (open area up - doors/windows). ok - no Issues reported from Okemos. Central school age students walk from school through building (stairs - not ADA friendly) into Admin ground floor to enter cafeteria. present with recent unit updates to Admin building. ok - exterior windows (up high on walls) due to ground floor location. remove and replace. Located on ground floor of administration building. Exterior entrance (stairs up to parking lot level). Main entrance located on west elevation of room to corridor. Other egress through kitchen.	2,478 2,478 2,478 2,478	SF SF SF SSF SF SF	\$ 650,000.00 \$ 15.00 \$ 12.00 \$ 8.50	\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	29,734 29,734 - 21,065 - - - 17,506



Offices	Offices	2.120	SF			æ	
	Replace all flooring in Administration and school offices. Includes renovation for	3,420 3,420	SF	s	125.00	\$	427,500
ricoring		3,720	2L	*	125.00	3	12/,300
	office area					l	
						l	
furniture						\$	
Cellings	Administration ceilings (2x4 grid with sagging tiles) to be replaced. Fair to good		with item a	hove		\$	
Ceimigs			171611 166111 6			1 *	
	condition - new ceilings would make a large impact. New light fixtures, may						
	become necessary since campus does not have fire suppression system.					l	
						<u> </u>	
Paging	Upgrade		in elec belo	w		\$	-
Master Clock	Upgrade		in elec belo	w		 \$	
Phone System	Upgrade		in elec belo	w		\$	
	Upgrade	3,420	SF	\$	8.00	\$	27,360
***************************************	Add diffuser and grilles with new ceilings	3,420	SF	\$	0.50	\$	1,710
	School office workroom Inefficiant and small - not functional, Teacher workroom	3,120	with Item a	<u> </u>	0.50	\$	1,7.70
Copyrviolik Koolii			with item a	ioove		1 *	•
	located in former locker room					 	
Meeting Rooms	Small individual rooms scattered around main office - need to update /		with item a	bove		\$	-
	reconfigure.						
Boardreom	Dated, all finishes and casework to be replaced.		with item a	bove		\$	
Coffee Break Area	Do not have in Administration.					\$	-
	Staff bathrooms in corridor outside main office were not updated with other		with item a	bove		\$	_
	restrooms			-			
Visibiles	Poor visibility to both the school entrance and administration entrance			Ι		\$	
	·			<u> </u>		_	
Health Koom with Foilet	Present at Central Mont main office near main entrance. Entire main office needs		with item a	DOVE		\$	-
	to be upgraded and redesigned.		ļ	·····		ļ	
Accessibility	No					\$	<u> </u>
Child Care Center	large room located on ground floor of Administration building.		L			\$	-
	Located in East Wing of school, minimal natural light.		<u> </u>	I		\$	-
Media Center	Media Center	1,500	SECTION	l		\$	
ryaniyayiyanyaayayayayaayayaaqaaayaayaayaayaaayaa		4-04		-	35 000 00	_	35.000
Size	No limitations reported. IT added room configured within footprint of Media	J	LS	\$	35,000.00	\$	35,000
44.44	Center.		ļ			ļ	
	Carpet.	166.67	SY	\$	63.54	\$	10,590
Lighting	2x4 fixtures - ok condition/no building controls other than wall switches. No	1,500	SF	\$	11.00	\$	16,500
[·	dimming capacity,			l		l	
Office Space	No media center offices - Adjacent meeting rooms used for general building use.		[\$	-
	Be aware of ceiling types in these rooms (different conditions should be removed		1	1			
	and replaced).		ŀ	1			
Ventilation	anu repraceul.		<u> </u>	 		5	
			 			-	-
Doors			<u></u>	<u> </u>		\$	
	2x4 grid/lights/projector/clean.	1,500		\$	12.00	\$	18,000
Heating	Add diffuser and grilles with new ceilings	1,500	SF	\$	0,50	\$	750
Acoustics	no issues - ceiling height 11' and CMU painted walls					\$	-
	furniture ok					\$	•
Auxiliary Spaces				 	······································	\$	
	(LS	\$	75,000.00	\$	75,000
i lechanical room	Mechanical room at the Administration building is small, crowded and difficult to		L3	*	75,000.00] *	75,000
	access.			 		<u> </u>	
General Note			ļ		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	\$	-
General Note						\$	-
Kitchen	Kitchen	1,309	SF			\$	•
	Kitchen/Cafeteria located in ground floor of Admin building (original High School			T	***************************************	\$	÷
	footprint). 300 meals daily to Central Montessori Elementary students.					1	
1	noospania, 500 mean daily to Central Fortesson Elementary students.						
1							
		<u> </u>				-	
Equipment	JRA to provide list for selecting new equipment. Large 3 compartment sink, range		LS	\$	265,500.00	\$	265,500
1	with oven and old hood, (4) free standing coolers (one is residential), prep tables.			1		1	
1	Serving space in separate room adjacent to kitchen.		1			l	
			1	l			
			I	l			
C-:th	Daplace 2nd tiles and gold in conduction Daplace and unusual	1,309	ce .	\$	15.00	\$	20,355
Cessings	Replace 2x4 tiles and grid in serving area. Replace and upgrade	KDC,1	35	1,	15.00	,	20,355
	lights/diffusers/grilles. Kitchen has hard lid gyp ceiling - remove and replace.		I				
			<u> </u>				
			<u> </u>			L	
Cooler/Freezer	Walk-in units not present		Ī			\$	
	4x4 quarry tile and rubber base present in kitchen and serving area.				*	\$	_



	All are through west school entrance (no canopy) to elevator - down to ground floor and through cafeteria to kitchen. No receiving area. There are (2) exterior		see building shell		\$	-
	doors on the north side with steps up to the parking lot elevation. There is a flooding Issue at the two doors					
Storage Space	Storage room present - between kitchen and mechanical area. Concrete floor (tunnel access here) / CMU walls/ gyp lid.				\$	-
Kitchen Hood	Old large hood above range and coolers. Remove and replace.		with equip	nent above	\$	
Make-up Air					\$	-
Serving Line	Serving space in separate room adjacent to kitchen. Floor ok, CMU and Gyp walls, replace ceiling. No fire suppression or fire alarm present.				\$	-
Electrical	No issues noted - such as too few outlets/location/breaker capacity.				\$	-
····	Upgrade light fixtures.	1,309		\$ 8.00	\$	10,472
	Add diffuser and grilles with new ceilings	1,309		\$ 0.50	\$	655
	Administration building just received new HVAC units to serve all (3) floors. Heating and A/C.		assume wo	rk not required	\$	•
Secured					\$	
Fire Suppression/FA	No fire suppression present. Fire alarm present.				\$	•
Overali	Final preparations and serving to elementary students. Not a fully functional licensed kitchen. Materials delivered from food service and high school.				\$	•
					\$	_
	MECHANICAL				\$	-
Heating Source and Condition	Building is served by (4) PK heating hot water boilers, 2,000 M8H each installed	l	allow	\$ 250,000.00	\$	250,000
_	around 2003. Two of the boilers have been abandoned that used to serve the					
	Facilities out buildings. Significant defiences in mechanical room - remove all abandoned equipment and piping					
Heating Pumps and Piping	Building is served by (2) B&G base mounted pumps (320 gpm @ 90' HD) Installed around 2003. No known issues for piping.		assume wo	rk not required	\$	-
Cooling Source and Condition	Individual DX cooling. Administration building and classrooms have cooling. Cafeteria and Gym does not have cooling.		assume work not required		\$	-
-	Caleteria and Gyrii does not have coomig.					
Cooling Pumps and Piping	N/A.				\$	-
	Classrooms are served by (23) horizontal unit vents with remote condensing units		assume wo	rk not required	\$	_
	were installed within the last 5 years. Finned-tube have Danfoss valves not on BMS. Window air conditioning units serve the Elementary offices.					
AHUs and RTUs	The (2) 3,500 cfm dual duct AHU's with remote condensing units on the roof	i	LS	\$ 12,250.00	\$	112,250
	serve the second and third floor of the Administration building were installed in					
	1988. The AHU with remote condensing unit on the roof serves the Cafeteria					
	was installed in 2021. The 1,860 cfm AHU with remote condensing unit on the					
	roof serves the first floor of the Administration building and was installed in 2021.					
	There is a 8.5-ton RTU that serves the Boardroom in the Administration Building		-			
	installed in 1988. There are (2) AHU's that serve the Gym.					
				4 25 500 00	ļ <u>. </u>	25 500
Ventilation	Exhaust fans are original. There is no ventilation in the conference room and	1	LS	\$ 25,500.00	1.2	25,500
	office off the Board Room. (1) 3,500 cfm EF, (2) 300 cfm EF's, (1) 800 cfm EF, (1) 3,000 cfm EF, (1) 600 cfm EF, (1) 1,800 cfm EF, (2) 1,100 cfm EF's, (3) 175 cfm EF's,					
Building Manager and	(4) 560 cfm Ef's, (1) 690 cfm EF Building is served by Trane BMS with partial pneumatics.	68,400	SF	\$ 5.00	5	342,000
System/Controls	assessing a service of 11 miles of 15 miles par out precentates.	\$0,100	l-'	3.00	*	3 12,000
·	Storm and domestic piping is nearing end of life. Sanitary piping backs up a couple	68,400	SF	\$ 3.50	\$	240,000
L	of times a year. There are two tunnel sumps. Tunnel floods.					
Water Heaters	Building is served by a Bradford White water heater, 80 gallon, 200 MBH installed		assume wo	ork not required	\$	-
	in 2020.		<u> </u>	ı	-	
	Administration Building remodeled within last 5 years. Elementary fixtures are original.				\$.,
Fire Protection					\$	•
Pool equipment	N/A.		 		\$	-
	ELECTOICAL				\$	
Transformer size	ELECTRICAL		Sample Company of the		\$	*
	Wiring is original, lacking receptacles throughout building	 			\$	
<u> </u>	No generator.				\$	•
	Misc. areas unaccounted for	22,962	SF	\$ 7.00	+	160,734
Occupancy Sensors	•				\$	_
Lighting Control System	Toggle switches. Needs updating.	68,400	ŞF	\$ 1.50		102,600
Panels	Majority of panels are in good shape.	<u> </u>		L	\$	<u> </u>



Panel Clearance	Need to remove storage items.				\$
Fire Alarm	Upgraded in the last 5 years. Future upgrades could include voice activation	68,400	SF	\$ 0.75	\$ 51,300
	(district wide)				
Lighting	Fluorescent fixtures throughout need to be replaced.		in areas ab	ove	\$ -
Exit Signs	Exit signs are very old and letters are dim.		in areas ab	ove	\$ -
Clocks		68,400	SF	\$ 0.25	\$ 17,100
Paging		68,400	SF	\$ 0,60	\$ 41,040
Phone System		68,400	SF	\$ 2.00	\$ 136,800
Branch		68,400	SF	\$ 2.00	\$ 136,800
	TECHNOLOGY				\$ -
	Shared storage space. Unused equipment needs to be removed.			"Phone System" above	
	Older singlemode fiber between buildings, multimode between IT rooms, some		included in	"Phone System" above	\$ -
	CAT6 tie lines between racks.				
Data Cabling (within buildings)	CAT 6 cabling. Switches were upgraded recently.		included in	"Phone System" above	\$ -
Bells/Paging System	Need to update paging for the district. Paging speakers not loud enough in the gym.		included in	"Paging" above	\$ -
	There is no synchronized clock system. Some satellite clocks and digital signage running software to display time.		included in	"Mater Clock" above	\$ -
Classroom Audio/Video Systems	Standard throw projectors being replaced with 75" interactive displays. Plan to		assume no	work required	\$
	replace Lightspeed audio with Audio Enhancement systems.			-	
Large Space Audio/Video	Gym needs to audio system and installed projector, Admin	1	LS	\$ 35,000.00	\$ 35,000
Systems	boardroom/conference room need AV systems to support virtual and in-person.				
Security Camera System	Need to update Sony cameras and VMS (currently exacqvision software)				\$ -
	Axis intercom at main entrance. Card readers at priority doors. Vanderbilt SMS.		assume no	work required	\$ -
					\$ -
					\$ -
	Direct Trade	68,400		\$ 119.93	\$ 8,202,967





