

New Braunfels ISD Facility Condition Assessment

Executive Summary Report

July 24th, 2026





4085 Cibolo Canyons, Suite 200, San Antonio, TX 78261
Phone: 210-492-5742 | answers@alphafacilities.com
www.alphafacilities.com

FACILITY CONDITION ASSESSMENT
NEW BRAUNFELS ISD

This page is intentionally left blank.

TABLE OF CONTENTS

FACILITY CONDITION ASSESSMENT NEW BRAUNFELS ISD	3
EXECUTIVE SUMMARY	7
<i>Introduction</i>	<i>7</i>
<i>Acknowledgement</i>	<i>7</i>
<i>Facility Condition Assessment Approach.....</i>	<i>8</i>
<i>Prioritization of Needs.....</i>	<i>9</i>
<i>Building Performance Metrics.....</i>	<i>10</i>
<i>The Renovate Versus Replacement Question</i>	<i>11</i>
<i>Categorization of Costs.....</i>	<i>11</i>
<i>Facility Condition Assessment.....</i>	<i>12</i>
<i>Site and Infrastructure Condition Assessment.....</i>	<i>13</i>
<i>Overview of Findings.....</i>	<i>14</i>
MIDDLE SCHOOL FACILITY CONDITION INFORMATION	31
<i>Middle School.....</i>	<i>32</i>
<i>Renewal Forecast</i>	<i>35</i>
HIGH SCHOOL FACILITY CONDITION INFORMATION.....	41
<i>High School.....</i>	<i>42</i>
<i>Renewal Forecast</i>	<i>45</i>
FACILITIES FACILITY CONDITION INFORMATION	51
<i>Facilities</i>	<i>52</i>
<i>Renewal Forecast</i>	<i>55</i>
TRANSPORTATION AND MAINTENANCE FACILITY CONDITION INFORMATION.....	61
<i>Transportation and Maintenance</i>	<i>62</i>
<i>Renewal Forecast</i>	<i>65</i>
ADMINISTRATION FACILITY CONDITION INFORMATION.....	71
<i>Administration</i>	<i>72</i>
<i>Renewal Forecast</i>	<i>75</i>
OTHER FACILITY CONDITION INFORMATION.....	81
<i>Other 82</i>	
<i>Renewal Forecast</i>	<i>85</i>
ELEMENTARY SCHOOL FACILITY CONDITION INFORMATION.....	91
<i>Elementary School.....</i>	<i>92</i>
<i>Renewal Forecast</i>	<i>95</i>
APPENDICES	102
<i>Appendix A -Typical System Lifecycles</i>	<i>102</i>
<i>Appendix B - Supplemental Information</i>	<i>103</i>
<i>Appendix C - Glossary.....</i>	<i>109</i>

This page is intentionally left blank.

EXECUTIVE SUMMARY

Introduction

New Braunfels ISD entered into a contract with ALPHA Facilities Solutions, LLC (ALPHA) to provide facility condition assessment and implementation services to forecast facility needs and justify funding requirements. The project was completed by a team consisting of engineers, architects, and construction professionals. Data collected during the Facility Condition Assessment phase of the project was input into APPS in order to estimate current and future funding requirements for facility sustainment. This predictive approach to asset management is known as Capital Planning and is used to anticipate funding and maintenance needs many years into the future.

The scope of work included the following:

1. Identify and document current and forecasted conditions of approximately 1,967,340 square feet of facilities.
2. Identify and document current site needs.
3. Identify and document remaining service life of major building systems to include envelope; architectural finishes; roofs; electrical; plumbing; and heating, ventilation, and air conditioning (HVAC).
4. Forecast facility renewal requirements based on lifecycle analysis of existing systems over the span of the next 20 years for each facility.
5. Provide Rough Order of Magnitude (ROM) cost estimates for building system renewal and site repairs.
6. Provide a Facility Condition Index (FCI) measurement to illustrate the relative condition of all facilities.

Acknowledgement

Overall Acknowledgement: Finally, the ALPHA Team would like to take this opportunity to thank New Braunfels ISD for allowing ALPHA to help the School District achieve its goals. We would also like to thank Rebecca Villareal and Daniel Dornier and their staff for investing a substantial amount of their valuable time to work with us on this project; their knowledge of the facilities was superb and their contributions were invaluable.

Facility Condition Assessment Approach

Asset Planning and Performance Software (APPS) was used to document facility conditions, to determine current requirements, and to forecast future requirements for facilities within the New Braunfels ISD. Parametric cost models contained within APPS were assigned to most buildings while new cost models were developed in instances where an appropriate cost model did not exist. New cost models developed by the ALPHA Team are also contained within APPS. System and component life cycles used within the cost models are based on average service life as shown in the Preventive Maintenance Guidebook: Best Practices to Maintain Efficient and Sustainable Buildings published by Building Owners and Managers Association (BOMA) International. When life cycle information is not provided by BOMA, we used our experience and professional judgment to suggest appropriate average service life for those components and systems. Unit costs, which are used to calculate renewal requirements, are also built into the cost models. Life cycles and unit costs have been adjusted on a location-specific basis as appropriate or as requested by School District personnel.

Although there are many factors that are important to obtain a successful outcome for a facility condition assessment, three provide the foundation for establishing a reliable cost model for each building. Those three factors are related to the following basic building information:

- Gross area
- Date built
- Building/location name

The gross area of a building, also known as gross square footage (GSF), is one of the basic building blocks for determining current replacement value (CRV) and generating system renewal costs, which are major components of a parametric-based effort. The date built for each facility provides the basis for establishing life cycles for many, and in some cases, all major building systems. Finally, although not critical to the outcome of the project, agreeing upon a building/location naming convention that is meaningful to all stakeholders enhances the usefulness and readability of the facility condition assessment report. Please note that GSF for each building was provided by the School District and generally was not validated as part of this project. It should be noted that some building names may have changed at the direction of the School District from what was indicated in documentation initially provided.

In order to determine basic building information, the ALPHA Team met with designated School District personnel to discuss School District-specific information such as building construction/renovation programs and building naming conventions. Scaled floor and site plans were generally not available, so square footages associated with additions and site features were obtained from a combination of sources to include School District records, satellite imagery, and professional judgment.

It is worth noting that, although most concealed systems may appear to be functional, the risk of failure increases with time when they have exceeded the average service life as predicted by BOMA. Consequently, this effort assumes that replacement of concealed systems that have exceeded the average service life as predicted by BOMA is appropriate. Based on the availability of resources and the tolerance for risk or potential out-of-service conditions, the School District may elect to defer immediate replacement of concealed systems that have exceeded average service life as appropriate.

Building condition requirements and site infrastructure requirements are documented within Asset Planning and Performance Software and based on estimated quantities, RS Means, and client supplied data when available.

Prioritization of Needs

Finally, all needs contained within APPS have been assigned a default priority based on importance to mission performance. Therefore, systems whose failure might render a building not suitable for occupancy have been ranked with a higher priority than those systems that have minimal or no impact on a facility's suitability for occupancy. For example, replacement of an HVAC system might take priority over replacement of flooring. The priority for a specific need can be changed if required and priorities can be further refined if desired by assignment of scores of one through 99. Although additional priorities are available within APPS, priorities used for this project are:

- High
- Medium
- Low

Needs contained within APPS have been ranked in terms of urgency in order to aid in the prioritization for allocation of funds. The priorities of applicable systems for this project are as follows:

High

- Electrical - Branch Wiring
- Electrical - Communications and Security
- Electrical - Lighting
- Electrical - Other Electrical Systems
- Electrical - Service & Distribution
- Fire Protection - Sprinklers
- HVAC - Controls & Instrumentation
- HVAC - Cooling Generating Systems
- HVAC - Distribution Systems
- HVAC - Heat Generating Systems
- HVAC - Terminal & Package Units
- Roofing

Medium

- Conveying
- Exterior Enclosure - Exterior Doors
- Exterior Enclosure - Exterior Windows
- Interior Construction - Interior Doors
- Plumbing - Domestic Water Distribution
- Plumbing - Plumbing Fixtures
- Plumbing - Sanitary Waste
- Site Development - Bleachers
- Site Development - Site Lighting

Low

- Exterior Enclosure - Exterior Walls
- Interior Construction - Fittings
- Interior Finishes - Ceiling Finishes
- Interior Finishes - Floor Finishes
- Interior Finishes - Wall Finishes
- Vehicular Pavements

Building Performance Metrics

As part of the FCA process, a facility condition index (FCI) was calculated for each facility. The FCI is used to quantify a facility's physical condition at a specific point in time and is calculated using the expired system replacement costs (costs associated with systems that are beyond average service life) and the current replacement value (CRV) of the building. Expired system replacement costs consist of work that is necessary to restore the facility to a condition equivalent to its original (like new) state.

The FCI can be helpful in several ways to include:

- Comparing the condition of one facility to a group of facilities
- Tracking trends (the extent of improvement or deterioration over time)
- Prioritizing capital improvement projects
- Making renovation versus replacement decisions

The FCI is calculated as shown in the example below.

Example 1: Total expired system replacement costs (Requirements) = \$3,000,000

Current Replacement Value (CRV) = \$10,000,000

$$FCI = \frac{\$3,000,000}{\$10,000,000} = .30$$



It is important to note there is no recognized standard for what constitutes an acceptable or unacceptable FCI. For example, the International Facility Management Association (IFMA) indicates that building condition is often defined in terms of the FCI as follows:

1. Good - 0% to 5%,
2. Fair - 5% to 10%,
3. Poor - 10% to 30%, and
4. Critical - greater than 30%

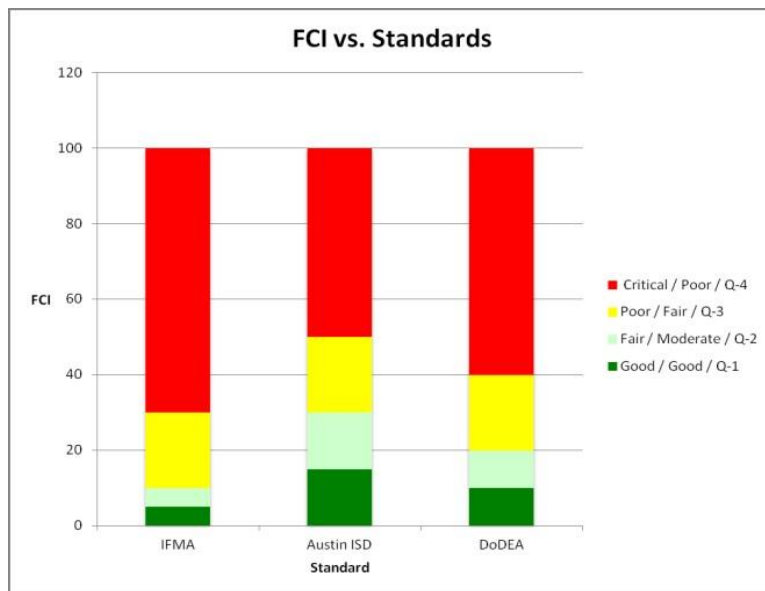


Figure 1. FCI Standards

renovations. For example, when cost of renovation reaches or exceeds 50% of the replacement cost of the facility, requirements to meet Americans with Disabilities Act (ADA), Life Safety and possibly other codes may be triggered. When the requirement to meet current building codes or civil rights statutes, such as those mentioned above are triggered, additional costs will be incurred. Although it is not possible to predict what the additional costs will be until project requirements are identified and cost estimates are prepared, it has been our experience that additional cost can be expected to range from 5% to 20% depending upon the age of the facility.

The Renovate Versus Replacement Question

A question that often arises is at what point does it make sense to replace a facility rather than to renovate it? Again, there is no industry standard, but conventional thinking is that replacement of a facility should be seriously considered when the FCI rises above 50%. However, the FCI is not the only consideration when making renovation versus replacement decisions. One consideration that should be taken into account is whether a facility is functionally adequate for the intended use. Another consideration revolves around the magnitude of needed

Categorization of Costs

At this point, it is appropriate to review the different types of costs associated with facility renovation and construction and how they apply to this project. According to the American Institute of Architects (AIA), facility capital costs are normally subdivided into three major categories - site costs, hard costs, and soft costs. Site costs are normally associated with the owner's initial land acquisition and development costs for a project and are not a consideration in the context of this project. Hard costs are associated with direct construction costs while soft costs can be defined as any indirect costs incurred in addition to the direct construction costs. Soft costs include a variety of costs such as design fees, legal fees, taxes, insurance, owner's administration costs, and financing costs. Cost data produced by the parametric cost models includes hard costs including consideration of renewal costs, which accounts for the additional cost associated with replacing an existing building system versus constructing the system in a new facility. Cost information within this report does not include soft costs.

It is important to remember that cost models are intended to produce rough order of magnitude (ROM) costs for purposes of developing a baseline from which to establish an FCI for each facility and to facilitate capital planning. It is not unusual for those new to the parametric cost estimating/life cycle analysis process to have expectations that are not completely in alignment with what the process is intended to yield. For example, the parametric cost estimating/life cycle analysis process generates ROM budgeting-level costs while costs that are more detailed are derived during formal preliminary design and final design cost estimating processes.

As a point of interest, *APPA: Leadership in Educational Facilities* published a paper citing research conducted by the *Building Research Board of the National Research Council* indicating, “Underfunding of maintenance and repair is a widespread and persistent problem.” The council concluded, “That an appropriate total budget allocation for routine maintenance and capital renewal is in the range of two to four percent of the aggregate current replacement value (CRV) of those facilities (excluding major infrastructure). When a backlog of deferred maintenance has been allowed to accumulate, spending must exceed this minimum level until the backlog has been eliminated.

Facility Condition Assessment

Facility-related data contained in this report was developed at the building level, which in turn, was rolled up at the campus level. Likewise, site infrastructure requirements were rolled up at the campus level. All data was then rolled up to provide an aggregate view of District facilities. Data within this report has been grouped as follows:

- Middle School
- High School
- Facilities
- Transportation and Maintenance
- Administration
- Other
- Elementary School

This report includes the following content, which is found at campus and/or Executive Summary levels:

- Facility Description: Summary of Findings
- Current Needs (2026)
- Forecasted Needs (2031)
- Current and Forecasted Needs: Summarized by Reporting Period
- Current and Forecasted Needs: Summarized by System
- Need Priorities (High - Medium - Low)

Appendix B - Supplemental Information provides additional information the reader may find useful.

Site and Infrastructure Condition Assessment

A site infrastructure assessment was included in the scope of work for this project. The site infrastructure assessment is a visual evaluation of the site systems. The teams walked each site to determine the general condition of the systems and categorized them as follows:

- Good condition
- In need of repair
- In need of replacement

Estimated quantities were calculated by digitizing marked-up Google Earth aerial photographs. Google Earth Aerial photographs were used in lieu of site plans.

The site assessment was performed and the subsequent results grouped by location. Findings for each location were divided as follows:

- Pedestrian Pavements
- Vehicular Pavements
- Site Development

Please note that not all locations have all of the various infrastructure systems present.

We determined unit pricing for the various deficiency requirements by referencing 2026 RSMeans Building Construction Cost Data and Assembly Cost Data when available; industry sources were used as a supplemental source for unit pricing when needed.

This page is intentionally left blank.

Overview of Findings

Overview of Findings: The Facility Condition Assessment and School District implementation project included 44 permanent facilities, totaling 1,968,740 square feet. The average FCI for the facilities assessed is 6 while the average FCI in five years is estimated to be 9 assuming current facility sustainment funding levels. The assessment team made the following general observations:


1. Twelve facilities assessed were noted to utilize either the original domestic water piping or piping constructed before 1985. It is recommended that any building constructed before 1985 have a water quality test performed on a regular basis. The following buildings were noted to meet these conditions: Seele Elementary-Building 1, Administration Center-Building 1040, Seele Elementary-Building 3, Seele Elementary-Building 5, Carl Schurz Elementary-Building A/B, Carl Schurz Elementary-Building C, Carl Schurz Elementary-Building D, Carl Schurz Elementary-Building E, Carl Schurz Elementary-Building G, and Lone Star Early Childhood Center plus an additional 2 buildings.
2. Eleven facilities assessed were noted to have roof covering systems beyond their recommended life. The following buildings were noted to meet these conditions: Carl Schurz Elementary-Building C, Carl Schurz Elementary-Building E, Carl Schurz Elementary-Building G, Carl Schurz Elementary-Building K, County Line Elementary, Lone Star Early Childhood Center, Oak Run Middle School, Planning and Construction, Two Rivers Gymnasium, and Two Rivers High School plus an additional 1 building.
3. Nineteen facilities assessed were noted to utilize branch wiring that is 30+ years old, the recommended life cycle as defined by BOMA. It is recommended that infrared testing be performed on these systems prior to extending their life cycles. The following buildings were noted to meet these conditions: Seele Elementary-Building 1, Administration Center-Building 1040, Seele Elementary-Building 3, Seele Elementary-Building 4, Seele Elementary-Building 5, Carl Schurz Elementary-Building A/B, Carl Schurz Elementary-Building C, Carl Schurz Elementary-Building D, Carl Schurz Elementary-Building E, and Carl Schurz Elementary-Building G plus an additional 9 buildings.
4. Three facilities assessed were noted to have either a portion of or the entire fire alarm and detection system beyond the recommended useful life of 15 years. The following buildings were noted to meet these conditions: Seele Elementary-Building 1, Klein Road Elementary, and Planning and Construction.
5. Nine of the facilities assessed were noted to be using HVAC distribution system that is beyond the recommended lifecycle of 30 years. The following buildings were noted to meet these conditions: Seele Elementary-Building 1, Seele Elementary-Building 5, Carl Schurz Elementary-Building C, Carl Schurz Elementary-Building G, Carl Schurz Elementary-Building K, County Line Elementary, Lone Star Early Childhood Center, Oak Run Middle School, and Walnut Springs Elementary.
6. The majority of the floor finish system was observed to be in good condition. 25 facilities assessed were observed to have sections of or complete floor finishes in good condition with minimal to no deficiencies observed. The majority of the ceiling finish system was observed to be in good condition. 22 facilities assessed were observed to have sections of or complete ceiling finishes in good condition with minimal to no deficiencies observed. The majority of the wall finish system was observed to be in good condition. 31 facilities assessed were observed to have sections of or complete wall finishes in good condition with minimal to no deficiencies observed.
7. Several facilities were observed to have foundation issues including Carl Schurz Elementary, Klein Road Elementary, Walnut Springs Elementary, Lone Star Early Childhood Center, New Braunfels Middle School, Long Creek High School, Seele Elementary, and Planning and

Construction. Additional structural analysis is recommended to determine the root cause of noted foundation issues. When considering future expenditures for repairs in this facility, the findings and fiscal ramifications of a more detailed structural analysis of foundation issues may be significant. The financial burden of structural repairs from these foundation issues, which are not vetted in this report, may lead to a determination against investing significant resources for other more obvious repair needs.

8. Inadequate parking was observed at 3 facilities including Carl Schurz Elementary, Two Rivers High School, Support Services, and Seele Elementary.


The information shown in the figure below shows the current (2026) FCI for all School District facilities in order of "worst first". The farthest right point on the blue bar for each building indicates the current FCI.

Figure 2. Current Facility Condition: New Braunfels ISD

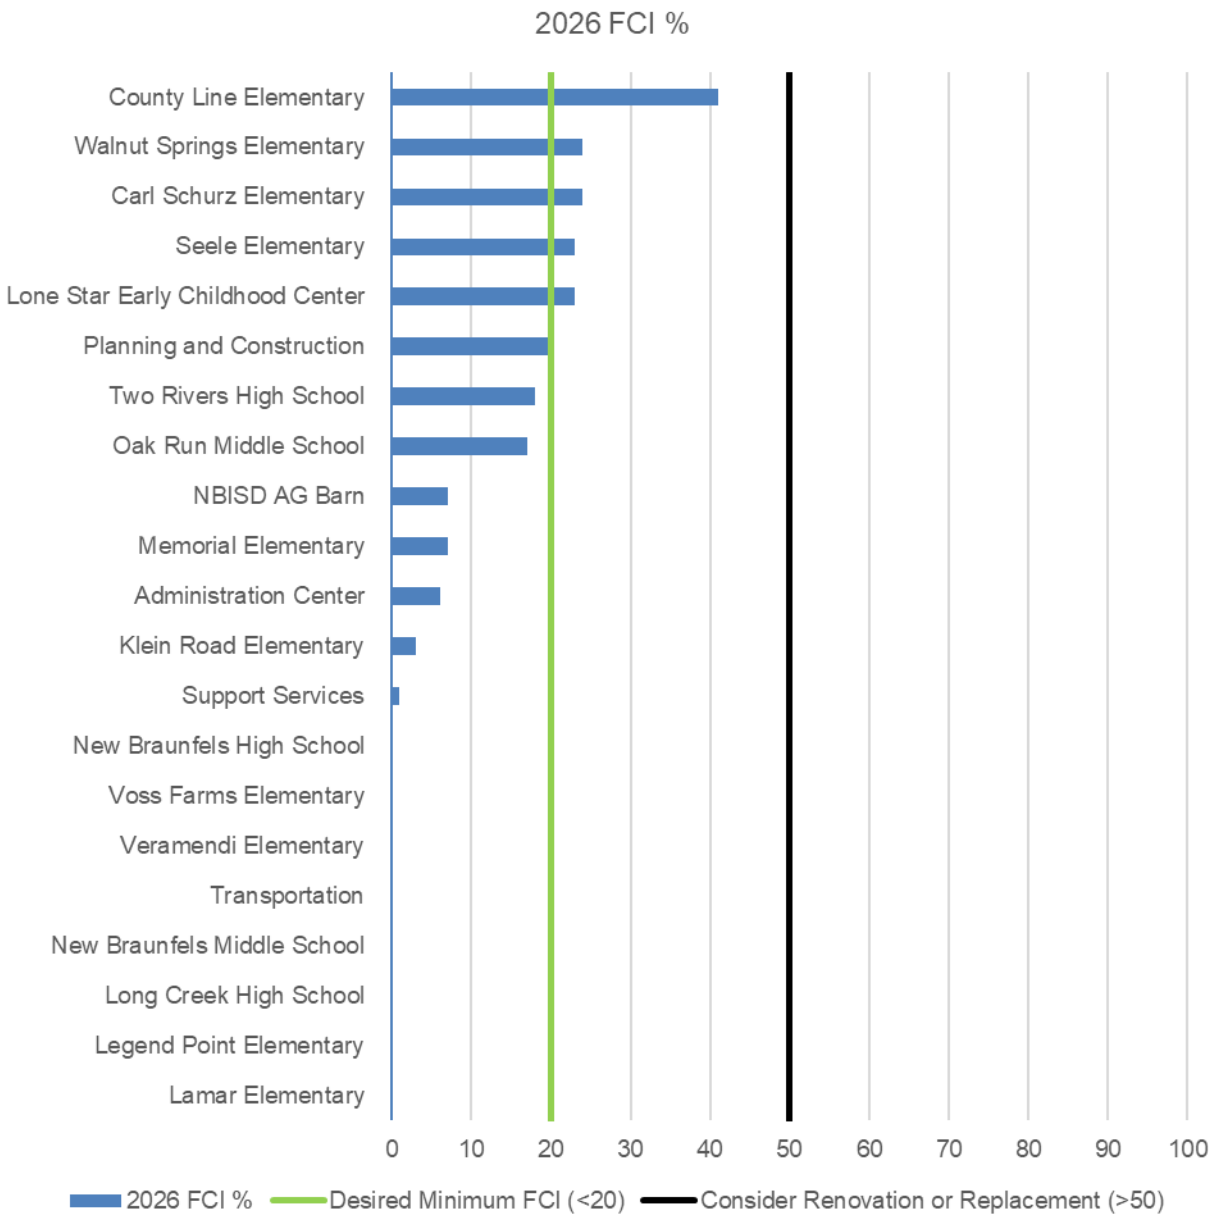

The information shown in the figure below shows the forecast (2031) FCI for all School District facilities in order of "worst first". The farthest right point on the blue bar for each building indicates the forecast FCI.

Figure 3. Forecast Facility Condition: New Braunfels ISD

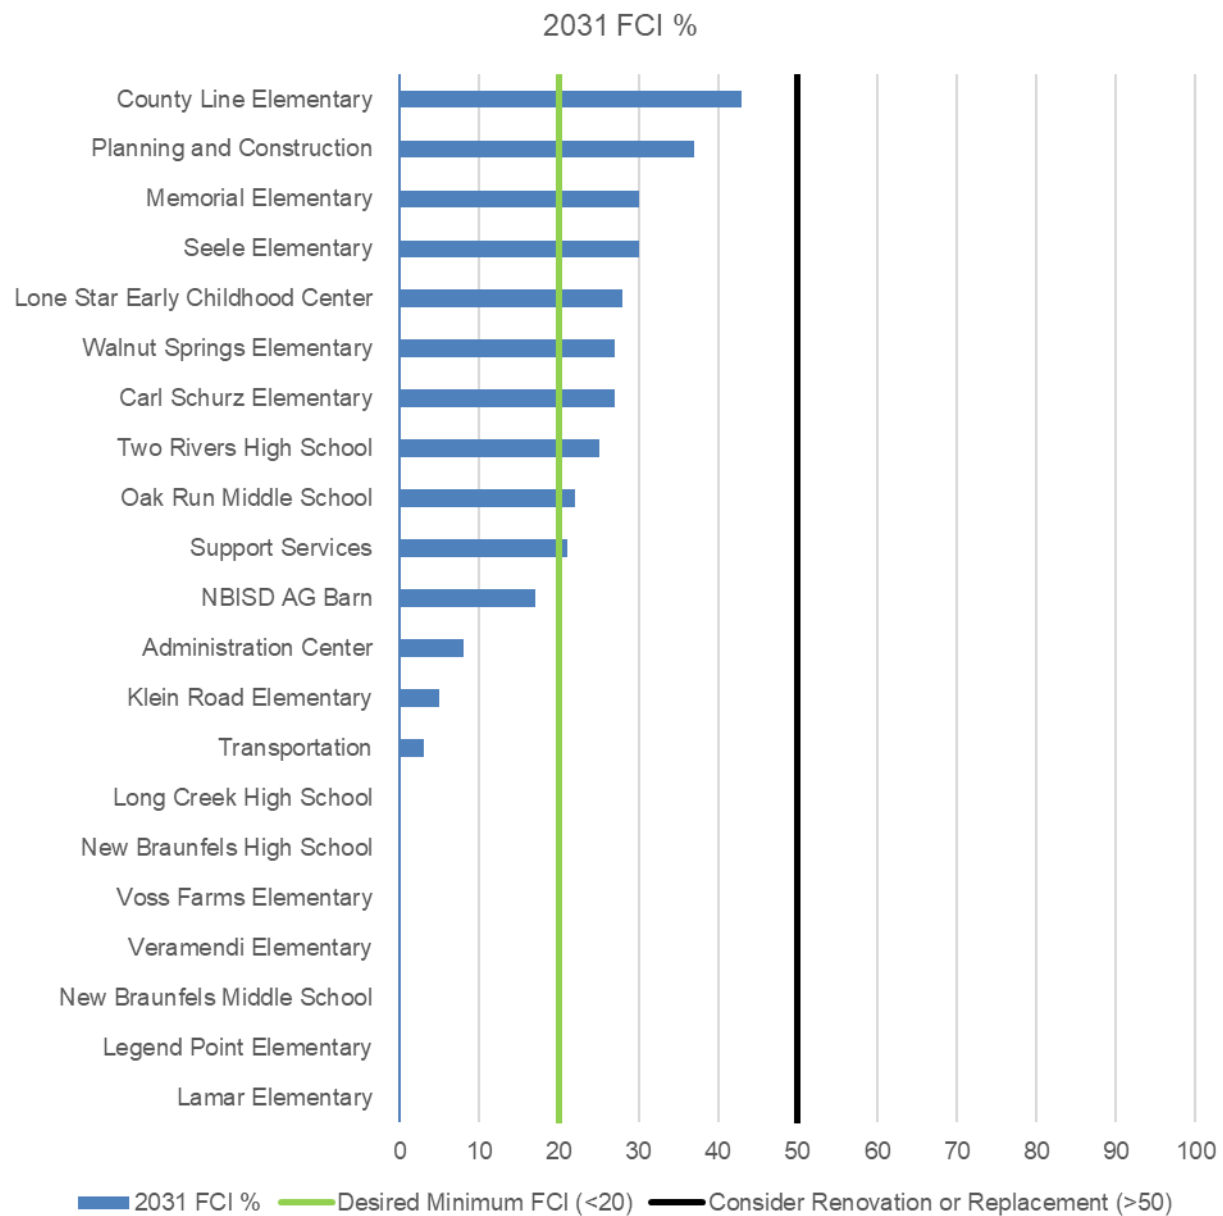

The following table summarizes findings by group. Please note the column labeled "Total Needs 2031" assumes no additional capital renewal funding is provided. A comprehensive list of expired systems and those expected to expire between now and the Year 2046 is shown in the Current and Forecasted Needs: Summarized by System - New Braunfels ISD Table.

Table 1. Facility Description: Summary of Findings: New Braunfels ISD


Group	Area (SF)	Total Needs 2026	Current Replacement Value	2026 FCI %	Total Needs 2031	2031 FCI %
Administration	54,361	\$1,235,234	\$12,952,867	10	\$2,083,707	16
Elementary School	845,311	\$28,318,325	\$292,106,591	10	\$37,683,341	13
Facilities	80,447	\$4,056,902	\$27,210,005	15	\$6,569,675	24
High School	615,350	\$141,246	\$225,911,426	0	\$1,001,269	0
Middle School	352,457	\$10,573,948	\$133,428,916	8	\$13,379,767	10
Other	9,000	\$140,239	\$1,888,559	7	\$319,386	17
Transportation and Maintenance	11,814	\$0	\$3,062,751	0	\$101,583	3
SUBTOTAL	1,968,740	\$44,465,893	\$696,561,115	6	\$61,138,728	9
Site and Infrastructure (excluded from FCI calculations)		\$489,151			\$489,151	
TOTALS	1,968,740	\$44,955,044	\$696,561,115		\$61,627,879	

Note: The average FCI for the New Braunfels ISD facilities assessed is 6 while the average FCI in 5 years is estimated to be 9 assuming current sustainment levels.

The following Figures show the current and forecasted needs respectively for all facilities. Needs are grouped as follows:

- Conveying
- Electrical
- Exterior Enclosure
- HVAC
- Interiors
- Life Safety
- Plumbing
- Roofing
- Site Infrastructure
- Sports

Figure 4. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by System Group: New Braunfels ISD

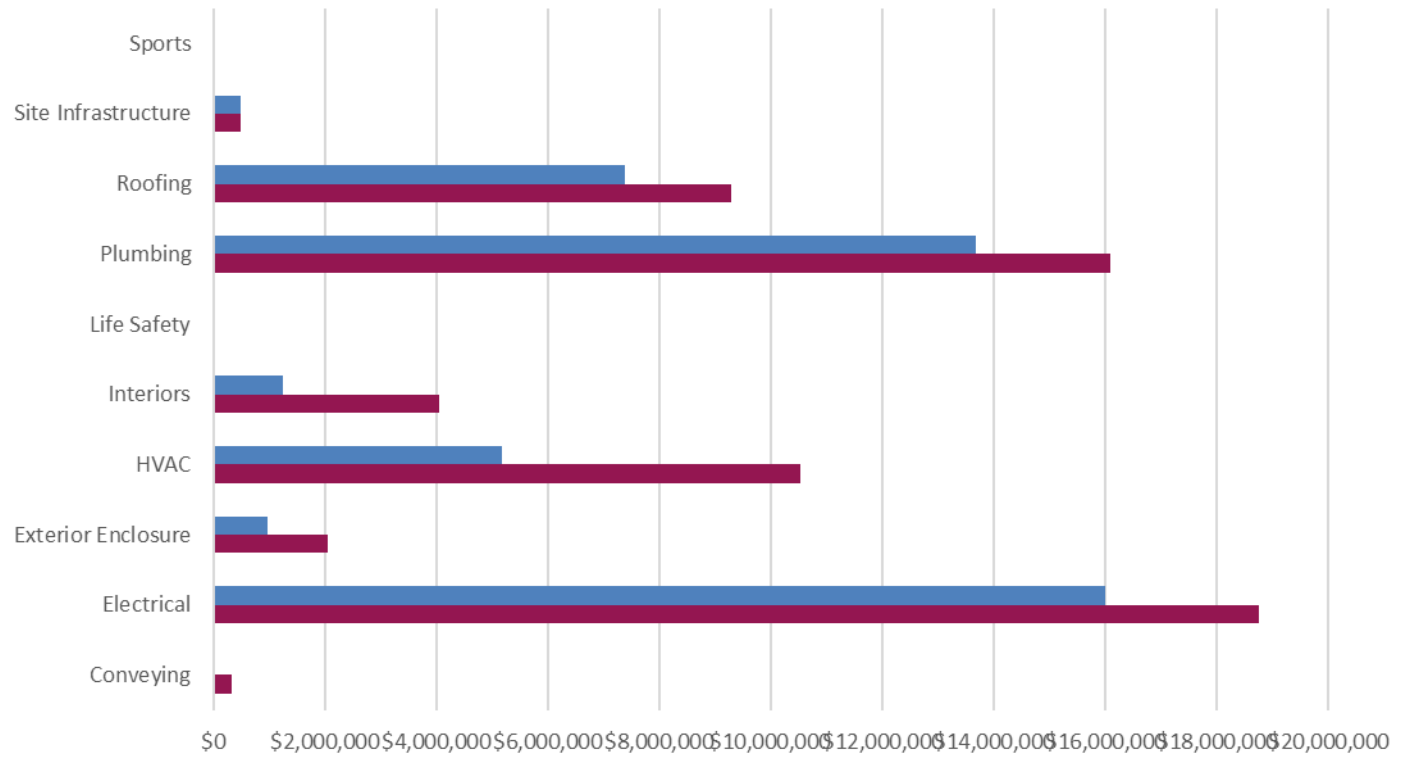


	Conveying	Electrical	Exterior Enclosure	HVAC	Interiors	Life Safety	Plumbing	Roofing	Site Infrastructure	Sports
■ 2026	\$0	\$15,990,266	\$983,070	\$5,170,382	\$1,256,235	\$0	\$13,688,295	\$7,377,647	\$489,151	\$0
■ 2031	\$330,269	\$18,759,899	\$2,062,872	\$10,528,205	\$4,059,930	\$0	\$16,097,454	\$9,300,098	\$489,151	\$0

Figures below show the current and forecasted needs respectively for all School District facilities grouped by location.

Figure 5. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Group: New Braunfels ISD



Figure 6. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Priority: New Braunfels ISD

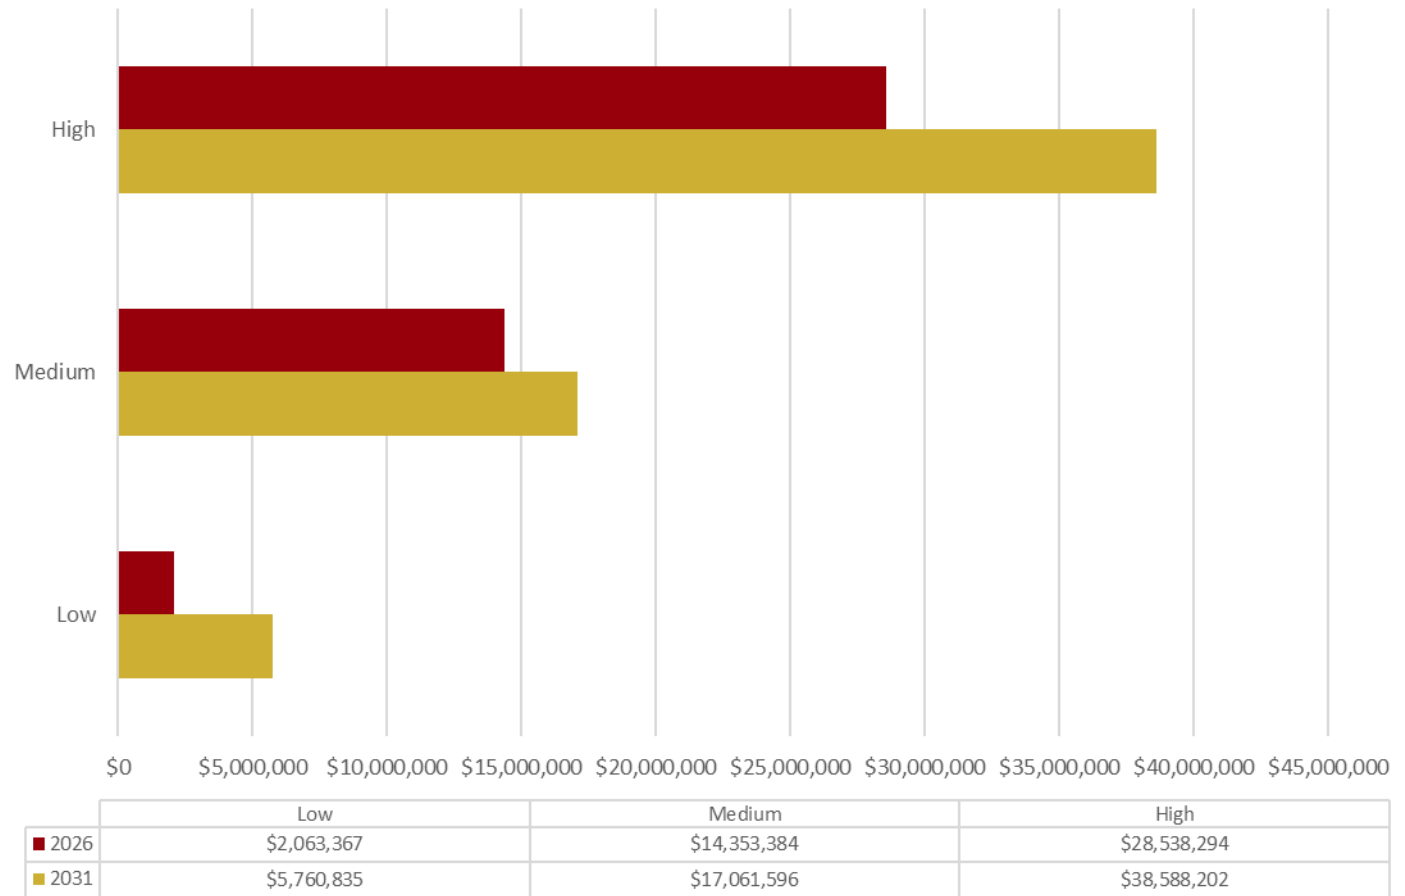

Note: Forecasted Needs (2031) include Current Needs (2026)

Figure 7. Current and Forecasted Needs: Summarized by Reporting Period Current +10 Years: New Braunfels ISD


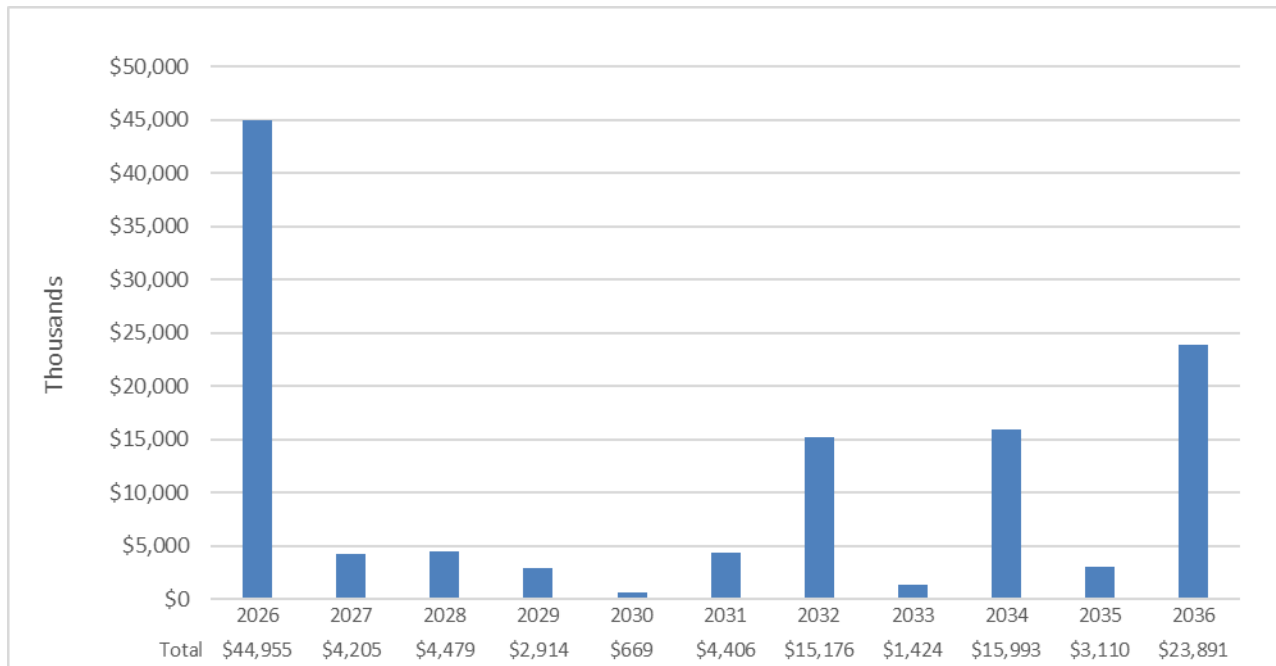


Figure 8. Current and Forecasted Needs: Summarized by Reporting Period Years 11-20: New Braunfels ISD

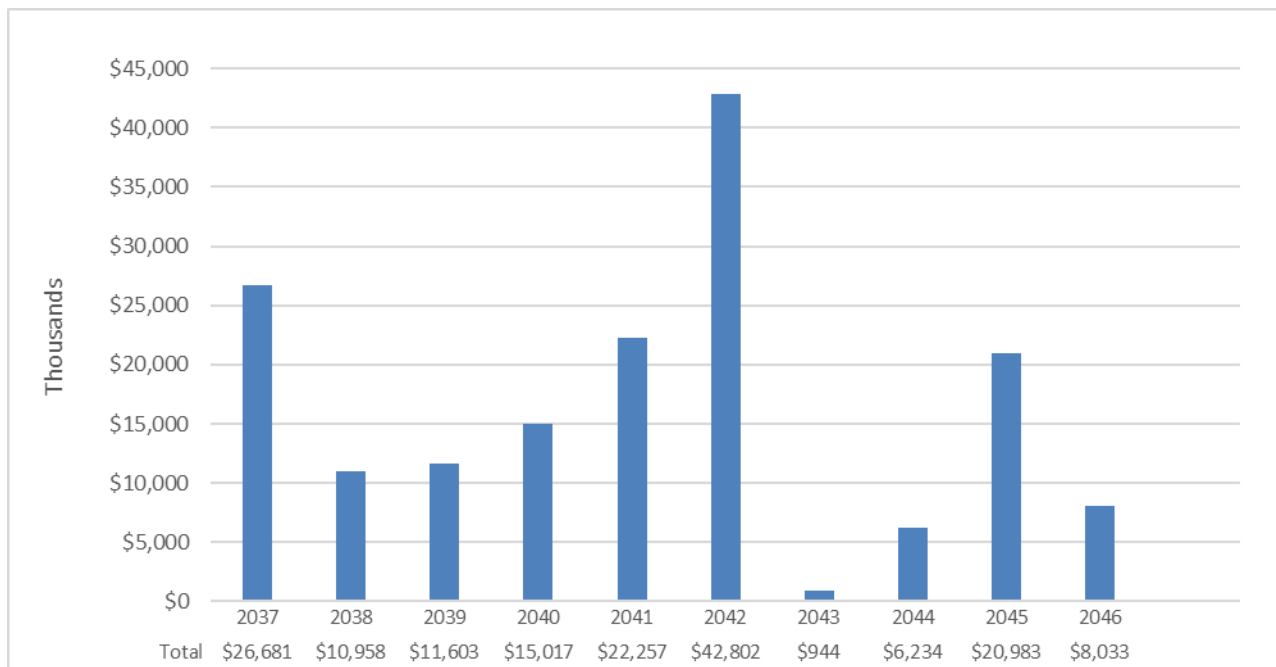

This page is intentionally left blank.

Table 2. Current and Forecasted Needs Summarized by System (Current + 5 years): New Braunfels ISD

System	2026	2027	2028	2029	2030	2031
Cumulative Needs by Year	\$44,955,044	\$49,160,303	\$53,639,766	\$56,553,721	\$57,222,271	\$61,627,879
Needs by Year	\$44,955,044	\$4,205,258	\$4,479,463	\$2,913,955	\$668,550	\$4,405,608
Exterior Enclosure	\$983,070	\$685,443	\$376,057	\$0	\$18,302	\$0
Exterior Walls (Finishes)	\$595,049	\$587,192	\$376,057	\$0	\$18,302	\$0
Exterior Windows	\$166,401	\$88,061	\$0	\$0	\$0	\$0
Exterior Doors	\$221,620	\$10,190	\$0	\$0	\$0	\$0
Roofing	\$7,377,647	\$1,689,826	\$0	\$232,625	\$0	\$0
Roof Coverings	\$7,377,647	\$1,689,826	\$0	\$232,625	\$0	\$0
Interior Construction	\$742,872	\$0	\$0	\$0	\$243,369	\$0
Interior Doors	\$277,068	\$0	\$0	\$0	\$87,779	\$0
Specialties	\$465,804	\$0	\$0	\$0	\$155,590	\$0
Interiors	\$513,363	\$843,702	\$45,064	\$146,050	\$0	\$1,525,511
Ceiling Finishes	\$86,224	\$56,119	\$0	\$0	\$0	\$102,606
Floor Finishes	\$211,810	\$775,277	\$5,122	\$0	\$0	\$389,367
Wall Finishes	\$215,328	\$12,306	\$39,942	\$146,050	\$0	\$1,033,537
Conveying	\$0	\$113,024	\$0	\$0	\$113,024	\$104,222
Conveying Systems	\$0	\$113,024	\$0	\$0	\$113,024	\$104,222
Electrical	\$15,990,266	\$74,314	\$1,397,433	\$854,948	\$105,493	\$337,445
Branch Wiring	\$11,914,035	\$0	\$1,397,433	\$0	\$0	\$337,445
Communications & Security	\$980,822	\$74,314	\$0	\$553,840	\$0	\$0
Lighting	\$983,810	\$0	\$0	\$0	\$0	\$0
Service Distribution	\$543,847	\$0	\$0	\$45,629	\$105,493	\$0
Exit Signs and Emergency Lighting	\$1,567,753	\$0	\$0	\$255,480	\$0	\$0
Plumbing	\$13,688,295	\$528,735	\$1,727,276	\$0	\$0	\$153,148
Domestic Water Distribution	\$2,343,419	\$0	\$227,591	\$0	\$0	\$29,202
Plumbing Fixtures	\$1,592,013	\$528,735	\$0	\$0	\$0	\$0
Sanitary Waste	\$9,752,863	\$0	\$1,499,684	\$0	\$0	\$123,946
HVAC	\$5,170,382	\$270,215	\$933,633	\$1,680,332	\$188,362	\$2,285,281
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$200,119	\$167,708	\$37,749	\$77,277	\$76,260	\$461,881
Distribution System	\$4,943,254	\$102,506	\$854,768	\$1,118,035	\$90,368	\$1,281,700
Heat Generation	\$0	\$0	\$6,355	\$10,740	\$0	\$130,595
Terminal & Package Units	\$27,009	\$0	\$34,762	\$474,280	\$21,734	\$411,105
Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0	\$0
Site Infrastructure	\$489,151	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$489,151	\$0	\$0	\$0	\$0	\$0
Sports	\$0	\$0	\$0	\$0	\$0	\$0
Bleachers	\$0	\$0	\$0	\$0	\$0	\$0

Table 3. Current and Forecasted Needs Summarized by System (Years 6 - 10): New Braunfels ISD

System	2032	2033	2034	2035	2036
Cumulative Needs by Year	\$76,803,629	\$78,227,368	\$94,219,952	\$97,329,700	\$121,220,423
Needs by Year	\$15,175,750	\$1,423,739	\$15,992,584	\$3,109,748	\$23,890,723
Exterior Enclosure	\$15,187	\$0	\$360,399	\$378,631	\$159,114
Exterior Walls (Finishes)	\$15,187	\$0	\$171,900	\$361,472	\$159,114
Exterior Windows	\$0	\$0	\$0	\$17,159	\$0
Exterior Doors	\$0	\$0	\$188,499	\$0	\$0
Roofing	\$1,339,634	\$0	\$0	\$1,189,796	\$409,116
Roof Coverings	\$1,339,634	\$0	\$0	\$1,189,796	\$409,116
Interior Construction	\$0	\$0	\$407,254	\$0	\$0
Interior Doors	\$0	\$0	\$322,613	\$0	\$0
Specialties	\$0	\$0	\$84,641	\$0	\$0
Interiors	\$4,604,267	\$1,193,052	\$11,656,345	\$852,411	\$3,992,051
Ceiling Finishes	\$4,266,804	\$1,193,052	\$72,546	\$96,911	\$1,168,080
Floor Finishes	\$0	\$0	\$9,921,238	\$358,727	\$2,385,533
Wall Finishes	\$337,462	\$0	\$1,662,561	\$396,773	\$438,438
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$4,800,668	\$0	\$268,587	\$54,827	\$13,090,061
Branch Wiring	\$0	\$0	\$0	\$38,963	\$0
Communications & Security	\$1,795,016	\$0	\$268,587	\$0	\$2,058,599
Lighting	\$1,881,617	\$0	\$0	\$0	\$11,031,462
Service Distribution	\$0	\$0	\$0	\$15,864	\$0
Exit Signs and Emergency Lighting	\$1,124,034	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$227,712	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$132,832	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$94,880	\$0
HVAC	\$1,466,454	\$230,687	\$3,299,999	\$406,370	\$6,240,382
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$6,223,795
Cooling Generation	\$319,529	\$0	\$889,700	\$129,642	\$5,847
Distribution System	\$874,448	\$40,926	\$1,947,236	\$276,728	\$0
Heat Generation	\$16,205	\$0	\$92,020	\$0	\$0
Terminal & Package Units	\$256,272	\$189,760	\$371,043	\$0	\$10,740
Fire Protection	\$2,177,408	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$2,177,408	\$0	\$0	\$0	\$0
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0
Sports	\$772,133	\$0	\$0	\$0	\$0
Bleachers	\$772,133	\$0	\$0	\$0	\$0

Table 4. Current and Forecasted Needs Summarized by System (Years 11 - 15): New Braunfels ISD

System	2037	2038	2039	2040	2041
Cumulative Needs by Year	\$147,901,606	\$158,859,140	\$170,462,272	\$185,479,293	\$207,736,734
Needs by Year	\$26,681,183	\$10,957,534	\$11,603,132	\$15,017,021	\$22,257,441
Exterior Enclosure	\$8,991	\$1,710,456	\$443,831	\$817,848	\$662,699
Exterior Walls (Finishes)	\$8,991	\$1,195,269	\$186,359	\$469,111	\$662,699
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$515,187	\$257,472	\$348,737	\$0
Roofing	\$574,746	\$0	\$351,114	\$179,853	\$666,576
Roof Coverings	\$574,746	\$0	\$351,114	\$179,853	\$666,576
Interior Construction	\$0	\$3,569,035	\$1,709,897	\$2,899,493	\$0
Interior Doors	\$0	\$1,029,723	\$536,270	\$836,026	\$0
Specialties	\$0	\$2,539,312	\$1,173,627	\$2,063,467	\$0
Interiors	\$1,548,385	\$9,612	\$1,732,166	\$4,887,982	\$1,107,834
Ceiling Finishes	\$8,816	\$0	\$642,926	\$0	\$1,107,834
Floor Finishes	\$1,539,569	\$9,612	\$1,089,241	\$4,627,013	\$0
Wall Finishes	\$0	\$0	\$0	\$260,969	\$0
Conveying	\$0	\$0	\$226,047	\$0	\$0
Conveying Systems	\$0	\$0	\$226,047	\$0	\$0
Electrical	\$19,368,155	\$1,028,612	\$2,779,829	\$6,040,115	\$9,482,661
Branch Wiring	\$0	\$11,132	\$2,247,813	\$0	\$0
Communications & Security	\$2,025,955	\$0	\$57,476	\$6,040,115	\$3,854,948
Lighting	\$16,701,282	\$0	\$359,547	\$0	\$5,067,215
Service Distribution	\$0	\$1,017,480	\$76,623	\$0	\$30,123
Exit Signs and Emergency Lighting	\$640,919	\$0	\$38,370	\$0	\$530,376
Plumbing	\$0	\$37,952	\$2,827,134	\$0	\$7,675,207
Domestic Water Distribution	\$0	\$37,952	\$449,714	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$7,675,207
Sanitary Waste	\$0	\$0	\$2,377,420	\$0	\$0
HVAC	\$4,437,370	\$3,757,470	\$1,533,114	\$191,730	\$2,629,887
Controls and Instrumentation	\$4,210,179	\$0	\$208,106	\$0	\$1,763,090
Cooling Generation	\$219,375	\$1,064,590	\$0	\$191,730	\$814,965
Distribution System	\$2,415	\$2,667,575	\$1,122,410	\$0	\$2,415
Heat Generation	\$0	\$6,101	\$12,202	\$0	\$47,917
Terminal & Package Units	\$5,402	\$19,205	\$190,396	\$0	\$1,500
Fire Protection	\$0	\$844,397	\$0	\$0	\$32,576
Sprinklers & Standpipe	\$0	\$844,397	\$0	\$0	\$32,576
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0
Sports	\$743,535	\$0	\$0	\$0	\$0
Bleachers	\$743,535	\$0	\$0	\$0	\$0

Table 5. Current and Forecasted Needs Summarized by System (Years 16 - 20): New Braunfels ISD

System	2042	2043	2044	2045	2046
Cumulative Needs by Year	\$250,538,380	\$251,482,297	\$257,715,994	\$278,698,532	\$286,731,171
Needs by Year	\$42,801,646	\$943,917	\$6,233,697	\$20,982,538	\$8,032,638
Exterior Enclosure	\$1,303,938	\$0	\$81,269	\$169,282	\$499,127
Exterior Walls (Finishes)	\$1,065,339	\$0	\$45,302	\$169,282	\$371,112
Exterior Windows	\$15,366	\$0	\$0	\$0	\$0
Exterior Doors	\$223,232	\$0	\$35,967	\$0	\$128,015
Roofing	\$0	\$83,009	\$1,727,378	\$2,288,181	\$0
Roof Coverings	\$0	\$83,009	\$1,727,378	\$2,288,181	\$0
Interior Construction	\$2,104,207	\$0	\$557,590	\$0	\$1,472,728
Interior Doors	\$580,663	\$0	\$297,742	\$0	\$518,688
Specialties	\$1,523,544	\$0	\$259,848	\$0	\$954,040
Interiors	\$1,246,916	\$50,709	\$0	\$2,532,224	\$230,337
Ceiling Finishes	\$1,174,899	\$0	\$0	\$2,532,224	\$0
Floor Finishes	\$72,017	\$50,709	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$230,337
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$13,858,616	\$0	\$1,818,056	\$11,841,409	\$248,977
Branch Wiring	\$11,236,148	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$2,622,469	\$0	\$1,796,877	\$10,788,206	\$0
Service Distribution	\$0	\$0	\$0	\$0	\$248,977
Exit Signs and Emergency Lighting	\$0	\$0	\$21,179	\$1,053,202	\$0
Plumbing	\$14,341,201	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$1,772,480	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$8,311,669	\$0	\$0	\$0	\$0
Sanitary Waste	\$4,257,051	\$0	\$0	\$0	\$0
HVAC	\$9,946,768	\$810,199	\$2,049,404	\$4,151,443	\$5,581,469
Controls and Instrumentation	\$0	\$0	\$75,986	\$2,966,235	\$0
Cooling Generation	\$901,711	\$0	\$1,176,692	\$394,518	\$1,822,614
Distribution System	\$8,994,941	\$656,090	\$565,913	\$669,690	\$2,822,065
Heat Generation	\$0	\$95,833	\$0	\$0	\$0
Terminal & Package Units	\$50,116	\$58,275	\$230,814	\$120,999	\$936,791
Fire Protection	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0
Sports	\$0	\$0	\$0	\$0	\$0
Bleachers	\$0	\$0	\$0	\$0	\$0

The following table provides an overall summary of findings for the portfolio of buildings included in this project.

Table 6. Facility Description: Summary of Findings: New Braunfels ISD

Campus Name	Age (Years)	Area (SF)	Total Building Needs 2026	Current Replacement Value	2026 FCI %	Total Building Needs 2031	2031 FCI %
Administration Center	36-62	39,084	\$518,214	9,312,740	6	\$753,522	8
Carl Schurz Elementary	36-101	53,381	\$4,386,449	18,446,397	24	\$4,945,594	27
County Line Elementary	40	59,240	\$8,397,560	20,471,039	41	\$8,707,430	43
Klein Road Elementary	17	98,000	\$871,961	33,864,987	3	\$1,746,848	5
Lamar Elementary	1	106,000	\$0	36,629,476	0	\$0	0
Legend Point Elementary	1	102,000	\$0	35,247,231	0	\$0	0
Lone Star Early Childhood Center	81	53,813	\$4,250,453	18,595,679	23	\$5,146,386	28
Long Creek High School	14	413,650	\$0	151,420,341	0	\$728,108	0
Memorial Elementary	28	62,419	\$1,596,779	21,569,578	7	\$6,382,180	30
NBISD AG Barn	18-21	9,000	\$140,239	1,888,559	7	\$319,386	17
New Braunfels High School	1-31	201,700	\$141,246	74,491,085	0	\$273,162	0
New Braunfels Middle School	5	190,000	\$0	71,907,331	0	\$0	0
Oak Run Middle School	34	162,457	\$10,573,948	61,521,585	17	\$13,379,767	22
Planning and Construction	62	15,277	\$717,020	3,640,127	20	\$1,330,185	37
Seele Elementary	32-76	51,420	\$4,091,195	17,768,751	23	\$5,243,140	30
Support Services	25	19,500	\$56,892	4,646,363	1	\$962,682	21
Transportation	14-17	11,814	\$0	3,062,751	0	\$101,583	3
Two Rivers High School	38-102	60,947	\$4,000,010	22,563,642	18	\$5,606,993	25
Veramendi Elementary	9	102,000	\$0	35,247,231	0	\$98,009	0
Voss Farms Elementary	9	101,000	\$0	34,901,670	0	\$106,753	0
Walnut Springs Elementary	37	56,038	\$4,723,928	19,364,552	24	\$5,306,999	27
TOTALS		1,968,740	\$44,465,893	696,561,115		\$61,138,728	

The following table illustrates the current estimated needs by campus.

Table 7. Summary of Current Deficiencies: New Braunfels ISD

Name	Year Built	Age (Years)	Building System	Site	Current Estimated Needs
Administration Center	1964	62	\$518,214	\$0	\$518,214
Carl Schurz Elementary	1925	101	\$4,386,449	\$90,362	\$4,476,811
County Line Elementary	1986	40	\$8,397,560	\$0	\$8,397,560
Klein Road Elementary	2009	17	\$871,961	\$6,384	\$878,345
Lamar Elementary	2025	1	\$0	\$0	\$0
Legend Point Elementary	2025	1	\$0	\$0	\$0
Lone Star Early Childhood Center	1945	81	\$4,250,453	\$15,420	\$4,265,873
Long Creek High School	2012	14	\$0	\$262,710	\$262,710
Memorial Elementary	1998	28	\$1,596,779	\$0	\$1,596,779
NBISD AG Barn	2005	21	\$140,239	\$0	\$140,239
New Braunfels High School	2025	1	\$141,246	\$0	\$141,246
New Braunfels Middle School	2021	5	\$0	\$0	\$0
Oak Run Middle School	1992	34	\$10,573,948	\$0	\$10,573,948
Planning and Construction	1964	62	\$717,020	\$82,775	\$799,795
Seele Elementary	1950	76	\$4,091,195	\$31,500	\$4,122,695
Support Services	2001	25	\$56,892	\$0	\$56,892
Transportation	2009	17	\$0	\$0	\$0
Two Rivers High School	1924	102	\$4,000,010	\$0	\$4,000,010
Veramendi Elementary	2017	9	\$0	\$0	\$0
Voss Farms Elementary	2017	9	\$0	\$0	\$0
Walnut Springs Elementary	1989	37	\$4,723,928	\$0	\$4,723,928
				Total Estimated Needs	\$44,955,044

Note: Please note that requirements are based on visual observations and interviews with School District personnel.

MIDDLE SCHOOL
FACILITY CONDITION INFORMATION

Middle School

The project included facilities at 2 locations totaling approximately 352,457 square feet. The table below contains location-specific information regarding current and forecast Facility Condition Indices. A comprehensive list of expired systems and those expected to expire between now and the Year 2046 is shown in the Forecasted Needs Summarized by System: Middle School Table.

Table 8. Facility Description: Summary of Findings: Middle School

Name	Area (SF)	Total Needs 2026	Current Replacement Value	2026 FCI %	Total Needs 2031	2031 FCI %
New Braunfels Middle School	190,000	\$0	71,907,331	0	\$0	0
Oak Run Middle School	162,457	\$10,573,948	61,521,585	17	\$13,379,767	22
SUBTOTAL	352,457	\$10,573,948	\$133,428,916	8	\$13,379,767	10
Site and Infrastructure (excluded from FCI calculations)		\$0			\$0	
TOTALS	352,457	\$10,573,948	\$133,428,916		\$13,379,767	


Note: The average FCI for the Middle School facilities assessed is 8 while the average FCI in 5 years is estimated to be 10 assuming current sustainment levels.

Figures below show the current and forecasted needs respectively for all Middle School locations grouped by system.

Figure 9. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by System Group: Middle School



Figure 10. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Priority: Middle School

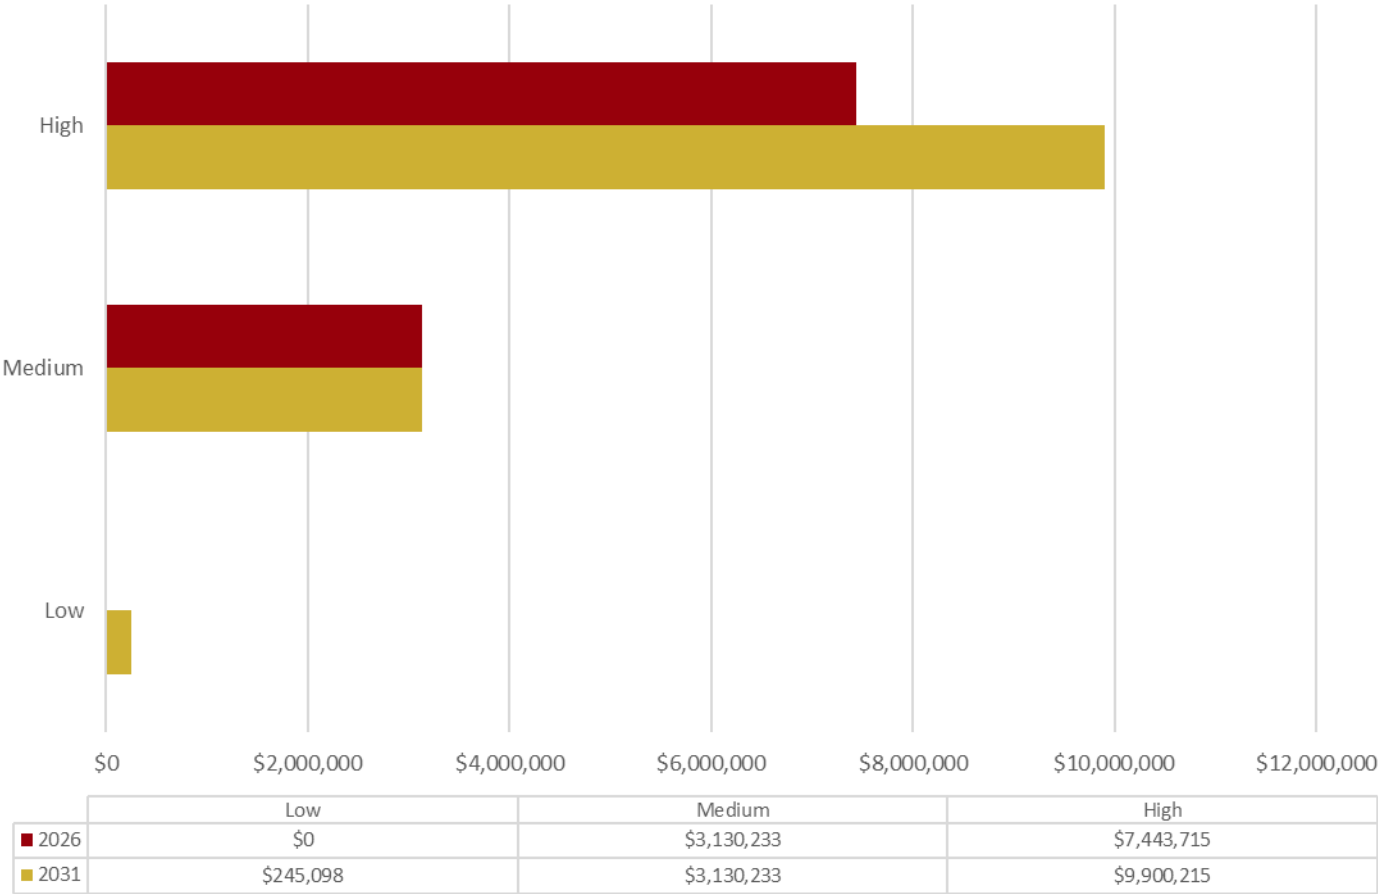

Renewal Forecast

The renewal forecast below for Middle School locations shows the current backlog and projected facility sustainment requirements over the next 20 years. Please note the renewal forecast does not include potential costs associated with asbestos abatement, seismic evaluation; seismic retrofitting; hazardous material inspection, evaluation, and mitigation; and NFPA 101 and ADA upgrades. The renewal forecast is shown in the following figures:

Figure 11. Current and Forecasted Needs: Summarized by Reporting Period Current +10 Years: Middle School


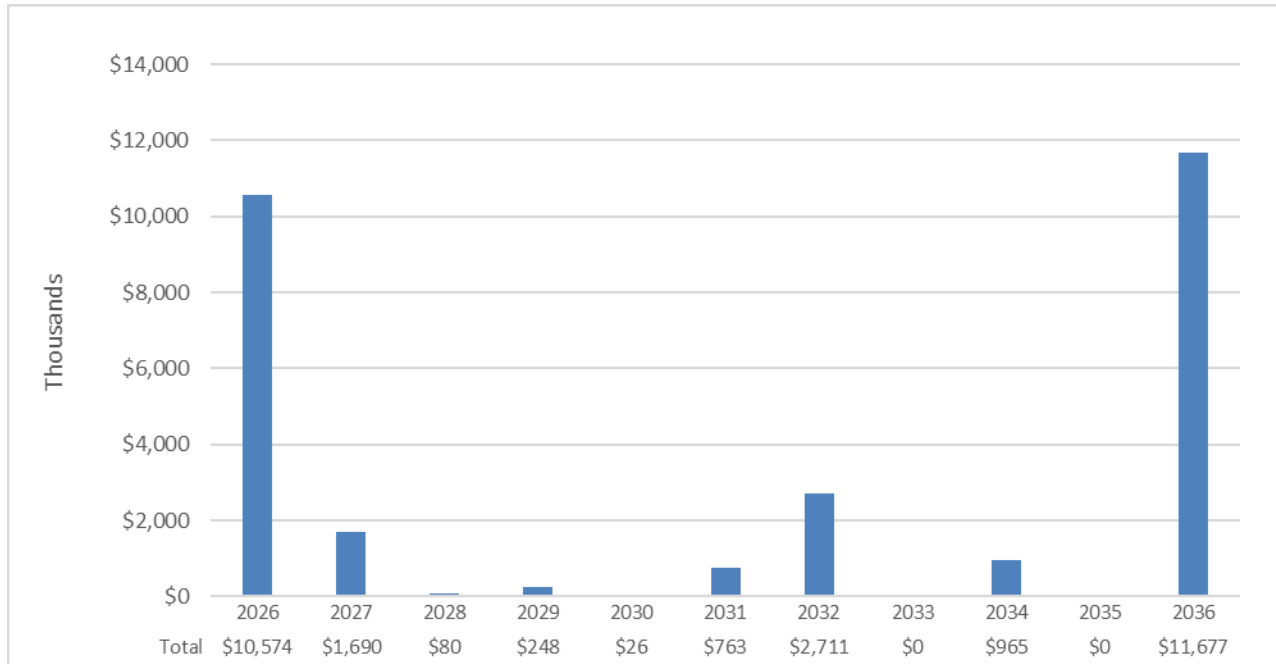


Figure 12. Current and Forecasted Needs: Summarized by Reporting Period Years 11-20: Middle School

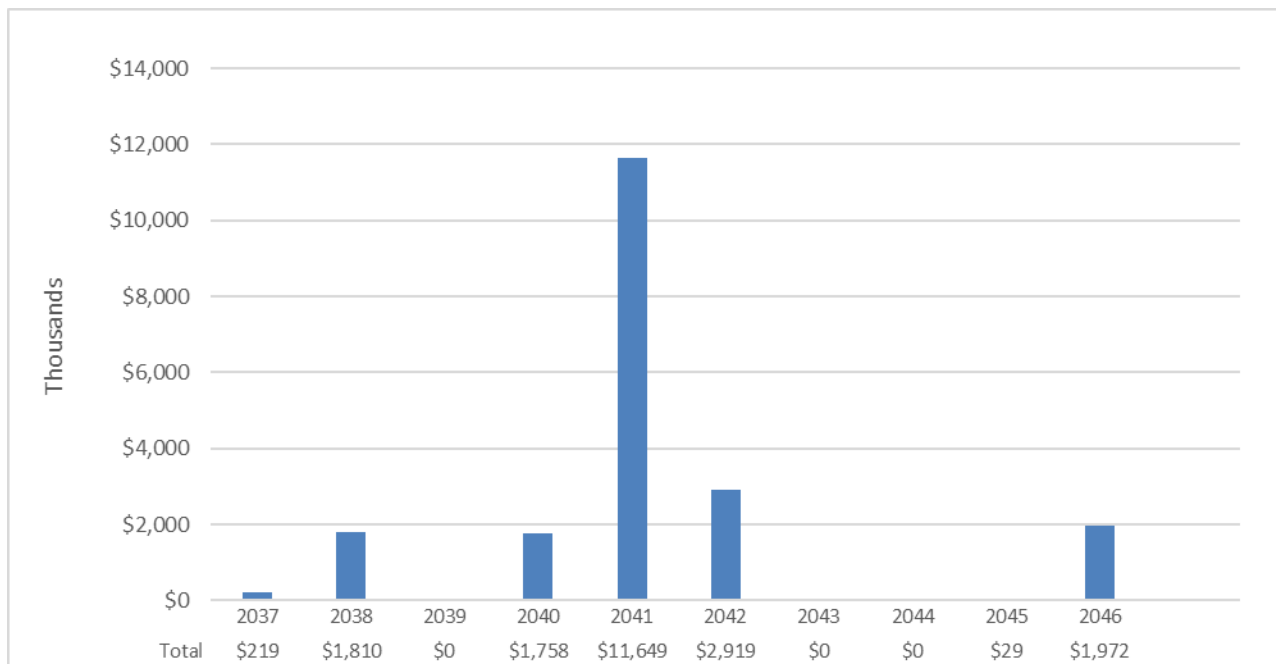

This page is intentionally left blank.

Table 9. Current and Forecasted Needs Summarized by System (Current + 5 years): Middle School

System	2026	2027	2028	2029	2030	2031
Cumulative Needs by Year	\$10,573,948	\$12,263,774	\$12,343,720	\$12,591,444	\$12,617,118	\$13,379,767
Needs by Year	\$10,573,948	\$1,689,826	\$79,946	\$247,724	\$25,674	\$762,649
Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Roofing	\$494,800	\$1,689,826	\$0	\$0	\$0	\$0
Roof Coverings	\$494,800	\$1,689,826	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$0	\$0	\$245,098
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$44,189
Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0	\$200,908
Conveying	\$0	\$0	\$0	\$0	\$0	\$104,222
Conveying Systems	\$0	\$0	\$0	\$0	\$0	\$104,222
Electrical	\$4,105,243	\$0	\$0	\$0	\$0	\$0
Branch Wiring	\$3,646,669	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$458,573	\$0	\$0	\$0	\$0	\$0
Plumbing	\$3,130,233	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$944,215	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$2,186,018	\$0	\$0	\$0	\$0	\$0
HVAC	\$2,843,672	\$0	\$79,946	\$247,724	\$25,674	\$413,329
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$3,178	\$6,355	\$0	\$0
Distribution System	\$2,843,672	\$0	\$76,768	\$192,557	\$25,674	\$64,567
Terminal & Package Units	\$0	\$0	\$0	\$48,813	\$0	\$348,762
Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0	\$0

Table 10. Current and Forecasted Needs Summarized by System (Years 6 - 10): Middle School

System	2032	2033	2034	2035	2036
Cumulative Needs by Year	\$16,090,466	\$16,090,466	\$17,055,453	\$17,055,453	\$28,732,200
Needs by Year	\$2,710,699	\$0	\$964,987	\$0	\$11,676,747
Exterior Enclosure	\$0	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0
Interiors	\$209,059	\$0	\$964,987	\$0	\$3,780,954
Ceiling Finishes	\$51,750	\$0	\$11,020	\$0	\$956,984
Floor Finishes	\$0	\$0	\$953,968	\$0	\$2,385,533
Wall Finishes	\$157,309	\$0	\$0	\$0	\$438,438
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$0	\$0	\$6,390,319
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$2,058,599
Lighting	\$0	\$0	\$0	\$0	\$4,331,721
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$324,232	\$0	\$0	\$0	\$1,505,473
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$1,505,473
Cooling Generation	\$213,020	\$0	\$0	\$0	\$0
Distribution System	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$111,213	\$0	\$0	\$0	\$0
Fire Protection	\$2,177,408	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$2,177,408	\$0	\$0	\$0	\$0

Table 11. Current and Forecasted Needs Summarized by System (Years 11 - 15): Middle School

System	2037	2038	2039	2040	2041
Cumulative Needs by Year	\$28,951,575	\$30,761,149	\$30,761,149	\$32,518,952	\$44,167,527
Needs by Year	\$219,375	\$1,809,574	\$0	\$1,757,803	\$11,648,575
Exterior Enclosure	\$0	\$461,230	\$0	\$0	\$175,716
Exterior Walls (Finishes)	\$0	\$335,768	\$0	\$0	\$175,716
Exterior Doors	\$0	\$125,463	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$666,576
Roof Coverings	\$0	\$0	\$0	\$0	\$666,576
Interior Construction	\$0	\$1,348,344	\$0	\$0	\$0
Interior Doors	\$0	\$418,835	\$0	\$0	\$0
Specialties	\$0	\$929,508	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$0	\$1,107,834
Ceiling Finishes	\$0	\$0	\$0	\$0	\$1,107,834
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$0	\$1,757,803	\$5,597,591
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$1,757,803	\$0
Lighting	\$0	\$0	\$0	\$0	\$5,067,215
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$530,376
Plumbing	\$0	\$0	\$0	\$0	\$2,211,303
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$2,211,303
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$219,375	\$0	\$0	\$0	\$1,889,555
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$1,763,090
Cooling Generation	\$219,375	\$0	\$0	\$0	\$126,465
Distribution System	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$0
Fire Protection	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0

Table 12. Current and Forecasted Needs Summarized by System (Years 16-20): Middle School

System	2042	2043	2044	2045	2046
Cumulative Needs by Year	\$47,086,607	\$47,086,607	\$47,086,607	\$47,115,141	\$49,086,996
Needs by Year	\$2,919,080	\$0	\$0	\$28,534	\$1,971,855
Exterior Enclosure	\$0	\$0	\$0	\$0	\$499,127
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$371,112
Exterior Doors	\$0	\$0	\$0	\$0	\$128,015
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$1,472,728
Interior Doors	\$0	\$0	\$0	\$0	\$518,688
Specialties	\$0	\$0	\$0	\$0	\$954,040
Interiors	\$11,820	\$0	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$11,820	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$0	\$0	\$0
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$2,907,260	\$0	\$0	\$28,534	\$0
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$775,246	\$0	\$0	\$0	\$0
Distribution System	\$2,081,898	\$0	\$0	\$0	\$0
Terminal & Package Units	\$50,116	\$0	\$0	\$28,534	\$0
Fire Protection	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0

HIGH SCHOOL
FACILITY CONDITION INFORMATION

High School

The project included facilities at 2 locations totaling approximately 615,350 square feet. The table below contains location-specific information regarding current and forecast Facility Condition Indices. A comprehensive list of expired systems and those expected to expire between now and the Year 2046 is shown in the Forecasted Needs Summarized by System: High School Table.

Table 13. Facility Description: Summary of Findings: High School

Name	Area (SF)	Total Needs 2026	Current Replacement Value	2026 FCI %	Total Needs 2031	2031 FCI %
Long Creek High School	413,650	\$0	151,420,341	0	\$728,108	0
New Braunfels High School	201,700	\$141,246	74,491,085	0	\$273,162	0
SUBTOTAL	615,350	\$141,246	\$225,911,426	0	\$1,001,269	0
Site and Infrastructure (excluded from FCI calculations)		\$262,710			\$262,710	
TOTALS	615,350	\$403,956	\$225,911,426		\$1,263,979	


Note: The average FCI for the High School facilities assessed is 0 while the average FCI in 5 years is estimated to be 0 assuming current sustainment levels.

Figures below show the current and forecasted needs respectively for all High School locations grouped by system.

Figure 13. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by System Group: High School



Figure 14. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Priority: High School

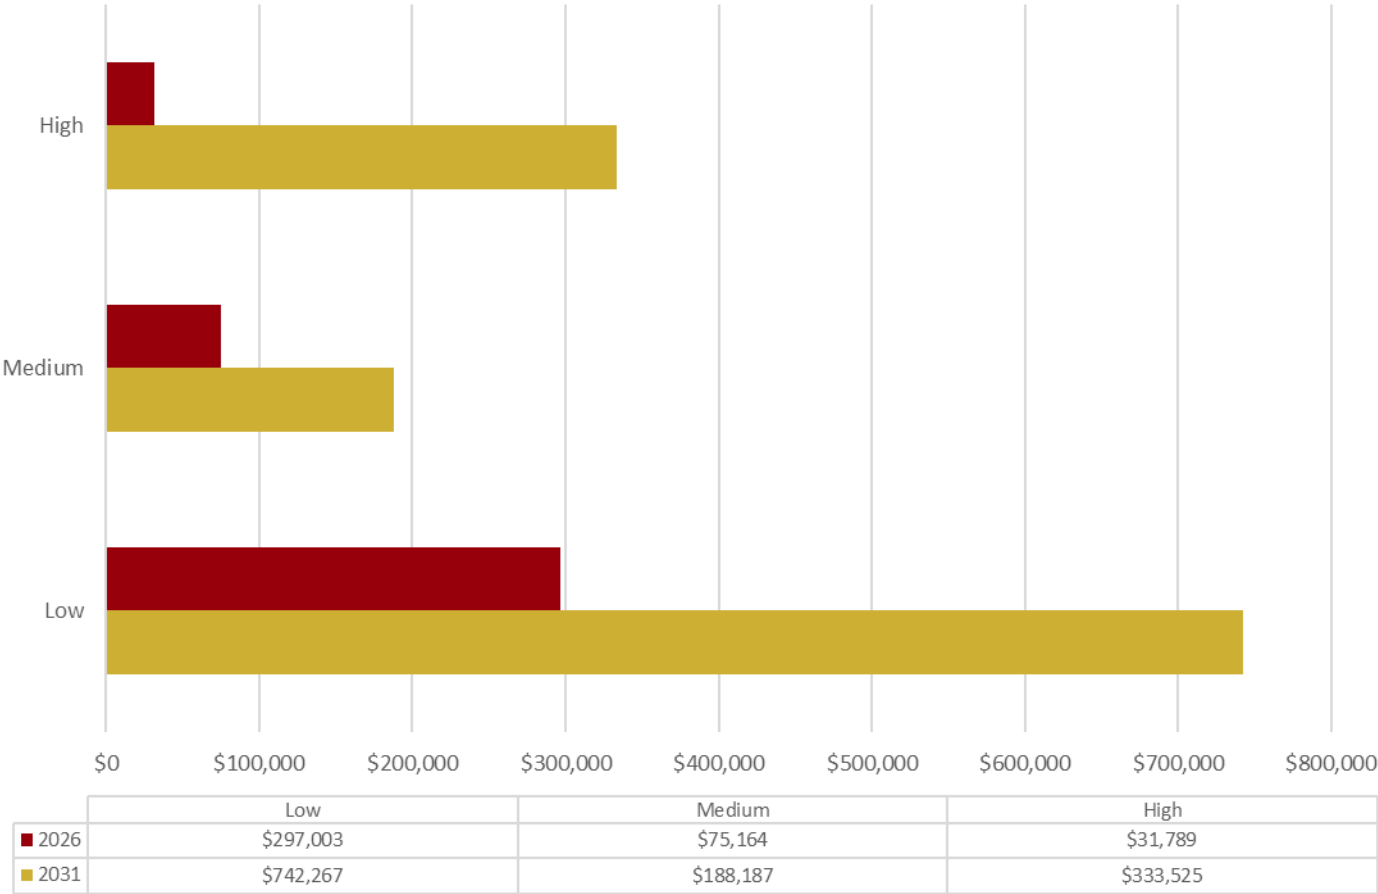

Renewal Forecast

The renewal forecast below for High School locations shows the current backlog and projected facility sustainment requirements over the next 20 years. Please note the renewal forecast does not include potential costs associated with asbestos abatement, seismic evaluation; seismic retrofitting; hazardous material inspection, evaluation, and mitigation; and NFPA 101 and ADA upgrades. The renewal forecast is shown in the following figures:

Figure 15. Current and Forecasted Needs: Summarized by Reporting Period Current +10 Years: High School


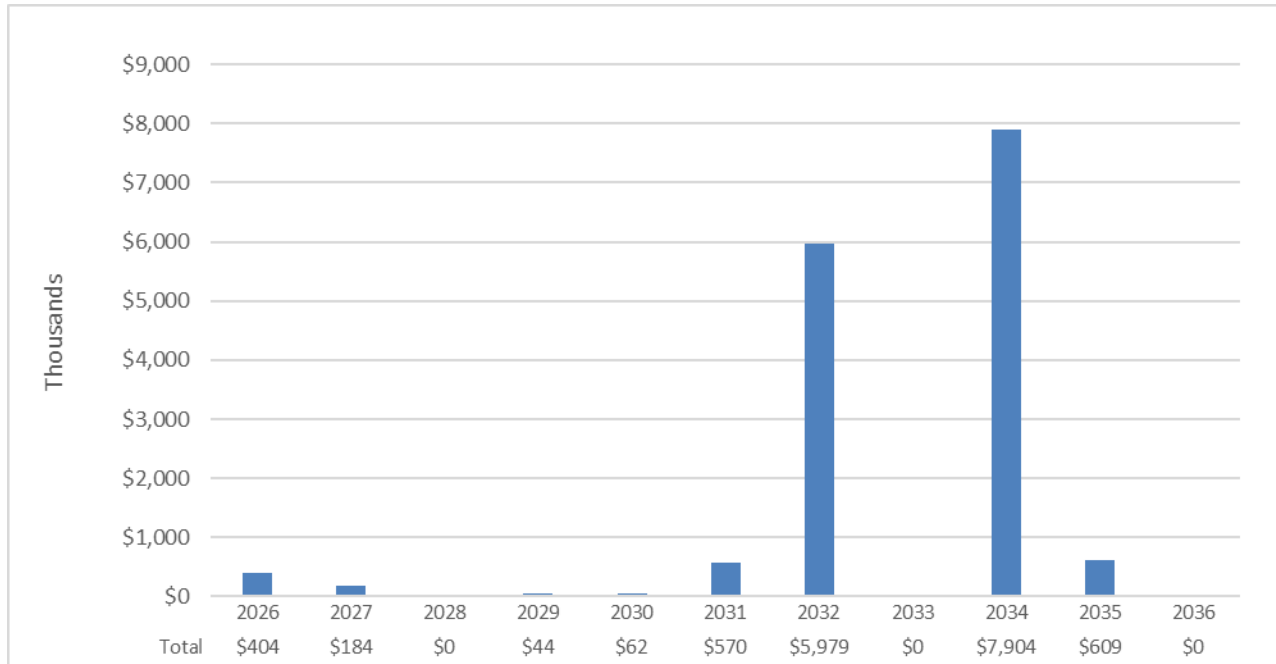


Figure 16. Current and Forecasted Needs: Summarized by Reporting Period Years 11-20: High School

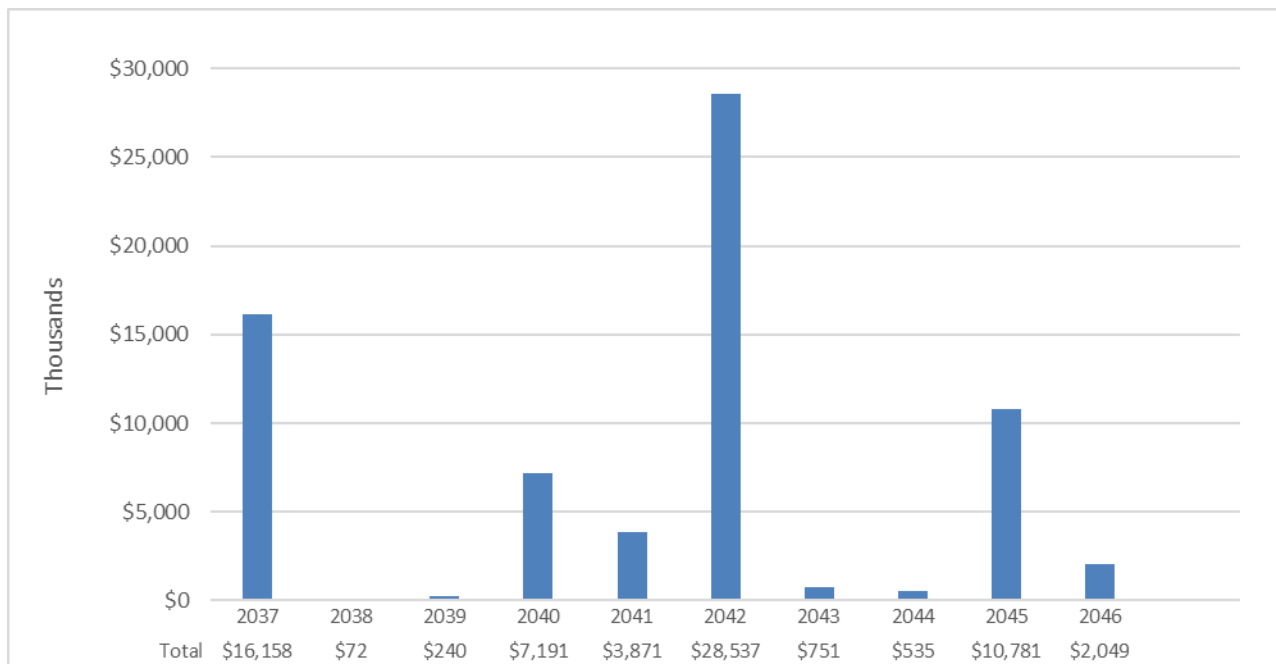

This page is intentionally left blank.

Table 14. Current and Forecasted Needs Summarized by System (Current + 5 years): High School

System	2026	2027	2028	2029	2030	2031
Cumulative Needs by Year	\$403,956	\$587,726	\$587,726	\$632,084	\$693,664	\$1,263,979
Needs by Year	\$403,956	\$183,770	\$0	\$44,358	\$61,580	\$570,316
Exterior Enclosure	\$65,201	\$0	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$23,866	\$0	\$0	\$0	\$0	\$0
Exterior Windows	\$28,613	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$12,723	\$0	\$0	\$0	\$0	\$0
Roofing	\$7,562	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$7,562	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$21,869	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$11,442	\$0	\$0	\$0	\$0	\$0
Specialties	\$10,427	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$1,922	\$0	\$0	\$0	\$443,343
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$11,068
Wall Finishes	\$0	\$1,922	\$0	\$0	\$0	\$432,275
Conveying	\$0	\$113,024	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$113,024	\$0	\$0	\$0	\$0
Electrical	\$24,227	\$0	\$0	\$0	\$0	\$0
Branch Wiring	\$24,227	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0	\$0
Plumbing	\$22,387	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$2,097	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$11,391	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$8,899	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$68,825	\$0	\$44,358	\$61,580	\$126,973
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$44,358	\$50,713	\$0
Distribution System	\$0	\$68,825	\$0	\$0	\$0	\$126,973
Heat Generation	\$0	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$10,867	\$0
Site Infrastructure	\$262,710	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$262,710	\$0	\$0	\$0	\$0	\$0
Sports	\$0	\$0	\$0	\$0	\$0	\$0
Bleachers	\$0	\$0	\$0	\$0	\$0	\$0

Table 15. Current and Forecasted Needs Summarized by System (Years 6 - 10): High School

System	2032	2033	2034	2035	2036
Cumulative Needs by Year	\$7,243,207	\$7,243,207	\$15,147,053	\$15,755,713	\$15,755,713
Needs by Year	\$5,979,228	\$0	\$7,903,846	\$608,660	\$0
Exterior Enclosure	\$0	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0
Roofing	\$1,339,634	\$0	\$0	\$0	\$0
Roof Coverings	\$1,339,634	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0
Interiors	\$2,735,314	\$0	\$4,851,311	\$592,796	\$0
Ceiling Finishes	\$2,735,314	\$0	\$0	\$53,809	\$0
Floor Finishes	\$0	\$0	\$4,052,447	\$358,727	\$0
Wall Finishes	\$0	\$0	\$798,864	\$180,260	\$0
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$1,132,147	\$0	\$0	\$15,864	\$0
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$18,729	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$0	\$0	\$15,864	\$0
Exit Signs and Emergency Lighting	\$1,113,418	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$0	\$3,052,535	\$0	\$0
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$789,037	\$0	\$0
Distribution System	\$0	\$0	\$1,892,455	\$0	\$0
Heat Generation	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$371,043	\$0	\$0
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0
Sports	\$772,133	\$0	\$0	\$0	\$0
Bleachers	\$772,133	\$0	\$0	\$0	\$0

Table 16. Current and Forecasted Needs Summarized by System (Years 11 - 15): High School

System	2037	2038	2039	2040	2041
Cumulative Needs by Year	\$31,913,567	\$31,985,506	\$32,225,789	\$39,416,369	\$43,287,179
Needs by Year	\$16,157,854	\$71,939	\$240,283	\$7,190,580	\$3,870,810
Exterior Enclosure	\$0	\$0	\$0	\$710,981	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$438,587	\$0
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$272,394	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$2,798,533	\$0
Interior Doors	\$0	\$0	\$0	\$797,812	\$0
Specialties	\$0	\$0	\$0	\$2,000,720	\$0
Interiors	\$8,816	\$0	\$0	\$1,847,827	\$0
Ceiling Finishes	\$8,816	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$1,847,827	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Conveying	\$0	\$0	\$226,047	\$0	\$0
Conveying Systems	\$0	\$0	\$226,047	\$0	\$0
Electrical	\$11,247,503	\$0	\$0	\$1,833,240	\$3,854,948
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$1,833,240	\$3,854,948
Lighting	\$11,135,792	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$111,711	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$4,158,001	\$71,939	\$14,235	\$0	\$15,862
Controls and Instrumentation	\$4,152,599	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$0	\$14,362
Distribution System	\$0	\$71,939	\$0	\$0	\$0
Heat Generation	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$5,402	\$0	\$14,235	\$0	\$1,500
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0
Sports	\$743,535	\$0	\$0	\$0	\$0
Bleachers	\$743,535	\$0	\$0	\$0	\$0

Table 17. Current and Forecasted Needs Summarized by System (Years 16-20): High School

System	2042	2043	2044	2045	2046
Cumulative Needs by Year	\$71,824,101	\$72,575,516	\$73,110,416	\$83,891,637	\$85,940,743
Needs by Year	\$28,536,922	\$751,415	\$534,900	\$10,781,221	\$2,049,106
Exterior Enclosure	\$394,717	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$346,411	\$0	\$0	\$0	\$0
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$48,306	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$753,004	\$0
Roof Coverings	\$0	\$0	\$0	\$753,004	\$0
Interior Construction	\$89,011	\$0	\$0	\$0	\$0
Interior Doors	\$7,629	\$0	\$0	\$0	\$0
Specialties	\$81,382	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$1,151,912	\$0
Ceiling Finishes	\$0	\$0	\$0	\$1,151,912	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$11,049,013	\$0	\$0	\$5,744,842	\$0
Branch Wiring	\$11,049,013	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$5,233,882	\$0
Service Distribution	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$510,959	\$0
Plumbing	\$10,158,201	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$1,756,286	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$4,213,601	\$0	\$0	\$0	\$0
Sanitary Waste	\$4,188,315	\$0	\$0	\$0	\$0
HVAC	\$6,845,981	\$751,415	\$534,900	\$3,131,463	\$2,049,106
Controls and Instrumentation	\$0	\$0	\$0	\$1,974,789	\$0
Cooling Generation	\$0	\$0	\$0	\$394,518	\$698,287
Distribution System	\$6,845,981	\$614,910	\$304,087	\$669,690	\$1,204,209
Heat Generation	\$0	\$95,833	\$0	\$0	\$0
Terminal & Package Units	\$0	\$40,672	\$230,814	\$92,465	\$146,610
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0
Sports	\$0	\$0	\$0	\$0	\$0
Bleachers	\$0	\$0	\$0	\$0	\$0

FACILITIES
FACILITY CONDITION INFORMATION

Facilities

The project included facilities at 2 locations totaling approximately 80,447 square feet. The table below contains location-specific information regarding current and forecast Facility Condition Indices. A comprehensive list of expired systems and those expected to expire between now and the Year 2046 is shown in the Forecasted Needs Summarized by System: Facilities Table.

Table 18. Facility Description: Summary of Findings: Facilities

Name	Area (SF)	Total Needs 2026	Current Replacement Value	2026 FCI %	Total Needs 2031	2031 FCI %
Support Services	19,500	\$56,892	4,646,363	1	\$962,682	21
Two Rivers High School	60,947	\$4,000,010	22,563,642	18	\$5,606,993	25
SUBTOTAL	80,447	\$4,056,902	\$27,210,005	15	\$6,569,675	24
Site and Infrastructure (excluded from FCI calculations)		\$0			\$0	
TOTALS	80,447	\$4,056,902	\$27,210,005		\$6,569,675	

Note: The average FCI for the Facilities facilities assessed is 15 while the average FCI in 5 years is estimated to be 24 assuming current sustainment levels.

Figures below show the current and forecasted needs respectively for all Facilities locations grouped by system.

Figure 17. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by System Group: Facilities


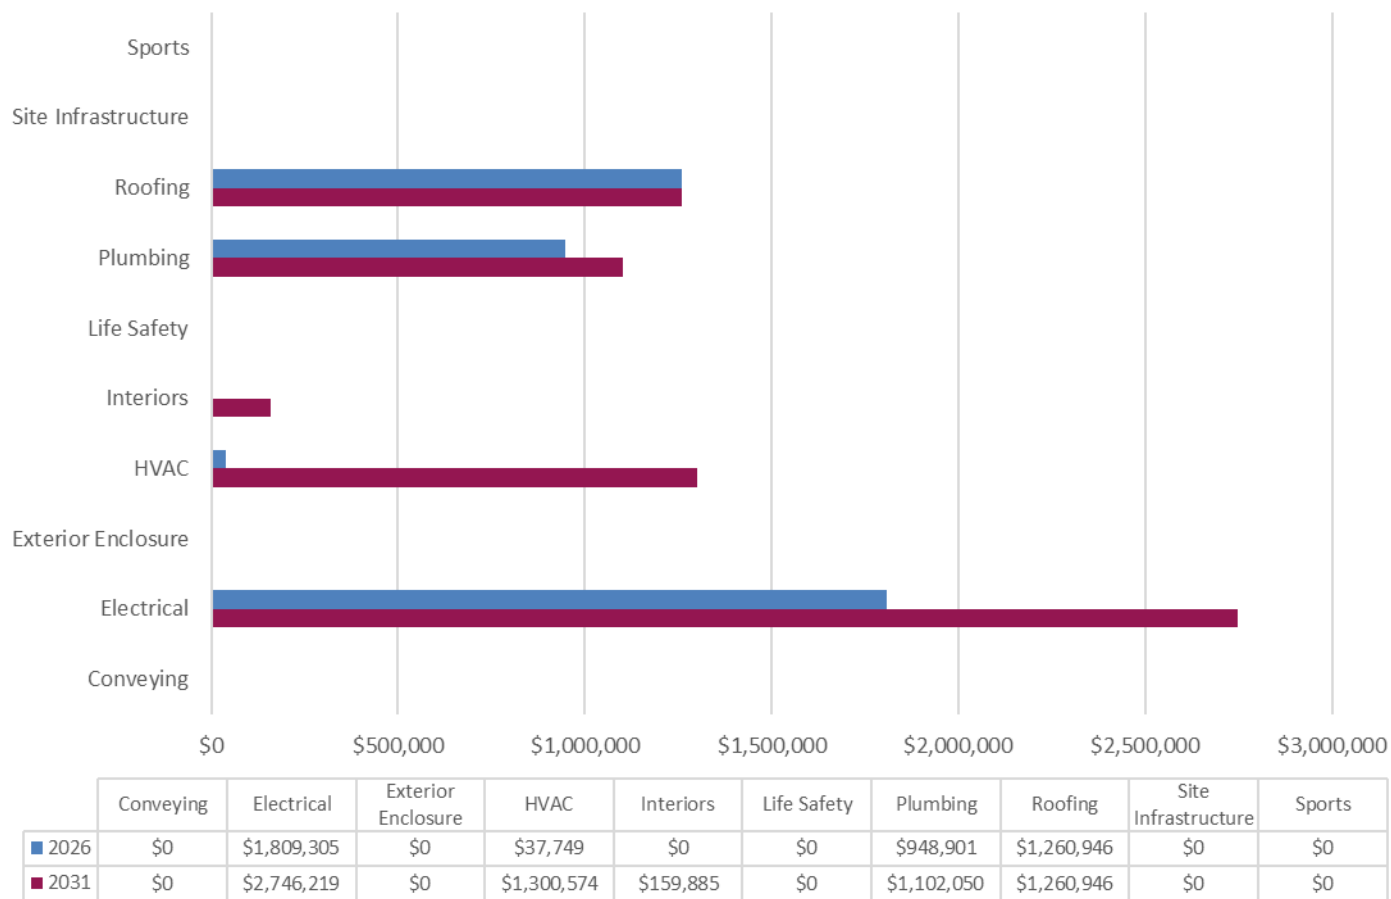


Figure 18. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Priority: Facilities

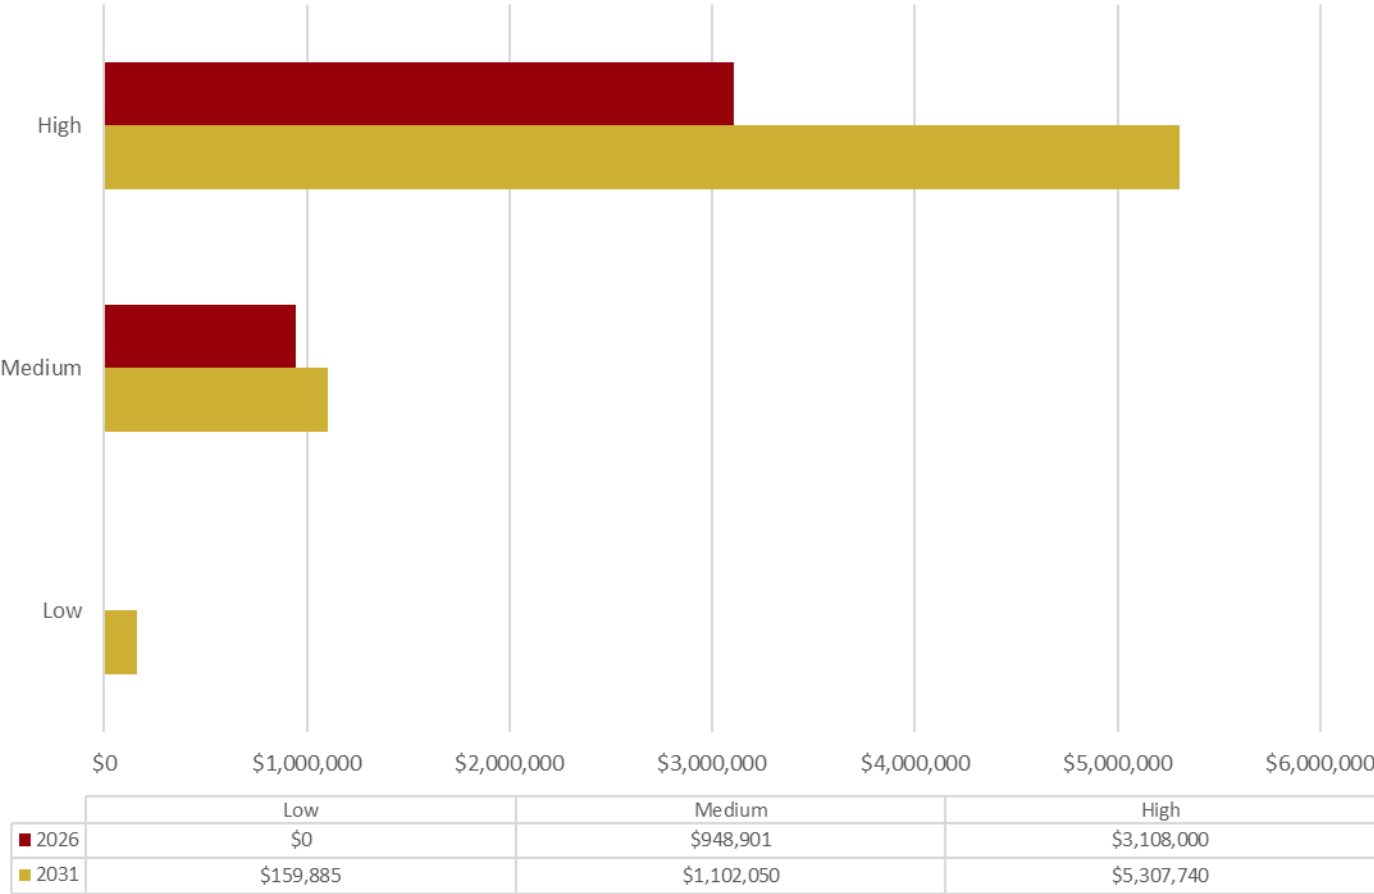

Renewal Forecast

The renewal forecast below for Facilities locations shows the current backlog and projected facility sustainment requirements over the next 20 years. Please note the renewal forecast does not include potential costs associated with asbestos abatement, seismic evaluation; seismic retrofitting; hazardous material inspection, evaluation, and mitigation; and NFPA 101 and ADA upgrades. The renewal forecast is shown in the following figures:

Figure 19. Current and Forecasted Needs: Summarized by Reporting Period Current +10 Years: Facilities


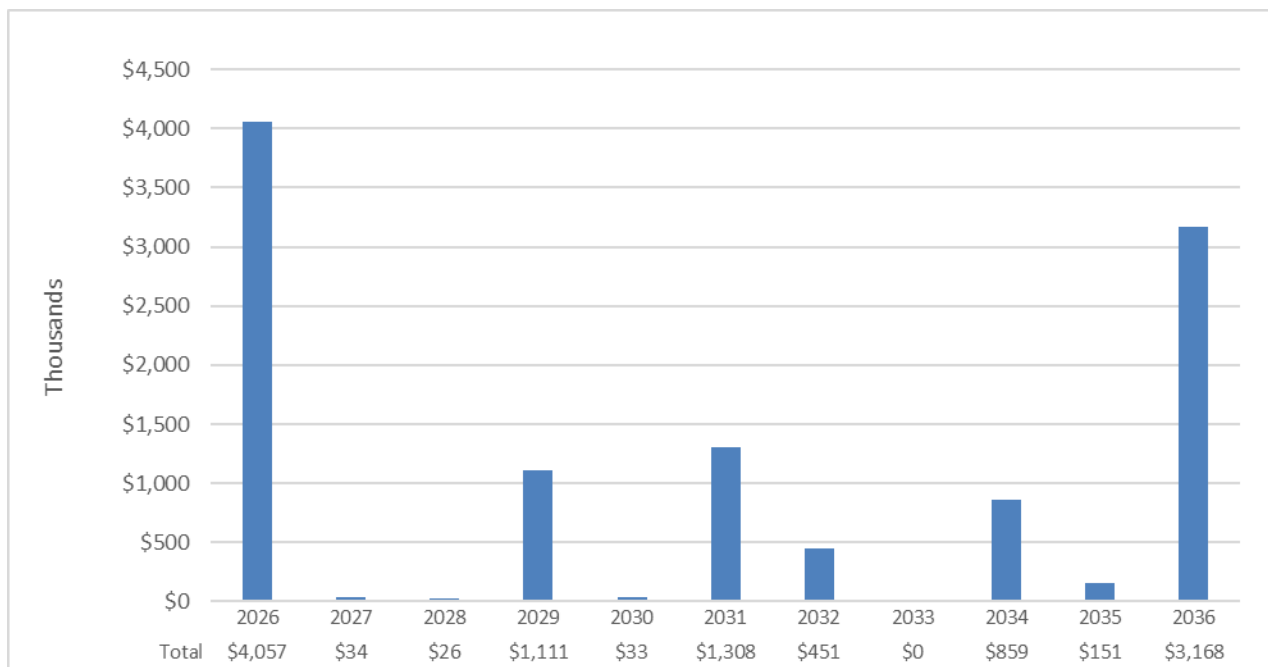


Figure 20. Current and Forecasted Needs: Summarized by Reporting Period Years 11-20: Facilities

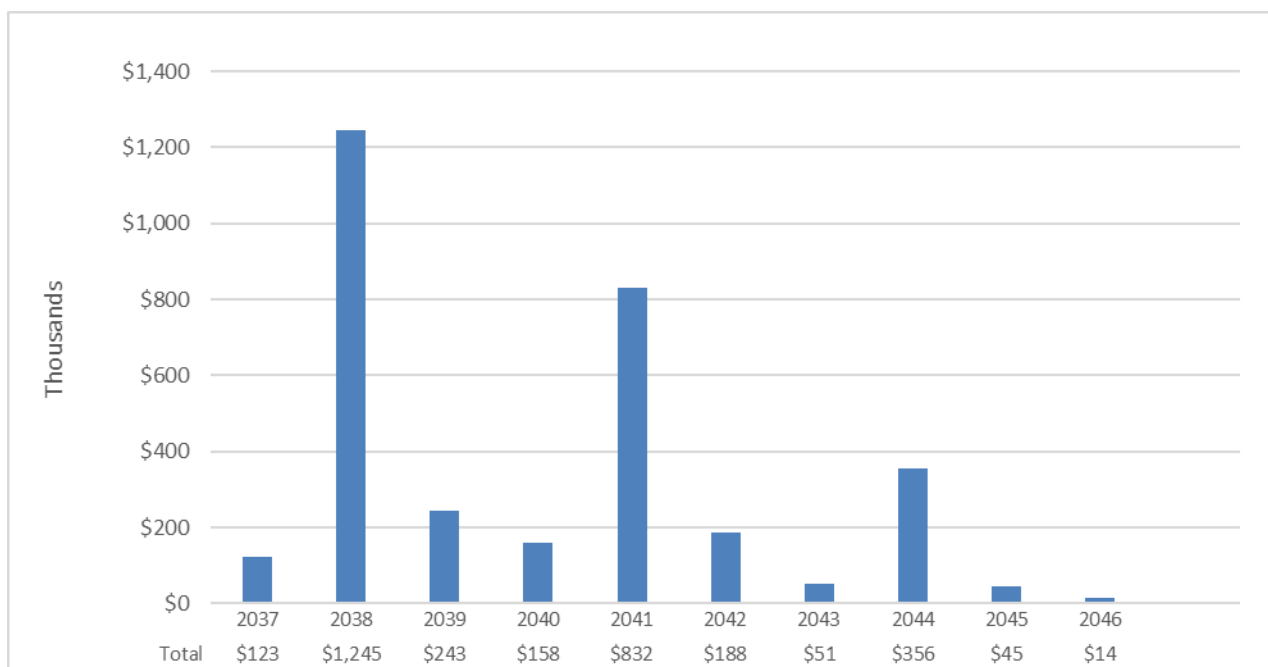

This page is intentionally left blank.

Table 19. Current and Forecasted Needs Summarized by System (Current + 5 years): Facilities

System	2026	2027	2028	2029	2030	2031
Cumulative Needs by Year	\$4,056,902	\$4,090,583	\$4,116,830	\$5,228,293	\$5,261,593	\$6,569,675
Needs by Year	\$4,056,902	\$33,682	\$26,246	\$1,111,464	\$33,300	\$1,308,081
Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Roofing	\$1,260,946	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$1,260,946	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$6,137	\$0	\$153,748
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$49,457
Wall Finishes	\$0	\$0	\$0	\$6,137	\$0	\$104,291
Electrical	\$1,809,305	\$0	\$0	\$599,469	\$0	\$337,445
Branch Wiring	\$1,635,634	\$0	\$0	\$0	\$0	\$337,445
Communications & Security	\$0	\$0	\$0	\$553,840	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$0	\$0	\$45,629	\$0	\$0
Exit Signs and Emergency Lighting	\$173,671	\$0	\$0	\$0	\$0	\$0
Plumbing	\$948,901	\$0	\$0	\$0	\$0	\$153,148
Domestic Water Distribution	\$317,038	\$0	\$0	\$0	\$0	\$29,202
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$631,863	\$0	\$0	\$0	\$0	\$123,946
HVAC	\$37,749	\$33,682	\$26,246	\$505,858	\$33,300	\$663,740
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$15,379	\$3,178	\$0	\$126,465
Distribution System	\$37,749	\$33,682	\$0	\$278,985	\$33,300	\$537,275
Heat Generation	\$0	\$0	\$0	\$6,355	\$0	\$0
Terminal & Package Units	\$0	\$0	\$10,867	\$217,341	\$0	\$0
Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0	\$0

Table 20. Current and Forecasted Needs Summarized by System (Years 6 - 10): Facilities

System	2032	2033	2034	2035	2036
Cumulative Needs by Year	\$7,020,396	\$7,020,396	\$7,878,911	\$8,029,525	\$11,197,957
Needs by Year	\$450,722	\$0	\$858,515	\$150,614	\$3,168,433
Exterior Enclosure	\$15,187	\$0	\$0	\$150,614	\$58,579
Exterior Walls (Finishes)	\$15,187	\$0	\$0	\$150,614	\$58,579
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$409,116
Roof Coverings	\$0	\$0	\$0	\$0	\$409,116
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0
Interiors	\$418,185	\$0	\$766,494	\$0	\$85,953
Ceiling Finishes	\$418,185	\$0	\$0	\$0	\$85,953
Floor Finishes	\$0	\$0	\$766,494	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$0	\$0	\$1,896,506
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$1,896,506
Service Distribution	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$17,349	\$0	\$92,020	\$0	\$718,280
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$712,433
Cooling Generation	\$16,015	\$0	\$0	\$0	\$5,847
Distribution System	\$0	\$0	\$0	\$0	\$0
Heat Generation	\$1,335	\$0	\$92,020	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$0
Fire Protection	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0

Table 21. Current and Forecasted Needs Summarized by System (Years 11 - 15): Facilities

System	2037	2038	2039	2040	2041
Cumulative Needs by Year	\$11,320,983	\$12,565,959	\$12,809,119	\$12,967,146	\$13,799,233
Needs by Year	\$123,025	\$1,244,976	\$243,161	\$158,027	\$832,087
Exterior Enclosure	\$8,991	\$104,332	\$86,523	\$0	\$65,266
Exterior Walls (Finishes)	\$8,991	\$0	\$0	\$0	\$65,266
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$104,332	\$86,523	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$656,657	\$156,638	\$0	\$0
Interior Doors	\$0	\$242,474	\$66,918	\$0	\$0
Specialties	\$0	\$414,183	\$89,720	\$0	\$0
Interiors	\$111,619	\$9,612	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$111,619	\$9,612	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$440,693	\$0	\$134,005	\$0
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$134,005	\$0
Lighting	\$0	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$440,693	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$694,081
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$694,081
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$2,415	\$33,682	\$0	\$24,022	\$40,164
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$24,022	\$40,164
Distribution System	\$2,415	\$33,682	\$0	\$0	\$0
Heat Generation	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$0
Fire Protection	\$0	\$0	\$0	\$0	\$32,576
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$32,576

Table 22. Current and Forecasted Needs Summarized by System (Years 16-20): Facilities

System	2042	2043	2044	2045	2046
Cumulative Needs by Year	\$13,987,245	\$14,037,954	\$14,394,088	\$14,439,493	\$14,453,474
Needs by Year	\$188,012	\$50,709	\$356,134	\$45,405	\$13,981
Exterior Enclosure	\$15,366	\$0	\$0	\$45,405	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$45,405	\$0
Exterior Windows	\$15,366	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$50,709	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$50,709	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$0	\$0	\$0
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$158,664	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$158,664	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$13,981	\$0	\$356,134	\$0	\$13,981
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$335,417	\$0	\$0
Distribution System	\$13,981	\$0	\$20,717	\$0	\$13,981
Heat Generation	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$0
Fire Protection	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0

TRANSPORTATION AND MAINTENANCE
FACILITY CONDITION INFORMATION

Transportation and Maintenance

The project included facilities at 1 locations totaling approximately 11,814 square feet. The table below contains location-specific information regarding current and forecast Facility Condition Indices. A comprehensive list of expired systems and those expected to expire between now and the Year 2046 is shown in the Forecasted Needs Summarized by System: Transportation and Maintenance Table.

Table 23. Facility Description: Summary of Findings: Transportation and Maintenance

Name	Area (SF)	Total Needs 2026	Current Replacement Value	2026 FCI %	Total Needs 2031	2031 FCI %
Transportation	11,814	\$0	3,062,751	0	\$101,583	3
SUBTOTAL	11,814	\$0	\$3,062,751	0	\$101,583	3
Site and Infrastructure (excluded from FCI calculations)		\$0			\$0	
TOTALS	11,814	\$0	\$3,062,751		\$101,583	

Note: The average FCI for the Transportation and Maintenance facilities assessed is 0 while the average FCI in 5 years is estimated to be 3 assuming current sustainment levels.

Figures below show the current and forecasted needs respectively for all Transportation and Maintenance locations grouped by system.

Figure 21. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by System Group: Transportation and Maintenance


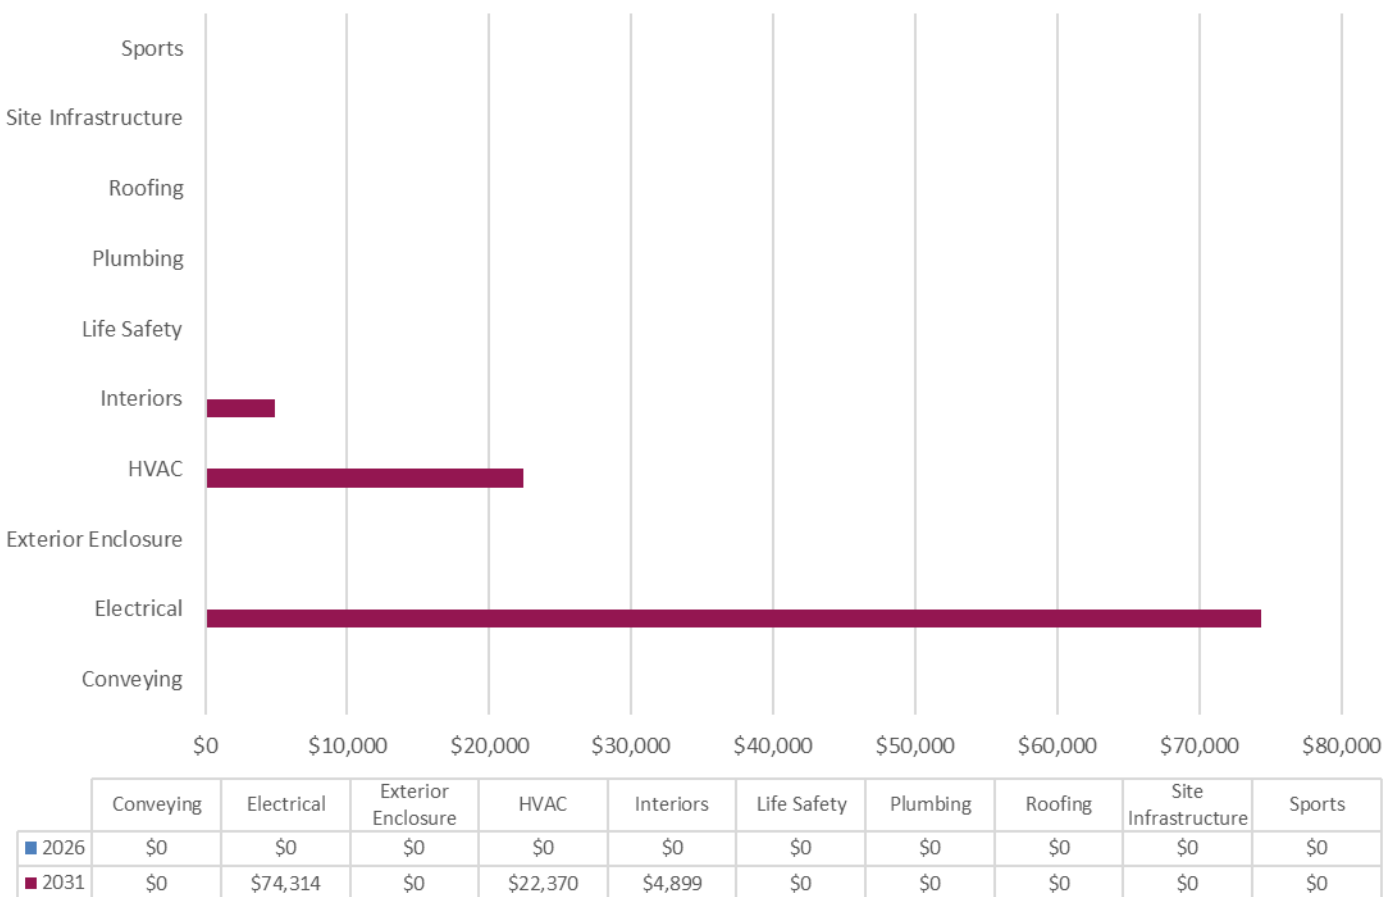


Figure 22. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Priority: Transportation and Maintenance

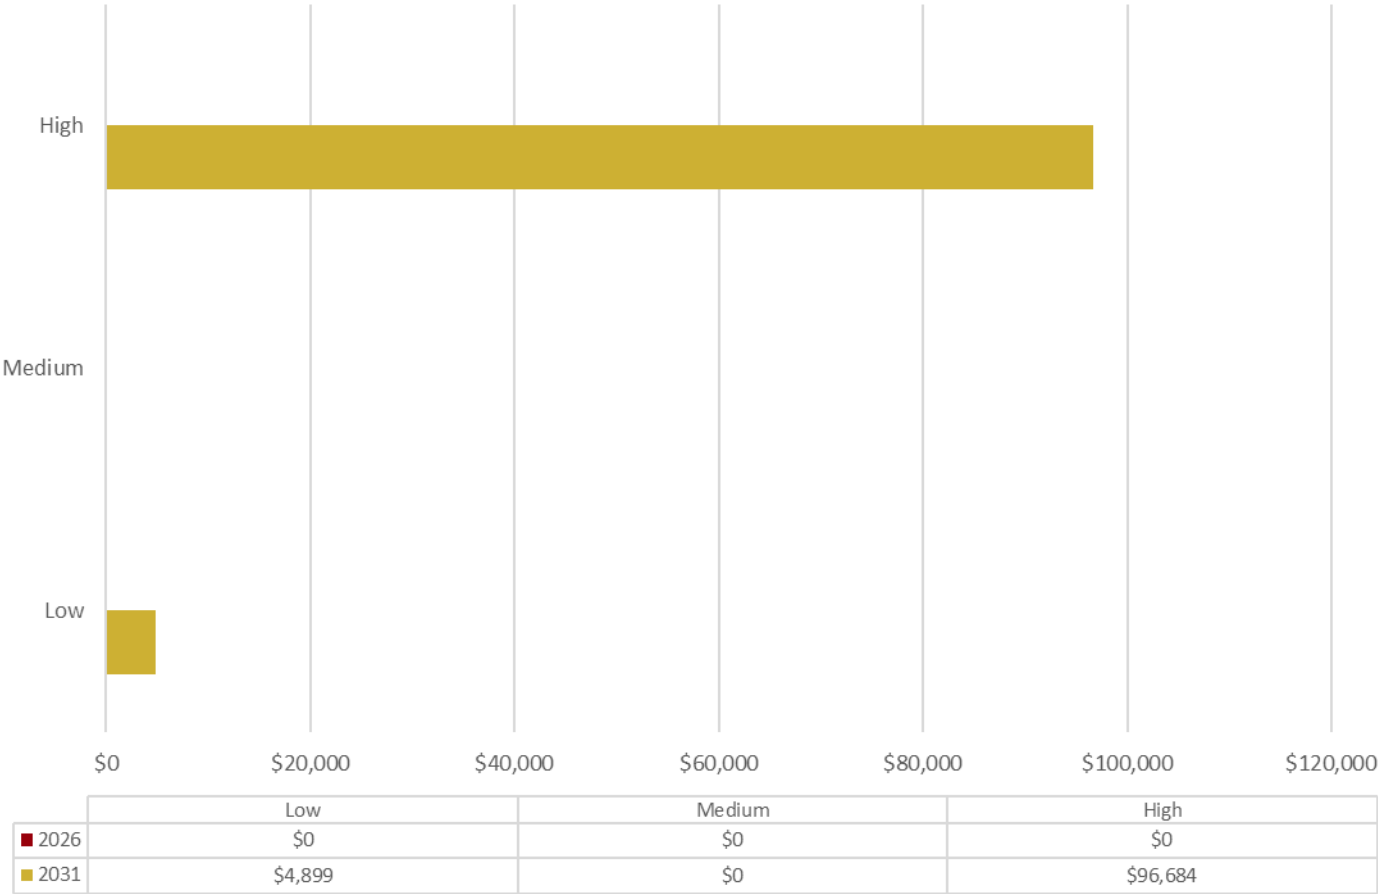

Renewal Forecast

The renewal forecast below for Transportation and Maintenance locations shows the current backlog and projected facility sustainment requirements over the next 20 years. Please note the renewal forecast does not include potential costs associated with asbestos abatement, seismic evaluation; seismic retrofitting; hazardous material inspection, evaluation, and mitigation; and NFPA 101 and ADA upgrades. The renewal forecast is shown in the following figures:

Figure 23. Current and Forecasted Needs: Summarized by Reporting Period Current +10 Years: Transportation and Maintenance


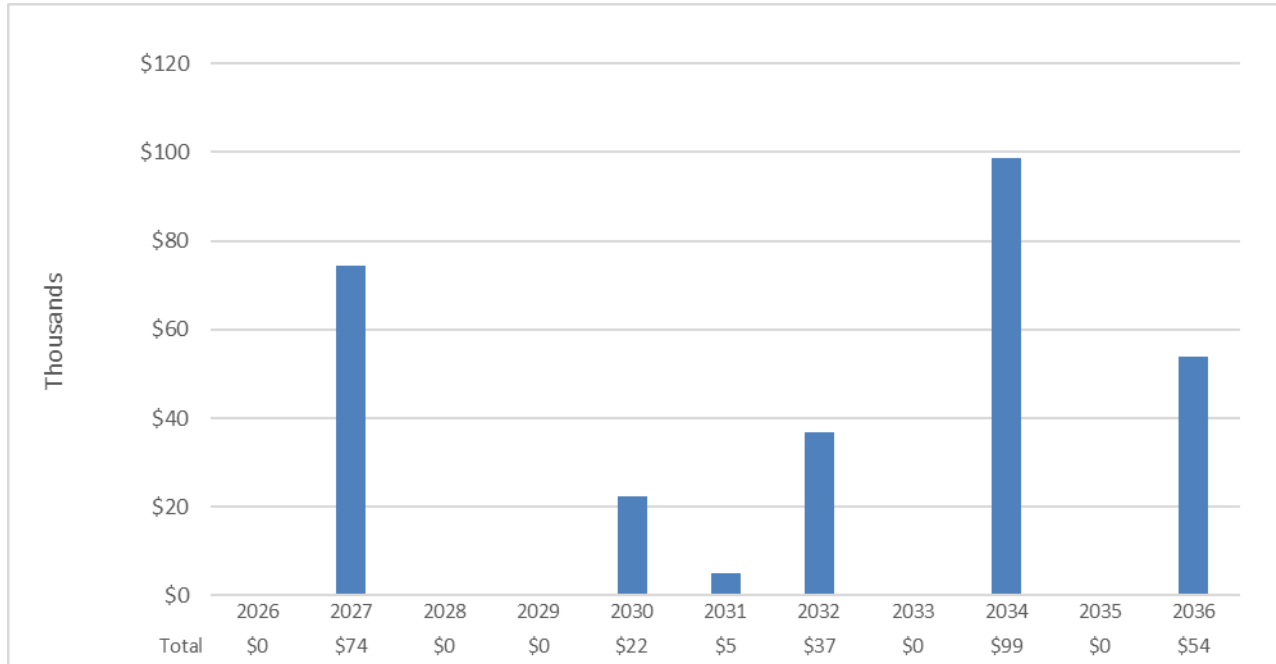


Figure 24. Current and Forecasted Needs: Summarized by Reporting Period Years 11-20: Transportation and Maintenance

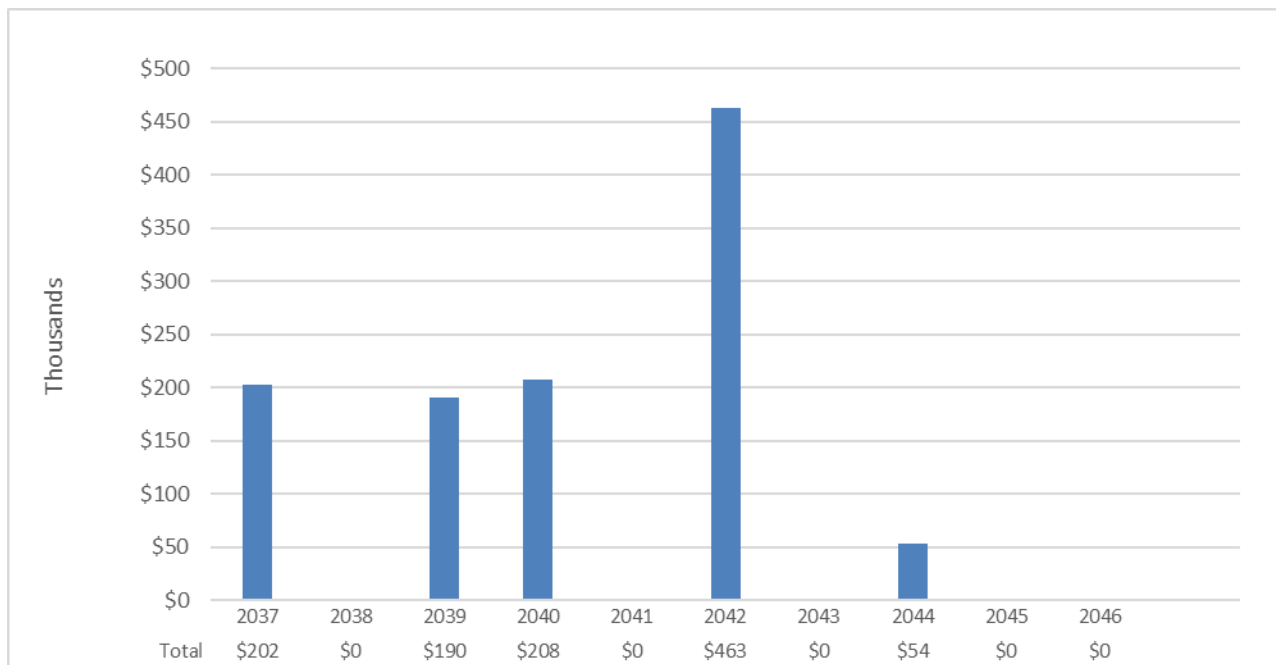

This page is intentionally left blank.

Table 24. Current and Forecasted Needs Summarized by System (Current + 5 years): Transportation and Maintenance

System	2026	2027	2028	2029	2030	2031
Cumulative Needs by Year	\$0	\$74,314	\$74,314	\$74,314	\$96,684	\$101,583
Needs by Year	\$0	\$74,314	\$0	\$0	\$22,370	\$4,899
Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$0	\$0	\$4,899
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0	\$4,899
Electrical	\$0	\$74,314	\$0	\$0	\$0	\$0
Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$74,314	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$0	\$0	\$0	\$22,370	\$0
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$0	\$22,370	\$0
Distribution System	\$0	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$0	\$0

Table 25. Current and Forecasted Needs Summarized by System (Years 6 - 10): Transportation and Maintenance

System	2032	2033	2034	2035	2036
Cumulative Needs by Year	\$138,418	\$138,418	\$237,064	\$237,064	\$290,858
Needs by Year	\$36,836	\$0	\$98,645	\$0	\$53,794
Exterior Enclosure	\$0	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0
Interiors	\$26,219	\$0	\$43,865	\$0	\$0
Ceiling Finishes	\$26,219	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$43,865	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$10,616	\$0	\$0	\$0	\$53,794
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$53,794
Exit Signs and Emergency Lighting	\$10,616	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$0	\$54,780	\$0	\$0
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$0	\$0
Distribution System	\$0	\$0	\$54,780	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$0

Table 26. Current and Forecasted Needs Summarized by System (Years 11 - 15): Transportation and Maintenance

System	2037	2038	2039	2040	2041
Cumulative Needs by Year	\$493,121	\$493,121	\$683,393	\$891,220	\$891,220
Needs by Year	\$202,263	\$0	\$190,271	\$207,828	\$0
Exterior Enclosure	\$0	\$0	\$15,252	\$106,868	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$30,524	\$0
Exterior Doors	\$0	\$0	\$15,252	\$76,343	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$1,907	\$100,960	\$0
Interior Doors	\$0	\$0	\$1,907	\$38,214	\$0
Specialties	\$0	\$0	\$0	\$62,747	\$0
Interiors	\$0	\$0	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$144,683	\$0	\$53,794	\$0	\$0
Branch Wiring	\$0	\$0	\$53,794	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$144,683	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$115,251	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$92,388	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$22,864	\$0	\$0
HVAC	\$57,580	\$0	\$4,067	\$0	\$0
Controls and Instrumentation	\$57,580	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$0	\$0
Distribution System	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$4,067	\$0	\$0

Table 27. Current and Forecasted Needs Summarized by System (Years 16-20): Transportation and Maintenance

System	2042	2043	2044	2045	2046
Cumulative Needs by Year	\$1,354,562	\$1,354,562	\$1,408,141	\$1,408,141	\$1,408,141
Needs by Year	\$463,341	\$0	\$53,579	\$0	\$0
Exterior Enclosure	\$50,205	\$0	\$19,980	\$0	\$0
Exterior Walls (Finishes)	\$50,205	\$0	\$19,980	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$33,599	\$0	\$0
Roof Coverings	\$0	\$0	\$33,599	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$187,135	\$0	\$0	\$0	\$0
Branch Wiring	\$187,135	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$172,920	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$16,194	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$87,989	\$0	\$0	\$0	\$0
Sanitary Waste	\$68,736	\$0	\$0	\$0	\$0
HVAC	\$53,082	\$0	\$0	\$0	\$0
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$0	\$0
Distribution System	\$53,082	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$0

ADMINISTRATION
FACILITY CONDITION INFORMATION

Administration

The project included facilities at 2 locations totaling approximately 54,361 square feet. The table below contains location-specific information regarding current and forecast Facility Condition Indices. A comprehensive list of expired systems and those expected to expire between now and the Year 2046 is shown in the Forecasted Needs Summarized by System: Administration Table.

Table 28. Facility Description: Summary of Findings: Administration

Name	Area (SF)	Total Needs 2026	Current Replacement Value	2026 FCI %	Total Needs 2031	2031 FCI %
Administration Center	39,084	\$518,214	9,312,740	6	\$753,522	8
Planning and Construction	15,277	\$717,020	3,640,127	20	\$1,330,185	37
SUBTOTAL	54,361	\$1,235,234	\$12,952,867	10	\$2,083,707	16
Site and Infrastructure (excluded from FCI calculations)		\$82,775			\$82,775	
TOTALS	54,361	\$1,318,009	\$12,952,867		\$2,166,482	

Note: The average FCI for the Administration facilities assessed is 10 while the average FCI in 5 years is estimated to be 16 assuming current sustainment levels.

Figures below show the current and forecasted needs respectively for all Administration locations grouped by system.

Figure 25. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by System Group: Administration


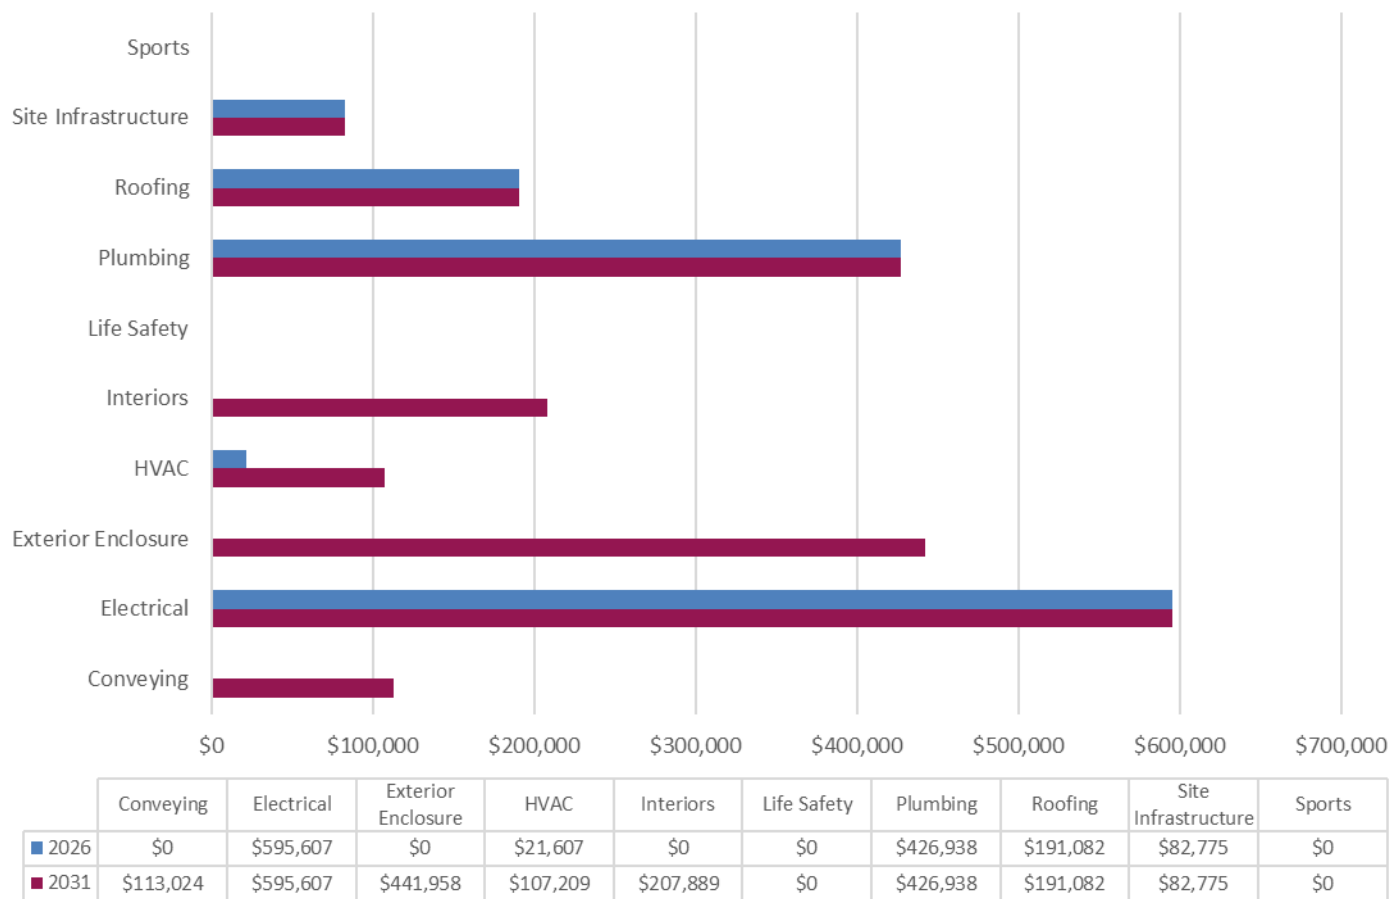


Figure 26. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Priority: Administration

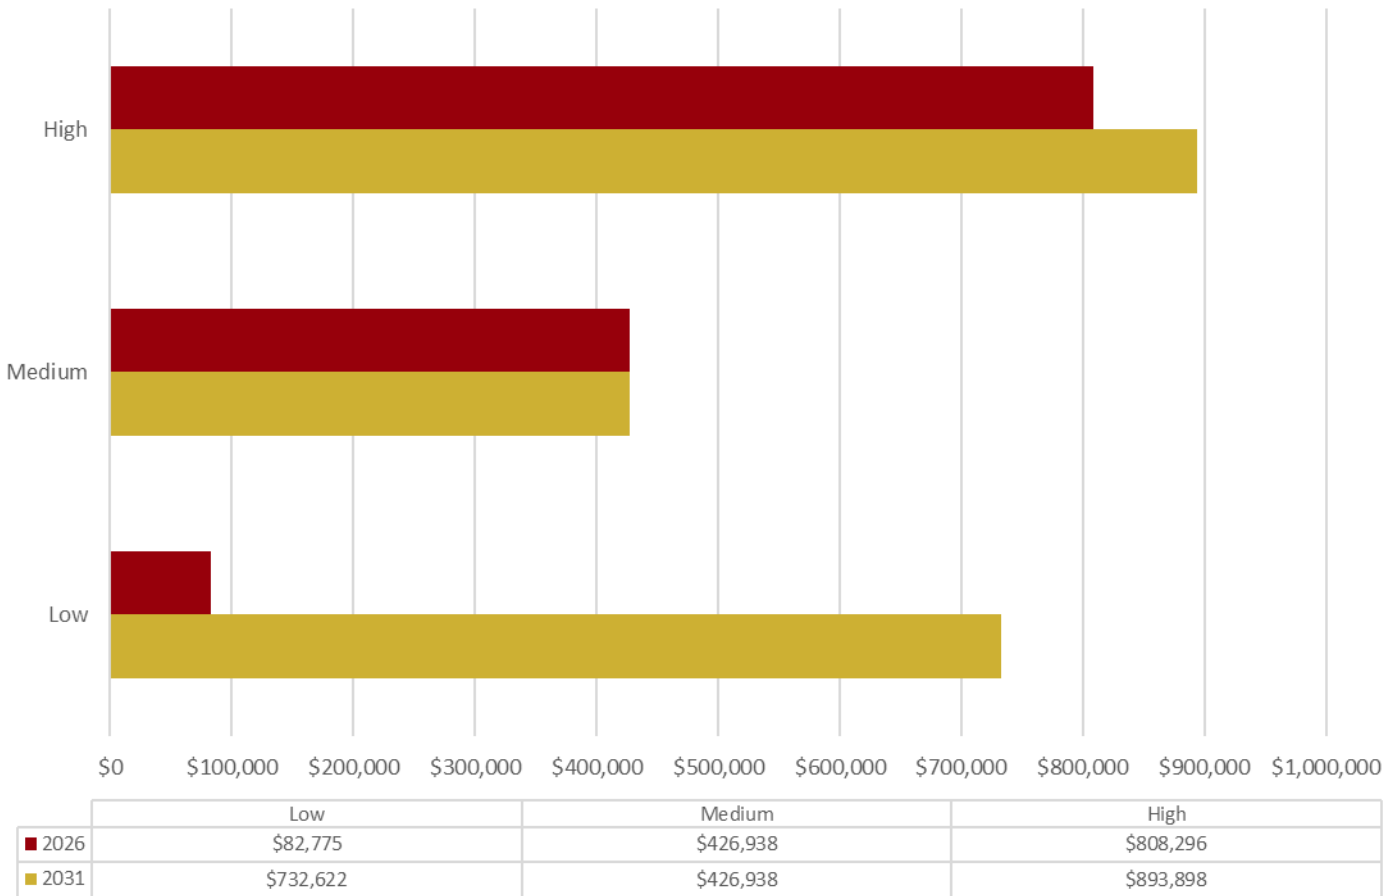

Renewal Forecast

The renewal forecast below for Administration locations shows the current backlog and projected facility sustainment requirements over the next 20 years. Please note the renewal forecast does not include potential costs associated with asbestos abatement, seismic evaluation; seismic retrofitting; hazardous material inspection, evaluation, and mitigation; and NFPA 101 and ADA upgrades. The renewal forecast is shown in the following figures:

Figure 27. Current and Forecasted Needs: Summarized by Reporting Period Current +10 Years: Administration


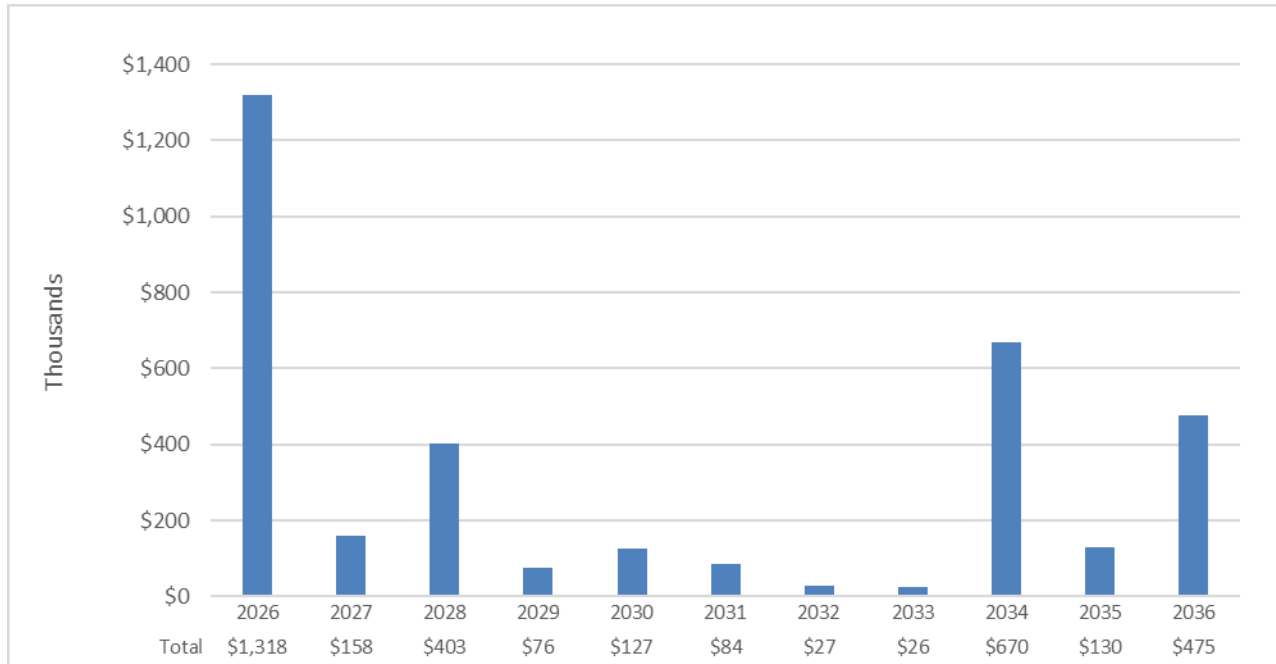


Figure 28. Current and Forecasted Needs: Summarized by Reporting Period Years 11-20: Administration

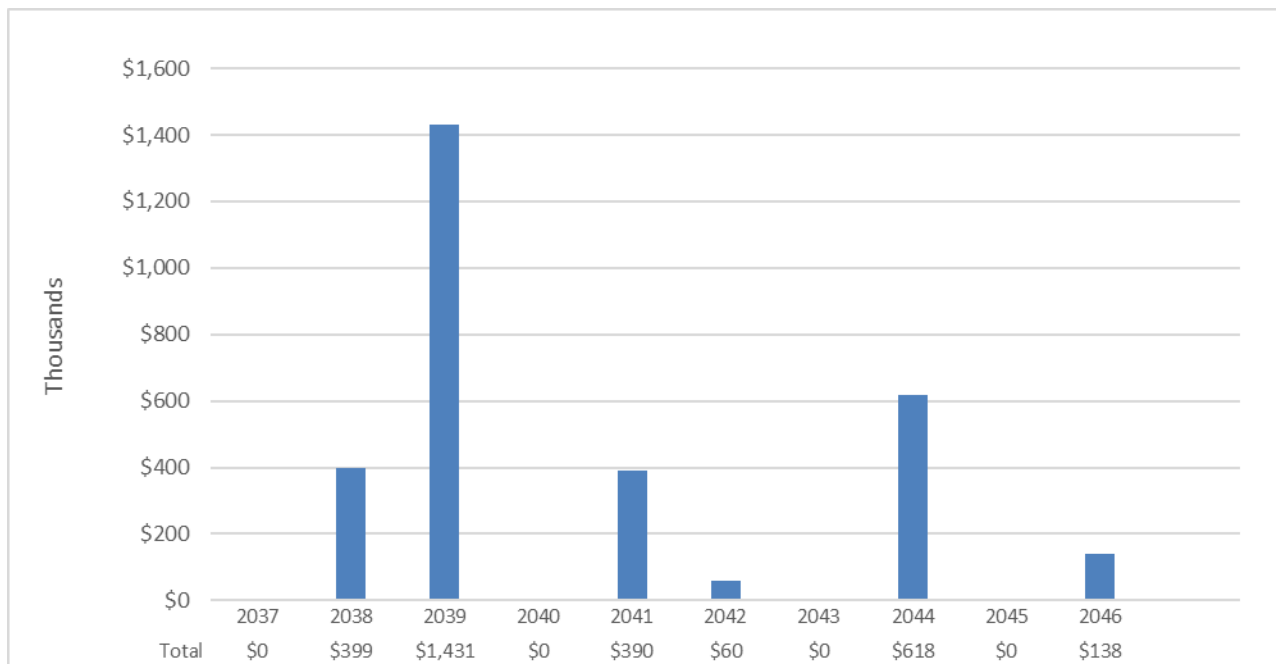

This page is intentionally left blank.

Table 29. Current and Forecasted Needs Summarized by System (Current + 5 years): Administration

System	2026	2027	2028	2029	2030	2031
Cumulative Needs by Year	\$1,318,009	\$1,476,303	\$1,879,687	\$1,955,755	\$2,082,632	\$2,166,482
Needs by Year	\$1,318,009	\$158,294	\$403,384	\$76,068	\$126,878	\$83,849
Exterior Enclosure	\$0	\$55,225	\$376,057	\$0	\$10,676	\$0
Exterior Walls (Finishes)	\$0	\$55,225	\$376,057	\$0	\$10,676	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Roofing	\$191,082	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$191,082	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$103,069	\$0	\$20,970	\$0	\$83,849
Ceiling Finishes	\$0	\$56,119	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$46,950	\$0	\$0	\$0	\$30,199
Wall Finishes	\$0	\$0	\$0	\$20,970	\$0	\$53,650
Conveying	\$0	\$0	\$0	\$0	\$113,024	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$113,024	\$0
Electrical	\$595,607	\$0	\$0	\$0	\$0	\$0
Branch Wiring	\$475,625	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$104,984	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$14,998	\$0	\$0	\$0	\$0	\$0
Plumbing	\$426,938	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$81,408	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$345,530	\$0	\$0	\$0	\$0	\$0
HVAC	\$21,607	\$0	\$27,327	\$55,098	\$3,178	\$0
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$14,362	\$0	\$3,178	\$8,516	\$3,178	\$0
Distribution System	\$7,245	\$0	\$0	\$3,432	\$0	\$0
Heat Generation	\$0	\$0	\$6,355	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$17,794	\$43,150	\$0	\$0
Site Infrastructure	\$82,775	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$82,775	\$0	\$0	\$0	\$0	\$0

Table 30. Current and Forecasted Needs Summarized by System (Years 6 - 10): Administration

System	2032	2033	2034	2035	2036
Cumulative Needs by Year	\$2,193,554	\$2,219,864	\$2,890,308	\$3,019,950	\$3,494,915
Needs by Year	\$27,072	\$26,310	\$670,444	\$129,642	\$474,965
Exterior Enclosure	\$0	\$0	\$0	\$0	\$15,187
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$15,187
Exterior Doors	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$42,022	\$0	\$0
Interior Doors	\$0	\$0	\$42,022	\$0	\$0
Specialties	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$353,989	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$353,989	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$268,587	\$0	\$367,695
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$268,587	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$367,695
Service Distribution	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$27,072	\$26,310	\$5,847	\$129,642	\$92,084
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$81,344
Cooling Generation	\$14,871	\$0	\$5,847	\$129,642	\$0
Distribution System	\$0	\$4,830	\$0	\$0	\$0
Heat Generation	\$12,202	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$21,480	\$0	\$0	\$10,740
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0

Table 31. Current and Forecasted Needs Summarized by System (Years 11 - 15): Administration

System	2037	2038	2039	2040	2041
Cumulative Needs by Year	\$3,494,915	\$3,893,625	\$5,324,279	\$5,324,279	\$5,714,666
Needs by Year	\$0	\$398,709	\$1,430,655	\$0	\$390,387
Exterior Enclosure	\$0	\$199,178	\$0	\$0	\$266,084
Exterior Walls (Finishes)	\$0	\$125,310	\$0	\$0	\$266,084
Exterior Doors	\$0	\$73,867	\$0	\$0	\$0
Roofing	\$0	\$0	\$351,114	\$0	\$0
Roof Coverings	\$0	\$0	\$351,114	\$0	\$0
Interior Construction	\$0	\$106,870	\$0	\$0	\$0
Interior Doors	\$0	\$22,942	\$0	\$0	\$0
Specialties	\$0	\$83,928	\$0	\$0	\$0
Interiors	\$0	\$0	\$287,126	\$0	\$0
Ceiling Finishes	\$0	\$0	\$287,126	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$86,560	\$397,917	\$0	\$0
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$359,547	\$0	\$0
Service Distribution	\$0	\$86,560	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$38,370	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$124,303
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$124,303
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$6,101	\$394,498	\$0	\$0
Controls and Instrumentation	\$0	\$0	\$208,106	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$0	\$0
Distribution System	\$0	\$0	\$2,097	\$0	\$0
Heat Generation	\$0	\$6,101	\$12,202	\$0	\$0
Terminal & Package Units	\$0	\$0	\$172,093	\$0	\$0
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0

Table 32. Current and Forecasted Needs Summarized by System (Years 16-20): Administration

System	2042	2043	2044	2045	2046
Cumulative Needs by Year	\$5,774,863	\$5,774,863	\$6,392,950	\$6,392,950	\$6,531,283
Needs by Year	\$60,197	\$0	\$618,087	\$0	\$138,333
Exterior Enclosure	\$0	\$0	\$35,967	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$35,967	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$557,590	\$0	\$0
Interior Doors	\$0	\$0	\$297,742	\$0	\$0
Specialties	\$0	\$0	\$259,848	\$0	\$0
Interiors	\$60,197	\$0	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$60,197	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Conveying	\$0	\$0	\$0	\$0	\$0
Conveying Systems	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$0	\$0	\$138,333
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$0	\$0	\$0	\$138,333
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$0	\$24,530	\$0	\$0
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$0	\$0	\$0	\$0
Distribution System	\$0	\$0	\$24,530	\$0	\$0
Heat Generation	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$0	\$0	\$0	\$0
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0

OTHER
FACILITY CONDITION INFORMATION

Other

The project included facilities at 1 locations totaling approximately 9,000 square feet. The table below contains location-specific information regarding current and forecast Facility Condition Indices. A comprehensive list of expired systems and those expected to expire between now and the Year 2046 is shown in the Forecasted Needs Summarized by System: Other Table.

Table 33. Facility Description: Summary of Findings: Other

Name	Area (SF)	Total Needs 2026	Current Replacement Value	2026 FCI %	Total Needs 2031	2031 FCI %
NBISD AG Barn	9,000	\$140,239	1,888,559	7	\$319,386	17
SUBTOTAL	9,000	\$140,239	\$1,888,559	7	\$319,386	17
Site and Infrastructure (excluded from FCI calculations)		\$0			\$0	
TOTALS	9,000	\$140,239	\$1,888,559		\$319,386	


Note: The average FCI for the Other facilities assessed is 7 while the average FCI in 5 years is estimated to be 17 assuming current sustainment levels.

Figures below show the current and forecasted needs respectively for all Other locations grouped by system.

Figure 29. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by System Group: Other



Figure 30. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Priority: Other

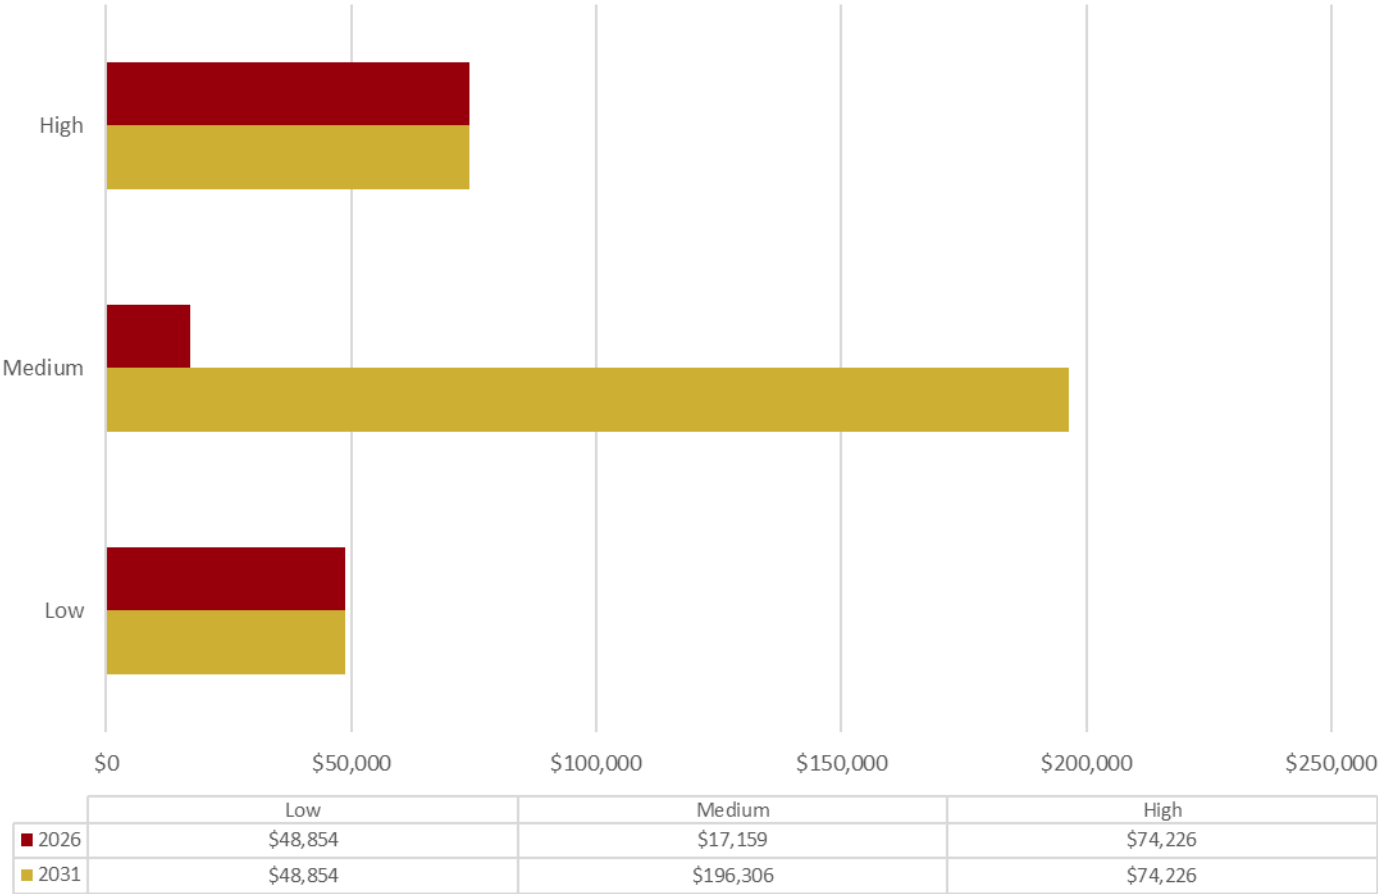

Renewal Forecast

The renewal forecast below for Other locations shows the current backlog and projected facility sustainment requirements over the next 20 years. Please note the renewal forecast does not include potential costs associated with asbestos abatement, seismic evaluation; seismic retrofitting; hazardous material inspection, evaluation, and mitigation; and NFPA 101 and ADA upgrades. The renewal forecast is shown in the following figures:

Figure 31. Current and Forecasted Needs: Summarized by Reporting Period Current +10 Years: Other


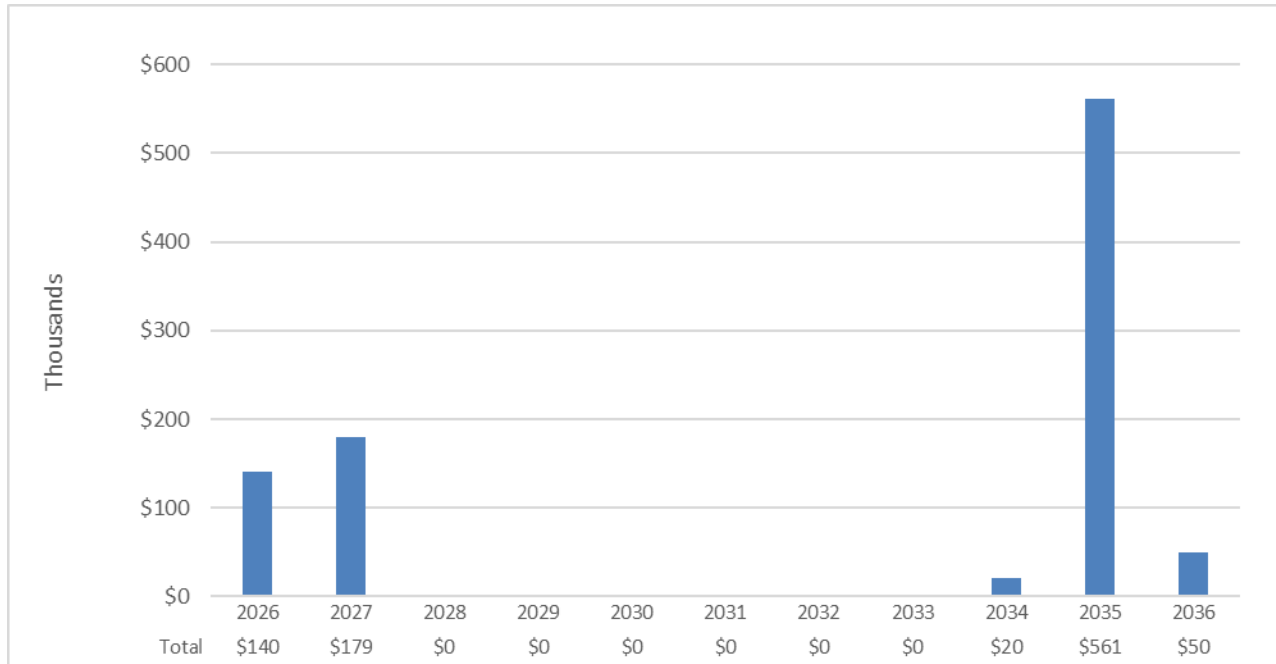


Figure 32. Current and Forecasted Needs: Summarized by Reporting Period Years 11-20: Other

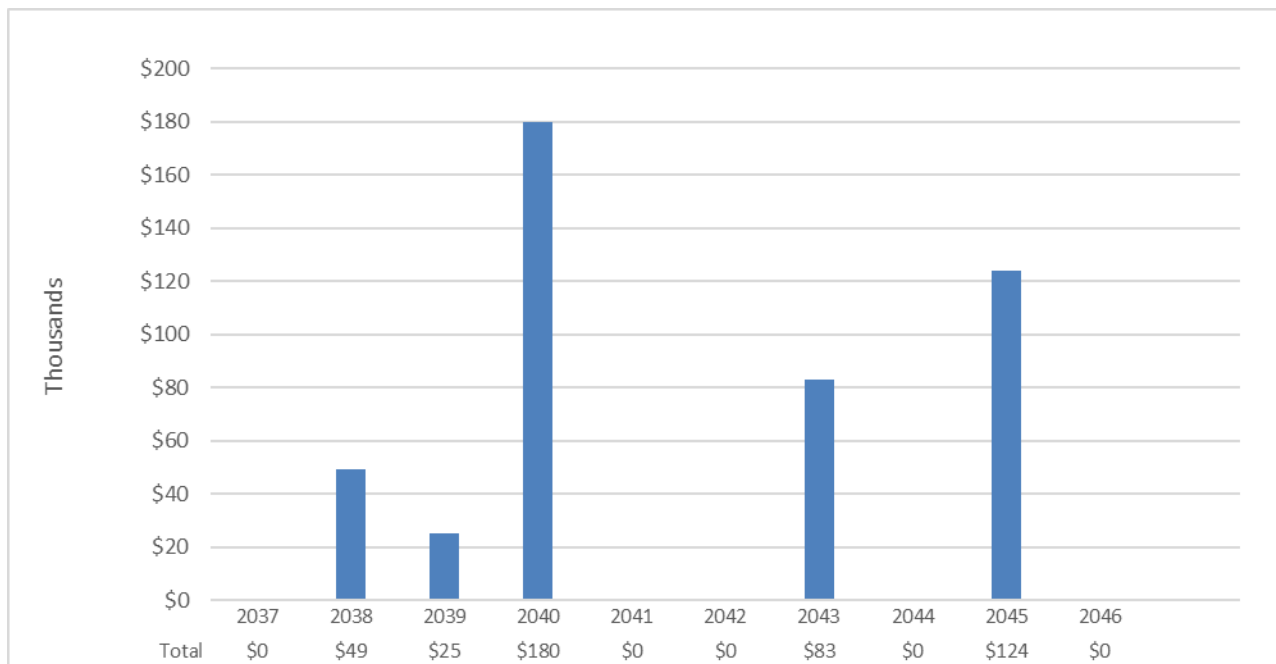

This page is intentionally left blank.

Table 34. Current and Forecasted Needs Summarized by System (Current + 5 years): Other

System	2026	2027	2028	2029	2030	2031
Cumulative Needs by Year	\$140,239	\$319,386	\$319,386	\$319,386	\$319,386	\$319,386
Needs by Year	\$140,239	\$179,147	\$0	\$0	\$0	\$0
Exterior Enclosure	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Windows	\$0	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$17,159	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$17,159	\$0	\$0	\$0	\$0	\$0
Interiors	\$48,854	\$0	\$0	\$0	\$0	\$0
Ceiling Finishes	\$18,366	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$27,056	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$3,432	\$0	\$0	\$0	\$0	\$0
Electrical	\$74,226	\$0	\$0	\$0	\$0	\$0
Branch Wiring	\$0	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$9,278	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$64,948	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$179,147	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$179,147	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$0	\$0	\$0	\$0	\$0
Distribution System	\$0	\$0	\$0	\$0	\$0	\$0

Table 35. Current and Forecasted Needs Summarized by System (Years 6 - 10): Other

System	2032	2033	2034	2035	2036
Cumulative Needs by Year	\$319,386	\$319,386	\$339,722	\$900,285	\$950,380
Needs by Year	\$0	\$0	\$20,336	\$560,562	\$50,095
Exterior Enclosure	\$0	\$0	\$20,336	\$17,159	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0
Exterior Windows	\$0	\$0	\$0	\$17,159	\$0
Exterior Doors	\$0	\$0	\$20,336	\$0	\$0
Roofing	\$0	\$0	\$0	\$0	\$0
Roof Coverings	\$0	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$0	\$38,963	\$50,095
Branch Wiring	\$0	\$0	\$0	\$38,963	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$50,095
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$227,712	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$132,832	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$94,880	\$0
HVAC	\$0	\$0	\$0	\$276,728	\$0
Distribution System	\$0	\$0	\$0	\$276,728	\$0

Table 36. Current and Forecasted Needs Summarized by System (Years 11 - 15): Other

System	2037	2038	2039	2040	2041
Cumulative Needs by Year	\$950,380	\$999,465	\$1,024,885	\$1,204,738	\$1,204,738
Needs by Year	\$0	\$49,084	\$25,420	\$179,853	\$0
Exterior Enclosure	\$0	\$0	\$25,420	\$0	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$0	\$0
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$25,420	\$0	\$0
Roofing	\$0	\$0	\$0	\$179,853	\$0
Roof Coverings	\$0	\$0	\$0	\$179,853	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$11,132	\$0	\$0	\$0
Branch Wiring	\$0	\$11,132	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$37,952	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$37,952	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$0	\$0	\$0	\$0
Distribution System	\$0	\$0	\$0	\$0	\$0

Table 37. Current and Forecasted Needs Summarized by System (Years 16-20): Other

System	2042	2043	2044	2045	2046
Cumulative Needs by Year	\$1,204,738	\$1,287,747	\$1,287,747	\$1,411,623	\$1,411,623
Needs by Year	\$0	\$83,009	\$0	\$123,877	\$0
Exterior Enclosure	\$0	\$0	\$0	\$123,877	\$0
Exterior Walls (Finishes)	\$0	\$0	\$0	\$123,877	\$0
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$0	\$0	\$0
Roofing	\$0	\$83,009	\$0	\$0	\$0
Roof Coverings	\$0	\$83,009	\$0	\$0	\$0
Interior Construction	\$0	\$0	\$0	\$0	\$0
Interior Doors	\$0	\$0	\$0	\$0	\$0
Interiors	\$0	\$0	\$0	\$0	\$0
Ceiling Finishes	\$0	\$0	\$0	\$0	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$0
Electrical	\$0	\$0	\$0	\$0	\$0
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$0	\$0	\$0	\$0	\$0
Distribution System	\$0	\$0	\$0	\$0	\$0

ELEMENTARY SCHOOL
FACILITY CONDITION INFORMATION

Elementary School

The project included facilities at 11 locations totaling approximately 845,311 square feet. The table below contains location-specific information regarding current and forecast Facility Condition Indices. A comprehensive list of expired systems and those expected to expire between now and the Year 2046 is shown in the Forecasted Needs Summarized by System: Elementary School Table.

Table 38. Facility Description: Summary of Findings: Elementary School

Name	Area (SF)	Total Needs 2026	Current Replacement Value	2026 FCI %	Total Needs 2031	2031 FCI %
Carl Schurz Elementary	53,381	\$4,386,449	18,446,397	24	\$4,945,594	27
County Line Elementary	59,240	\$8,397,560	20,471,039	41	\$8,707,430	43
Klein Road Elementary	98,000	\$871,961	33,864,987	3	\$1,746,848	5
Lamar Elementary	106,000	\$0	36,629,476	0	\$0	0
Legend Point Elementary	102,000	\$0	35,247,231	0	\$0	0
Lone Star Early Childhood Center	53,813	\$4,250,453	18,595,679	23	\$5,146,386	28
Memorial Elementary	62,419	\$1,596,779	21,569,578	7	\$6,382,180	30
Seele Elementary	51,420	\$4,091,195	17,768,751	23	\$5,243,140	30
Veramendi Elementary	102,000	\$0	35,247,231	0	\$98,009	0
Voss Farms Elementary	101,000	\$0	34,901,670	0	\$106,753	0
Walnut Springs Elementary	56,038	\$4,723,928	19,364,552	24	\$5,306,999	27
SUBTOTAL	845,311	\$28,318,325	\$292,106,591	10	\$37,683,341	13
Site and Infrastructure (excluded from FCI calculations)		\$143,666			\$143,666	
TOTALS	845,311	\$28,461,991	\$292,106,591		\$37,827,007	

Note: The average FCI for the Elementary School facilities assessed is 10 while the average FCI in 5 years is estimated to be 13 assuming current sustainment levels.

Figures below show the current and forecasted needs respectively for all Elementary School locations grouped by system.

Figure 33. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by System Group: Elementary School


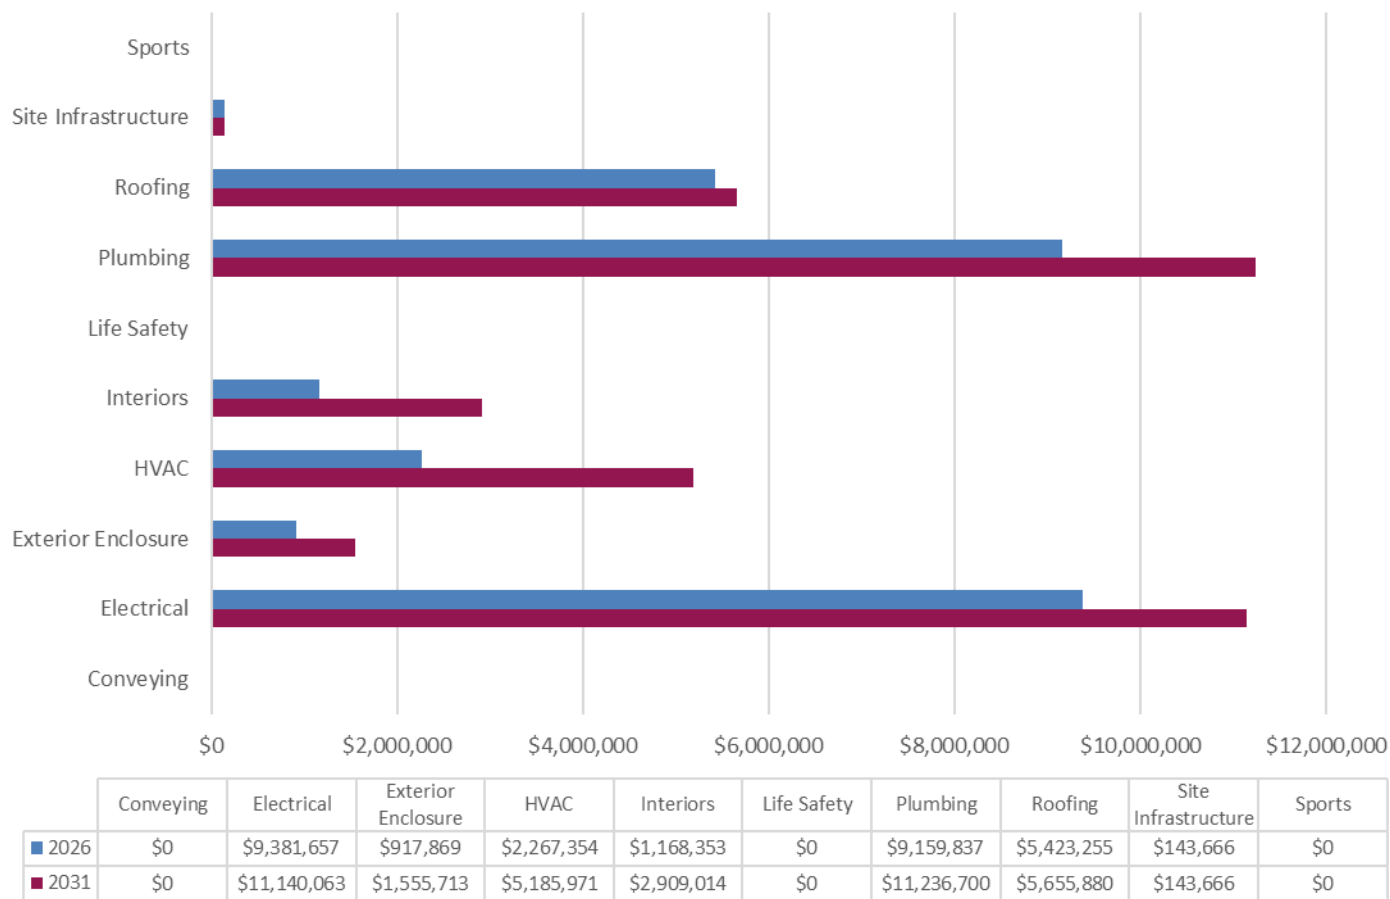


Figure 34. Comparison of 2026 Current Needs vs. 2031 Forecasted Needs by Priority: Elementary School

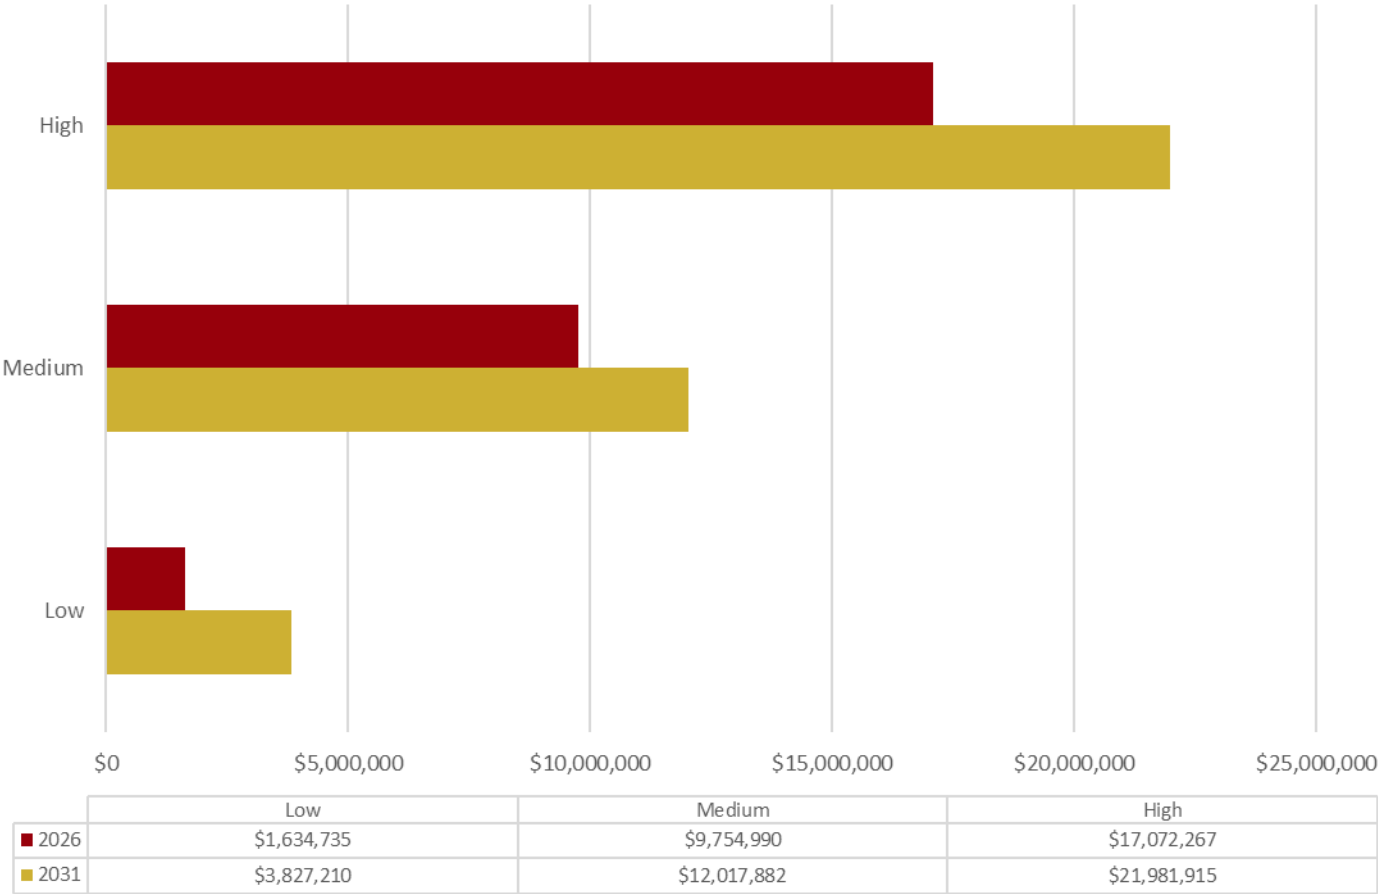

Renewal Forecast

The renewal forecast below for Elementary School locations shows the current backlog and projected facility sustainment requirements over the next 20 years. Please note the renewal forecast does not include potential costs associated with asbestos abatement, seismic evaluation; seismic retrofitting; hazardous material inspection, evaluation, and mitigation; and NFPA 101 and ADA upgrades. The renewal forecast is shown in the following figures:

Figure 35. Current and Forecasted Needs: Summarized by Reporting Period Current +10 Years: Elementary School


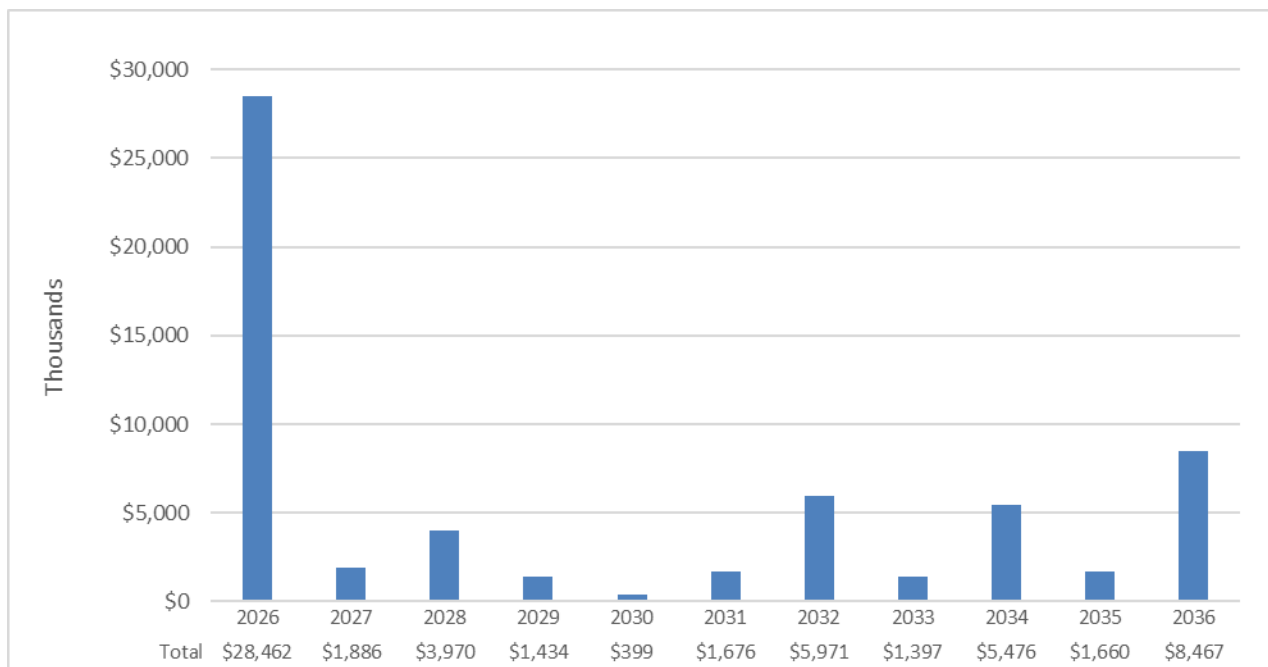


Figure 36. Current and Forecasted Needs: Summarized by Reporting Period Years 11-20: Elementary School

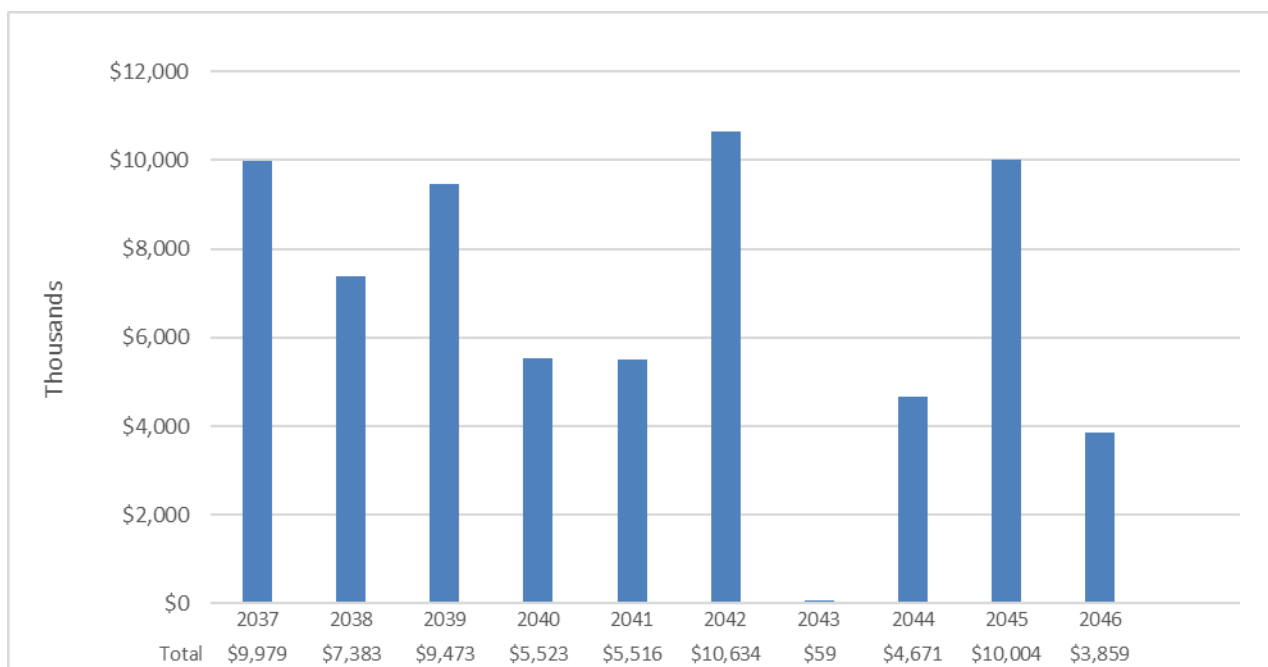

This page is intentionally left blank.

Table 39. Current and Forecasted Needs Summarized by System (Current + 5 years): Elementary School

System	2026	2027	2028	2029	2030	2031
Cumulative Needs by Year	\$28,461,991	\$30,348,216	\$34,318,104	\$35,752,445	\$36,151,193	\$37,827,007
Needs by Year	\$28,461,991	\$1,886,225	\$3,969,887	\$1,434,341	\$398,748	\$1,675,814
Exterior Enclosure	\$917,869	\$630,218	\$0	\$0	\$7,626	\$0
Exterior Walls (Finishes)	\$571,184	\$531,967	\$0	\$0	\$7,626	\$0
Exterior Windows	\$137,788	\$88,061	\$0	\$0	\$0	\$0
Exterior Doors	\$208,897	\$10,190	\$0	\$0	\$0	\$0
Roofing	\$5,423,255	\$0	\$0	\$232,625	\$0	\$0
Roof Coverings	\$5,423,255	\$0	\$0	\$232,625	\$0	\$0
Interior Construction	\$703,845	\$0	\$0	\$0	\$243,369	\$0
Interior Doors	\$248,468	\$0	\$0	\$0	\$87,779	\$0
Specialties	\$455,377	\$0	\$0	\$0	\$155,590	\$0
Interiors	\$464,509	\$738,711	\$45,064	\$118,943	\$0	\$594,574
Ceiling Finishes	\$67,859	\$0	\$0	\$0	\$0	\$58,417
Floor Finishes	\$184,754	\$728,327	\$5,122	\$0	\$0	\$298,642
Wall Finishes	\$211,896	\$10,384	\$39,942	\$118,943	\$0	\$237,515
Electrical	\$9,381,657	\$0	\$1,397,433	\$255,480	\$105,493	\$0
Branch Wiring	\$6,131,879	\$0	\$1,397,433	\$0	\$0	\$0
Communications & Security	\$866,560	\$0	\$0	\$0	\$0	\$0
Lighting	\$983,810	\$0	\$0	\$0	\$0	\$0
Service Distribution	\$543,847	\$0	\$0	\$0	\$105,493	\$0
Exit Signs and Emergency Lighting	\$855,563	\$0	\$0	\$255,480	\$0	\$0
Plumbing	\$9,159,837	\$349,587	\$1,727,276	\$0	\$0	\$0
Domestic Water Distribution	\$998,662	\$0	\$227,591	\$0	\$0	\$0
Plumbing Fixtures	\$1,580,622	\$349,587	\$0	\$0	\$0	\$0
Sanitary Waste	\$6,580,553	\$0	\$1,499,684	\$0	\$0	\$0
HVAC	\$2,267,354	\$167,708	\$800,115	\$827,294	\$42,261	\$1,081,240
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$185,757	\$167,708	\$16,015	\$14,871	\$0	\$335,417
Distribution System	\$2,054,589	\$0	\$777,999	\$643,062	\$31,394	\$552,885
Heat Generation	\$0	\$0	\$0	\$4,385	\$0	\$130,595
Terminal & Package Units	\$27,009	\$0	\$6,101	\$164,976	\$10,867	\$62,343
Fire Protection	\$0	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0	\$0
Site Infrastructure	\$143,666	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$143,666	\$0	\$0	\$0	\$0	\$0

Table 40. Current and Forecasted Needs Summarized by System (Years 6 - 10): Elementary School

System	2032	2033	2034	2035	2036
Cumulative Needs by Year	\$43,798,201	\$45,195,630	\$50,671,440	\$52,331,710	\$60,798,399
Needs by Year	\$5,971,194	\$1,397,429	\$5,475,810	\$1,660,270	\$8,466,688
Exterior Enclosure	\$0	\$0	\$340,063	\$210,859	\$85,348
Exterior Walls (Finishes)	\$0	\$0	\$171,900	\$210,859	\$85,348
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$0	\$168,163	\$0	\$0
Roofing	\$0	\$0	\$0	\$1,189,796	\$0
Roof Coverings	\$0	\$0	\$0	\$1,189,796	\$0
Interior Construction	\$0	\$0	\$365,232	\$0	\$0
Interior Doors	\$0	\$0	\$280,591	\$0	\$0
Specialties	\$0	\$0	\$84,641	\$0	\$0
Interiors	\$1,215,489	\$1,193,052	\$4,675,698	\$259,615	\$125,144
Ceiling Finishes	\$1,035,335	\$1,193,052	\$61,526	\$43,102	\$125,144
Floor Finishes	\$0	\$0	\$3,750,476	\$0	\$0
Wall Finishes	\$180,153	\$0	\$863,697	\$216,513	\$0
Electrical	\$3,657,905	\$0	\$0	\$0	\$4,331,652
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$1,795,016	\$0	\$0	\$0	\$0
Lighting	\$1,862,888	\$0	\$0	\$0	\$4,331,652
Service Distribution	\$0	\$0	\$0	\$0	\$0
Exit Signs and Emergency Lighting	\$0	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$1,097,801	\$204,377	\$94,817	\$0	\$3,924,545
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$3,924,545
Cooling Generation	\$75,625	\$0	\$94,817	\$0	\$0
Distribution System	\$874,448	\$36,096	\$0	\$0	\$0
Heat Generation	\$2,669	\$0	\$0	\$0	\$0
Terminal & Package Units	\$145,059	\$168,280	\$0	\$0	\$0
Fire Protection	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0

Table 41. Current and Forecasted Needs Summarized by System (Years 11 - 15): Elementary School

System	2037	2038	2039	2040	2041
Cumulative Needs by Year	\$70,777,064	\$78,160,316	\$87,633,658	\$93,156,589	\$98,672,171
Needs by Year	\$9,978,665	\$7,383,252	\$9,473,342	\$5,522,930	\$5,515,582
Exterior Enclosure	\$0	\$945,716	\$316,636	\$0	\$155,634
Exterior Walls (Finishes)	\$0	\$734,191	\$186,359	\$0	\$155,634
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$0	\$211,525	\$130,277	\$0	\$0
Roofing	\$574,746	\$0	\$0	\$0	\$0
Roof Coverings	\$574,746	\$0	\$0	\$0	\$0
Interior Construction	\$0	\$1,457,164	\$1,551,352	\$0	\$0
Interior Doors	\$0	\$345,471	\$467,445	\$0	\$0
Specialties	\$0	\$1,111,692	\$1,083,907	\$0	\$0
Interiors	\$1,427,950	\$0	\$1,445,040	\$3,040,155	\$0
Ceiling Finishes	\$0	\$0	\$355,800	\$0	\$0
Floor Finishes	\$1,427,950	\$0	\$1,089,241	\$2,779,185	\$0
Wall Finishes	\$0	\$0	\$0	\$260,969	\$0
Electrical	\$7,975,969	\$490,226	\$2,328,117	\$2,315,067	\$30,123
Branch Wiring	\$0	\$0	\$2,194,019	\$0	\$0
Communications & Security	\$2,025,955	\$0	\$57,476	\$2,315,067	\$0
Lighting	\$5,420,807	\$0	\$0	\$0	\$0
Service Distribution	\$0	\$490,226	\$76,623	\$0	\$30,123
Exit Signs and Emergency Lighting	\$529,208	\$0	\$0	\$0	\$0
Plumbing	\$0	\$0	\$2,711,883	\$0	\$4,645,519
Domestic Water Distribution	\$0	\$0	\$357,326	\$0	\$0
Plumbing Fixtures	\$0	\$0	\$0	\$0	\$4,645,519
Sanitary Waste	\$0	\$0	\$2,354,557	\$0	\$0
HVAC	\$0	\$3,645,749	\$1,120,313	\$167,708	\$684,306
Controls and Instrumentation	\$0	\$0	\$0	\$0	\$0
Cooling Generation	\$0	\$1,064,590	\$0	\$167,708	\$633,975
Distribution System	\$0	\$2,561,955	\$1,120,313	\$0	\$2,415
Heat Generation	\$0	\$0	\$0	\$0	\$47,917
Terminal & Package Units	\$0	\$19,205	\$0	\$0	\$0
Fire Protection	\$0	\$844,397	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$844,397	\$0	\$0	\$0
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0

Table 42. Current and Forecasted Needs Summarized by System (Years 16-20): Elementary School

System	2042	2043	2044	2045	2046
Cumulative Needs by Year	\$109,306,265	\$109,365,049	\$114,036,045	\$124,039,547	\$127,898,910
Needs by Year	\$10,634,094	\$58,784	\$4,670,996	\$10,003,501	\$3,859,363
Exterior Enclosure	\$843,650	\$0	\$25,322	\$0	\$0
Exterior Walls (Finishes)	\$668,724	\$0	\$25,322	\$0	\$0
Exterior Windows	\$0	\$0	\$0	\$0	\$0
Exterior Doors	\$174,926	\$0	\$0	\$0	\$0
Roofing	\$0	\$0	\$1,693,779	\$1,535,177	\$0
Roof Coverings	\$0	\$0	\$1,693,779	\$1,535,177	\$0
Interior Construction	\$2,015,196	\$0	\$0	\$0	\$0
Interior Doors	\$573,034	\$0	\$0	\$0	\$0
Specialties	\$1,442,162	\$0	\$0	\$0	\$0
Interiors	\$1,174,899	\$0	\$0	\$1,380,311	\$230,337
Ceiling Finishes	\$1,174,899	\$0	\$0	\$1,380,311	\$0
Floor Finishes	\$0	\$0	\$0	\$0	\$0
Wall Finishes	\$0	\$0	\$0	\$0	\$230,337
Electrical	\$2,622,469	\$0	\$1,818,056	\$6,096,567	\$110,643
Branch Wiring	\$0	\$0	\$0	\$0	\$0
Communications & Security	\$0	\$0	\$0	\$0	\$0
Lighting	\$2,622,469	\$0	\$1,796,877	\$5,554,324	\$0
Service Distribution	\$0	\$0	\$0	\$0	\$110,643
Exit Signs and Emergency Lighting	\$0	\$0	\$21,179	\$542,243	\$0
Plumbing	\$3,851,415	\$0	\$0	\$0	\$0
Domestic Water Distribution	\$0	\$0	\$0	\$0	\$0
Plumbing Fixtures	\$3,851,415	\$0	\$0	\$0	\$0
Sanitary Waste	\$0	\$0	\$0	\$0	\$0
HVAC	\$126,465	\$58,784	\$1,133,839	\$991,446	\$3,518,382
Controls and Instrumentation	\$0	\$0	\$75,986	\$991,446	\$0
Cooling Generation	\$126,465	\$0	\$841,275	\$0	\$1,124,327
Distribution System	\$0	\$41,180	\$216,578	\$0	\$1,603,875
Heat Generation	\$0	\$0	\$0	\$0	\$0
Terminal & Package Units	\$0	\$17,603	\$0	\$0	\$790,181
Fire Protection	\$0	\$0	\$0	\$0	\$0
Sprinklers & Standpipe	\$0	\$0	\$0	\$0	\$0
Site Infrastructure	\$0	\$0	\$0	\$0	\$0
Vehicular Pavements	\$0	\$0	\$0	\$0	\$0

APPENDICES

APPENDICES

Appendix A -Typical System Lifecycles

System and component life cycles used in the cost models for this project were based on average service life as shown in the *Preventive Maintenance Guidebook: Best Practices to Maintain Efficient and Sustainable Buildings* published by Building Owners and Managers Association (BOMA) International. When life cycle information is not provided by BOMA, life cycles have been assigned using ALPHA's professional judgment.

Table 43. Typical Life Cycles

System	Lifecycle (Years)	System	Lifecycle (Years)
Roofing		Plumbing Fixtures	30
Built-up	25	Domestic Water Distribution	30
Composition Shingle	20	Sanitary Waste	30
Metal Panels	25	Fire Protection	
Modified Bitumen	20	Fire Sprinklers and Standpipe (Piping and Risers)	40
Standing Seam Metal	35	Fire Detection (Activation Devices)	10
Building Exterior		Fire Detection (Notification Devices and	15
Exterior Doors	25	Fire Detection (Wiring)	30
Exterior Walls (Finishes)	10-30	HVAC	
Exterior Windows	30	Cooling Generating	25
Interior Finishes		Controls	20
Interior Doors	25	Distribution	30
Ceiling (Acoustical Tile and Grids)	20	Heat Generating	30
Ceiling (Painted)	10	Terminal and Package Units	15
Walls	10	Electrical	
Floors	15	Branch Wiring	30
Built-in Equip/Specialties		Lighting	20
Built-in Equip/Specialties	20	Service and Distribution	40
Conveying Systems		Generators	20
Elevators	35	Equipment	
Chair Lifts	15	Institutional Equipment	25
Plumbing		Other Equipment	15-25

Appendix B - Supplemental Information

Capital Planning v. Budgeting

While traditional budgets may be perceived as reacting to short-term needs based on the historical performance of facilities and systems, a capital plan anticipates both short- and long-term degradation by employing a facility condition assessment and predictive cost modeling.

- **Budgeting:** Traditional, cost-based, budgeting practices describe a system by which a prior period's budget is adjusted to provide for the fluctuating cost of maintaining facilities. Traditional budgeting issues may include: 1) anticipated needs; 2) organizational growth; 3) the acquisition of new assets; 4) operations and maintenance; 5) deferred maintenance; and, 6) insurance.
- **Capital Planning:** Capital planning differs from budgeting in that it considers a broader range of financial considerations over an extended timeline so as to more effectively predict and manage the fiscal needs of a real estate portfolio. Financial considerations may include the cost of capital, depreciation, organizational risk and return on investment (ROI). Similar in concept to the accounting principle of anticipating the capital depreciation of plant value, a capital renewal plan anticipates and attempts to counteract the ongoing deterioration of facility systems and components in order to extend a facility's life and value.

Facility Condition Index

A Facility Condition Index is considered to be a key building performance metric. As part of the FCA process, a facility condition index (FCI) is calculated for each facility. The FCI is used to quantify a facility's physical condition at a specific point in time and is calculated using the expired system replacement costs (costs associated with systems that are beyond average service life) and the current replacement value (CRV) of the building. Expired system replacement costs consist of work that is necessary to restore the facility to a condition equivalent to its original (like new) state.

Example: Total expired system replacement costs (Requirements) = \$3,000,000

Current Replacement Value (CRV) = \$10,000,000

$$FCI = \frac{\$3,000,000}{\$10,000,000} = .30$$



Present Value and Nominal Value

In the calculation of FCI sums, monetary values can be discounted to incorporate the time value of money, or be expressed in constant terms, ignoring the effects of inflation and interest. Because the cost of capital can vary significantly according to time, portfolio types, and project programs, all monetary terms in this report are expressed as nominal values.

- **Nominal Value:** Expresses monetary values, without adjusting for inflation or interest (also known as face value or par value).
- **Present Value:** The current worth of a future sum of money or stream of cash flows given a specified rate of return. Future cash flows can be discounted at a client specified discount rate to reflect the owner's internal cost of capital.

Hard and Soft Costs

Unless otherwise stated, the costs indicated in this report represent hard costs only. Because soft costs vary regionally and periodically, provisions for soft cost expenses should be considered in addition to the hard costs indicated. For the purpose of this report, Hard and Soft costs are defined as follows:

- **Hard costs:** Direct costs incurred in relation to a specific construction project. Hard cost may include labor, materials, equipment, etc.
- **Soft cost:** Indirect costs incurred in addition to the direct construction cost. Soft costs may include professional services, financing, taxes, etc.

Building Systems

A building system describes a mechanism, or group of mechanisms that perform a given role to maintain the functionality of a facility. Examples of building systems may include roofing, plumbing or heating, ventilation and air conditioning (HVAC) systems.

Per the Uniformat classification standard, building systems have been grouped as follows:

- Foundations
- Superstructure
- Exterior Enclosure
- Roofing
- Interior Construction
- Interior Finishes
- Conveying Systems
- Plumbing
- HVAC
- Fire Protection
- Electrical


System States

The design life of a building system or component describes the duration for which a system is expected to perform within normal operational parameters. The design life may be shortened for a variety of reasons including, neglect or inadequate maintenance or extended as a result of robust preventative / predictive maintenance. This extended or shortened design life is defined as a system's useful life, and quantifies the duration for which a system, or component, operates within a minimally accepted level of performance.

As illustrated in the figure below, a facility condition analysis will make an appraisal of systems and components and recommend one of a series of actions necessary to ensure the continued functionality of a facility:

- **Missing:** A system or component may be deemed missing if the element absent, but is required for the operation of a facility (Example: ADA requirements for accessible ramps).
- **Extended:** The life cycle of a system or component may be extended beyond its anticipated design life, if the element is deemed to be performing adequately.
- **Expired:** A system or component may be recommended for replacement (at any time) if the element is deemed to be performing inadequately.

Figure 37. System or Component Life Cycle Curve

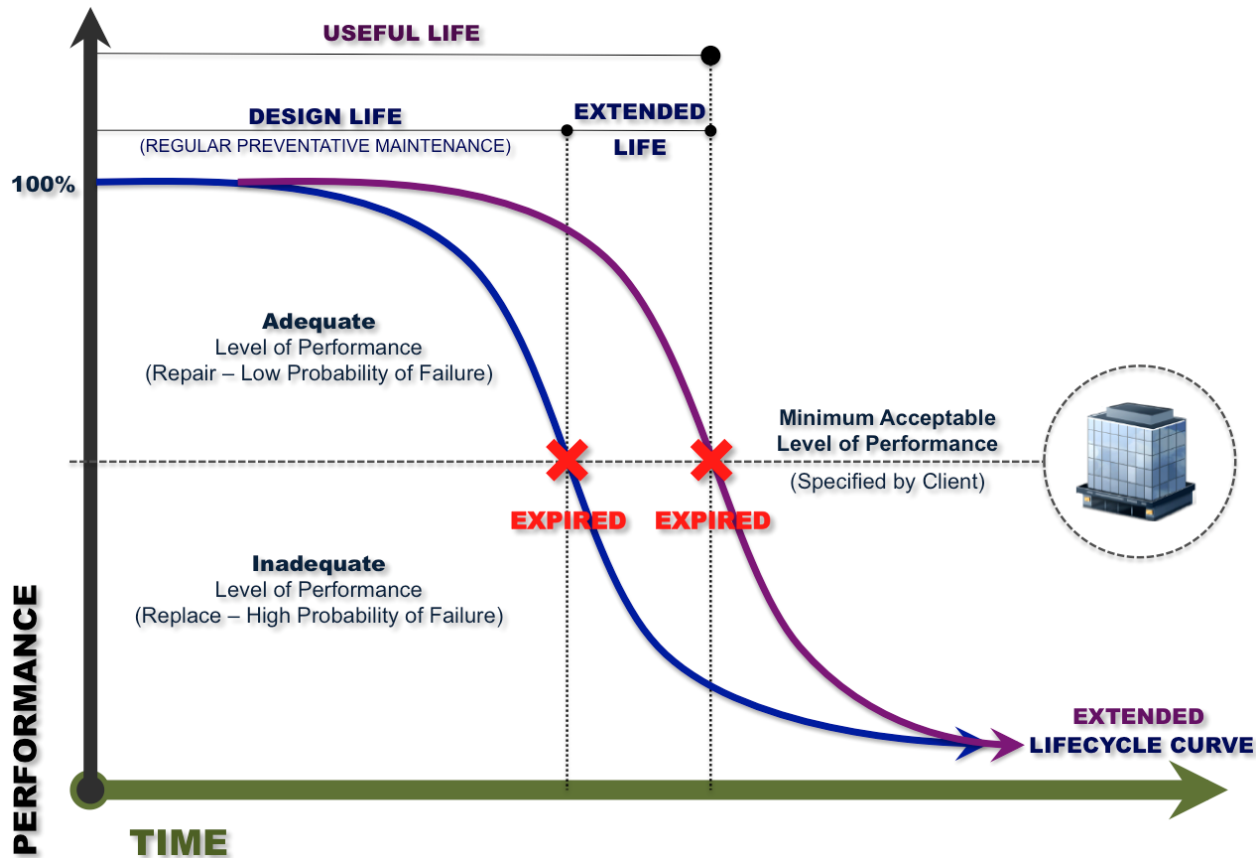

System Actions

A deficiency describes a condition in which there exists the need to repair an item that is damaged, missing, inadequate or insufficient for an intended purpose. Deficiencies are typically associated with underperforming systems or components, and describe activities that are required to extend their useful life.

- **Repair:** Describes a condition in which it is recommended that the building system or component be serviced to provide additional useful life. Repairs are curative in nature, while maintenance by contrast is preventative.
- **Replace:** Describes a condition in which it is recommended that the building system or component be removed and replaced with a new system or component. Replacement needs may vary according to building type, region, use, and maintenance management.

Multiple building systems are considered “non-renewable” because the replacement of those systems would typically be so costly as to require the replacement of the entire facility (Example: Foundations). Accordingly, there are no deficiencies or costs associated to non-renewable system.

Additionally, per client preferences, many aspects of the built environment may not be part of the scope of a facility condition analysis.

Cost Models

Cost estimation models are parametric equations used to predict the costs or the life cycle of a building system or component. The projections of the cost models are factored into capital plans, budgeting tools and other financial planning mechanisms. The rough order of magnitude cost estimates contained in this report are based on the cost models available within the client's database platform.

It is important to note that there are a variety of cost model equations employed in the building industry and it is not uncommon for prices derived from the client's database platform to vary from external references. If required, adjustments can typically be made to the facility condition data in order to facilitate comparison with external cost models, better reflect local conditions or perform sensitivity analyses.

This page is intentionally left blank.

Appendix C - Glossary

ACBM: Asbestos-containing Building Material

ADA: Americans with Disabilities Act

AHERA: Asbestos Hazard Emergency Response Act

ALPHA: ALPHA Facilities Solutions, LLC

Alterations: Work performed to change the interior arrangements or other physical characteristics of an existing facility or fixed equipment so that it can be used more effectively for its current designated purpose or adapted to a new use.

ASHRAE: American Society of Heating, Refrigerating and Air Conditioning Engineers

ASTM: American Society for Testing and Materials

BOMA: Building Owners and Managers Association

Budgeting: A system by which a prior period's estimate of income and expenditure is adjusted to account for operational realities in order to provide for the cost of maintaining facilities. Traditional budgeting issues may include anticipated needs, organizational growth, the acquisition of new assets, operations and maintenance, deferred maintenance and insurance.

Building: An enclosed and roofed structure that can be traversed without exiting to the exterior.

Building Addition: An area, space or component of a building added to the existing structure, after the original building's year built date.

Capital Renewal: The planned replacement of building subsystems such as roofs, electrical systems, HVAC systems, and plumbing systems that have reached the end of their useful lives. Without significant reinvestment in building subsystems, older facilities will fall into a state of deteriorating condition and functionality, and the repair and maintenance costs will increase (International Facilities Management Association).

Calculated Next Renewal: The year a system or element would be expected to expire, based solely on the date it was installed and the expected service life of the system.

Condition: Condition refers to the state of physical fitness or readiness of a facility, system or systemic element for its intended use.

Cost Model: Parametric equations used to quantify the condition of building systems and estimate the cost necessary to sustain a facility over a given set of reporting periods. These estimated costs can be presented over a timeline to represent a capital renewal schedule.

Current Replacement Value (CRV): CRV is a standard industry cost estimate of materials, supplies and labor required to replace facility at existing size and functional capability. Please note that the terms Plant Replacement Value and Current Replacement Value have the same meaning in the context of determining Facility Condition Index.

Deficiency: A deficiency describes a condition in which there exists the need to repair a building system or component that is damaged, missing, inadequate or insufficient for an intended purpose.

Element: Elements are the major components that comprise building systems.

Facility: A facility refers to site(s), building(s), or building addition(s) or combinations thereof that provide a particular service or support of an educational purpose.

Facility Condition Assessment (FCA): The process of performing a physical evaluation of the condition of a facility and its systems. The findings of this analysis may be used in conjunction with cost models to estimate the current and future funding streams necessary to maintain a real estate portfolio.

Facility Condition Index (FCI): FCI is an industry-standard measurement of a facility's condition that is the ratio of the cost to correct a facility's deficiencies to the Current Replacement Value of the facilities – the higher the FCI, the poorer the condition of the facility. After an FCI is established for all buildings within a portfolio, a building's condition can be ranked relative to other buildings. The FCI may also represent the condition of a portfolio based on the cumulative FCIs of the portfolio's facilities.

Gross Square Feet (GSF): The size of the enclosed floor space of a building in square feet, measured to the outside face of the enclosing walls.

Hard Costs: Direct costs incurred in relation to a specific construction project. Hard costs may include labor, materials, equipment, etc.

Heating, Ventilation and Air Conditioning (HVAC): A term used to describe building systems responsible for maintaining the temperature, humidity and air quality control.

IFMA: International Facilities Management Association.

Indoor Air Quality (IAQ): A metric used to quantify the air quality within and around buildings and structures, especially as it relates to the health and comfort of building occupants.

Install Year: The year a building or system was built or the most recent major renovation date (where a minimum of 70% of the system's Current Replacement Value (CRV) was replaced).

Inflation: The trend of increasing prices from one year to the next, representing the rate at which the real value of an investment is eroded and the loss in spending power over time.

Interest: The charge for the privilege of borrowing money, typically expressed as an annual percentage rate and commonly calculated using simple or compound interest calculation.

Life Cycle: The period of time that a building, system or element can be expected to adequately serve its intended function.

Maintenance: Work necessary to realize the originally anticipated life of a fixed asset, including buildings, fixed equipment and infrastructure. Maintenance is preventative, whereas repairs are curative.

Mechanical, Electrical and Plumbing (MEP): A term used to describe building systems related to the provision of HVAC, electric and plumbing services to a facility.

Needs: In the context of this report, needs are the backlog of capital renewal requirements.

Next Renewal: The assessor adjusted expected useful life of a system or element as a result of on-site inspection.

Nominal Value: A value expressed in monetary terms for a specific year or years, without adjusting for inflation – also known as face value or par value.

Operations: Activities related to normal performance of the functions for which a building is used (e.g., utilities, janitorial services, waste treatment).

O&M: Operations and Maintenance

Parametric Cost Modeling: Parametric statistics is a branch of statistics that assumes that the data has come from a type of probability distribution and makes inferences about the parameters of the distribution.

Plant Replacement Value (PRV): PRV represents the cost to design and construct a notional facility to current standards to replace an existing facility at the same location. Please note that the terms Plant Replacement Value (PRV) and Current Replacement Value (CRV) have the same meaning in the context of determining Facility Condition Index (FCI).

Present Value (PV): The current worth of a future sum of money or stream of cash flows given a specified rate of return. Future cash flows are discounted at a client specified discount rate.

Real Interest Rate: A net interest rate adjusted to remove the effects of inflation. It is the amount by which the nominal interest rate is higher than the inflation rate.

Repairs: Work to restore damaged or worn-out facilities to normal operating condition. Repairs are curative, whereas maintenance is preventative.

Replacements: An exchange of one fixed asset for another that has the same capacity to perform the same function. In contrast to repair, replacement generally involves a complete identifiable item of reinvestment (e.g., a major building component or subsystem).

Return on Investment (ROI): ROI is a financial indicator used to evaluate the performance of an investment and as a means to compare benefit.

Rough Order of Magnitude (ROM): ROM cost estimates are the most basic of cost estimate classifications.

RSMeans: An independent third-party provider of building industry construction cost data.

Site: A facility's grounds and its utilities, roadways, landscaping, fencing and other typical land improvements needed to support the facility.

Soft Costs: Indirect costs incurred in addition to the direct construction cost. Soft costs may include professional services, financing, taxes, etc.

System: System refers to building and related site work elements as described by ASTM Uniformat II, Classification for Building Elements (E1557-97), a format for classifying major facility elements common to most buildings. Elements usually perform a given function, regardless of the design specification, construction method or materials used. See also, "Uniformat II".

Uniformat II: Uniformat II (commonly referred to simply as Uniformat), is ASTM Uniformat II, Classification for Building Elements (E1557-97) – A methodology for classifying major facility components common to most buildings.

Year Built: The year that a building or addition was originally built, based on substantial completion or occupancy.

This page is intentionally left blank.



4085 Cibolo Canyons, Suite 200

San Antonio, TX 78261

210.49.ALPHA www.alphafacilities.com

answers@alphafacilities.com