



Rigging System/ Safety Inspection Report

Facility: Northome School	Date of Inspection: 8/7/25
Location: Northome, MN	Inspected by: Gopher Stage Lighting
Year Constructed or Equipment Installed: 1994	On Site Contacts: Nicole
Last Inspection Date: N/A	
Current Use:	Report Prepared by: Kevin Bieganek
Owner concerns:	
Current safety of stage equipment.	



Introduction

This report is a summary for a non-destructive/visual safety inspection for the theatrical rigging system in this facility.

<u>Note:</u> It is recommended that rigging system inspections be performed annually by qualified personnel or an outside "etcp certified" representative.

Use of an inspection and maintenance log is also suggested. Copies of these forms are attached to this report for your continued use.

Disclaimer: Gopher Stage Lighting does not represent, guarantee, or warrant, whether implied, any liability for unforeseen hidden defects not readily apparent during this visual inspection.




Non - Destructive Visual inspection of Stage Equipment.

<u>All Stage Equipment</u>, motorized (if present) and non-motorized, rigging points, termination hardware, fabrics, and track systems were visually inspected and operated. The following report contains current observations. *See reference next page.







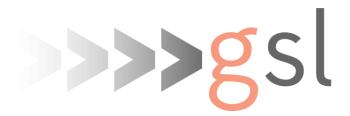

Page | 2



Non - Destructive Visual inspection of Stage Equipment.

S۱	/stem	and	eaui	pment	summary:
~	/366111	allu	Cyui		Julilliai y.

-,	, , , , , , , , , , , , , , , , , , ,			
□Counterweight Rigg	ing # Line Sets:	Manufactur	er:	
□Single □ Double	# Lift Lines:			
□CWT Assist Rigging	# Units: N/A	Manufactur	er: N/A	
□Line Shaft Hoist	# Units: N/A	Manufacture	er: N/A	
□Multi-Cable Hoist	# Units: N/A	Manufacture	er: N/A	
⊠Dead Hung Rigging	# Line Sets: 13	Manufacture	er: N/A	
☐Fire Curtain	Туре:	□Orchestra Pit Lift	Manufacturer: N/A	
□Orchestra Shell	⊠Curtain and Track	□Gymnasium Hoist	☑ Other: N/A	
□Pit Filler/Trap	# Electrics: N/A	☐ Other: N/A	Height of Steel: 14'	

*Please Note: This report is broken up into itemized groups according to their operational perspectives.

Each section or item inspected will be marked as follows:

Good – Good operating condition, no safety concerns and meets current industry standards.

Fair – Needs attention in the near future, Potential safety concern, does not meet current industry standards.

Poor – <u>Life safety liability concern</u>, requires immediate attention, does not meet current industry standards.



149 Thompson Ave E, STE 130 West St Paul, MN 55118 | ph 612. 871. 0138 toll free 877. 871. 0138 | fax 612.871.6532





6	4	8	
A		1	
	-		

Non - Destructive Visual inspection of Stage Equipment.

Dead Hung (DH) Rigging System and Components									
1.	DH Wire Rope/Chain	Co	ondition?			Comments	Photo	Line set#	
		NA	GOOD	FAIR	POOR				
Α	Wire Rope/Chains			\boxtimes		Replace all non-rated chain.			
В	Terminations			\boxtimes					
C	Adjustment Devices			\boxtimes					
D	Alignment/Fleet			\boxtimes					
2.	DH Battens	Co	nditio			Comments	Photo	Line Set#	
		NA	GOOD	FAIR	POOR				
Α	Battens	Ш	Ш	\boxtimes					
В	Splices			\boxtimes					
_									
3.	DH Electrics		nditio			Comments	Photo	Line Set#	
	SO Power Cable	NA	GOOD	FAIR	POOR				
A				\boxtimes					
В	Connector Strip			\boxtimes					
С	Cable Management			\boxtimes					
D	Safety Cables			\boxtimes					
4.	DH Other Components	Co	nditio	n?		Comments	Photo	Line Set#	
		NA	GOOD	FAIR	POOR				
Α	Manual hand winch				\boxtimes	As discussed. Disable system.			
В	Click here to enter text.								
C	Click here to enter text.								
D	Click here to enter text.								
	Dead Hung Rigging Systo	em -	Sumn	nary a	and Red	commendations			
	General maintenance of this system will keep it in good operational condition. Recommend								
	resolving the issues stated in this report.								
1									

149 Thompson Ave E, STE 130 West St Paul, MN 55118 | ph 612. 871. 0138 toll free 877. 871. 0138 | fax 612.871.6532 www.gopherstagelighting.com











Curtain and Track Elements


1.	Curtain and Track Ele		Condition?			Comments		Line Set#
	- Controlling	NA	GOOD	FAIR	POOR			
Α	Condition					Replace all – Does not meet current industry standards for fire safety.		
В	Flame Retardants (NFPA 705 test)				\boxtimes			
C	Travelers				\boxtimes			
D	Borders				\boxtimes			
Е	Legs				\boxtimes			
F	Scrims				\boxtimes			
G	Valance				\boxtimes			
Н	Cyclorama				\boxtimes			
I	Blackout				\boxtimes			
2.	Track			EAID	DOOD	Comments	Photo	
_	T	NA	GOOD	FAIR	POOR			
A	Tracks				片			
В	Track Hardware							
C	Components							
D	Curtain Machine							
Curtain and Track Elements – Summary and Recommendations								
		As	noted	•				

149 Thompson Ave E, STE 130 West St Paul, MN 55118 | ph 612. 871. 0138 toll free 877. 871. 0138 | fax 612.871.6532 www.gopherstagelighting.com







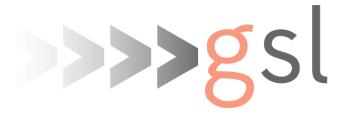

Page | 5



Conclusion.

The current condition of this theater appears to be in Good operating condition with **Life Safety/Liability Concerns**. Please consult with your rigging equipment / service provider for further discussion and possible solutions to the observations made in this report.

GSL *encourages* you to have annual safety inspections. It appears that the staff at this theater takes great pride in the safety, training, cleanliness and maintenance of the equipment and people who operate it. Keep up the great service you are providing, and we look forward to performing your next inspection.

If you have any further questions or concerns please feel free to contact Gopher Stage lighting at (877) 871-0138 or (612) 871-0138.

Thank you for the opportunity to perform this annual rigging and safety inspection.

Kevin H. Bieganek

ETCP Certified Rigger - Theater #1019
Inspections & Quotations Business Manager
Gopher Stage Lighting an employee owned company





